



Product Change Notification - SYST-17XJQD349

Date:

18 Feb 2020

Product Category:

Sigma - Delta A/D Converters

Affected CPNs:



Notification subject:

ERRATA - MCP346X/MCP356X Silicon Errata and Data Sheet Clarification

Notification text:

SYST-17XJQD349

Microchip has released a new Product Documents for the MCP346X/MCP356X Silicon Errata and Data Sheet Clarification of devices. If you are using one of these devices please read the document located at [MCP346X/MCP356X Silicon Errata and Data Sheet Clarification](#).

Notification Status: Final

Description of Change: 1) Updated Module 3: Internal Oscillator 2) Added Module 4: POR Events During Full-Shutdown Mode describing CHIPID corruption.

Impacts to Data Sheet: None

Reason for Change: To Improve Productivity

Change Implementation Status: Complete

Date Document Changes Effective: 18 Feb 2020

NOTE: Please be advised that this is a change to the document only the product has not been changed.

Markings to Distinguish Revised from Unrevised Devices: N/A

Attachment(s):

[MCP346X/MCP356X Silicon Errata and Data Sheet Clarification](#)

Please contact your local [Microchip sales office](#) with questions or concerns regarding this notification.

Terms and Conditions:

If you wish to [receive Microchip PCNs via email](#) please register for our PCN email service at our [PCN home page](#) select register then fill in the required fields. You will find instructions about registering for Microchips PCN email service in the [PCN FAQ](#) section.

If you wish to [change your PCN profile, including opt out](#), please go to the [PCN home page](#) select login and sign into your myMicrochip account. Select a profile option from the left navigation bar and make the applicable selections.

MCP3X6X Rev. B Silicon Errata and Data Sheet Clarification

The functionality of the MCP346x/356x Two/Four/Eight-Channel 16/24-Bit Delta-Sigma ADCs is described in the device Data Sheets ([DS20006180B](#) and [DS20006181B](#), respectively), except for the anomalies described below.

All of the issues listed here will be addressed in future revisions of the MCP346x/356x silicon.

Contact Microchip for the latest silicon fix.

Silicon Errata Issues

Note: This document summarizes all silicon errata issues from all revisions of silicon, previous as well as current. Applies to the current silicon revision (Rev. B).

1. Module: DIDD Current

When \overline{CS} is high (SPI inactive) the circuitry for SPI is still active and will consume approximately 26 $\mu\text{A}/\text{MHz}$ additional current per pin if either the SDI or SCK pins are toggling. This can occur when other devices on the same SPI bus are being addressed.

Work around

No work around at this time. While the instantaneous current draw is an additional 26 $\mu\text{A}/\text{MHz}$ of current, the overall system time-averaged current draw depends on the amount of time the SPI bus is active. If the SPI bus is only active 25% of the overall system operating time and operates at 5 MHz, the time-averaged current draw, as a result of this errata, becomes an additional 32.5 μA per pin.

2. Module: Data-Ready Events

A Data-Ready (\overline{DR}) Conversion complete event is indicated using three mechanisms:

1. The $\overline{DR_STATUS}$ bit in the SPI STATUS byte
2. The $\overline{DR_STATUS}$ bit in the IRQ Register
3. An \overline{IRQ} pin falling edge

If a \overline{DR} event occurs simultaneously within the transmission of a STATUS byte, between the second and eighth bits transmitted, the \overline{DR} event will be missed and not reflected in the transmission of a subsequent STATUS byte.

Similarly, if a \overline{DR} event occurs between the end of the Command Byte requesting a read of the IRQ Register and the transmission of the IRQ Register data-byte, the \overline{DR} event will be missed and not reflected in subsequent IRQ Register reads.

The \overline{IRQ} pin mechanism to indicate a \overline{DR} event is not affected by this errata.

Work around

A software/firmware workaround can be put in place to check the state of the $\overline{DR_STATUS}$ bits of the STATUS byte and of the IRQ Register within a single communication sequence. To do this, a read command of the IRQ Register must be executed.

During the transmission of the IRQ Register read command over SDI, a STATUS byte containing the state of the $\overline{DR_STATUS}$ bit is simultaneously transmitted over SDO. Continued clocking of the SCK pin transmits the data-byte of the IRQ Register containing the state of the $\overline{DR_STATUS}$ bit. Comparing the state of the $\overline{DR_STATUS}$ bit of the STATUS byte with the $\overline{DR_STATUS}$ bit of the IRQ Register determines if a new Data-Ready event has occurred.

If either mechanism indicates a $\overline{DR_STATUS}$ bit state of '0', new data is available and can be read from the ADCDATA Register. If neither mechanism indicates a $\overline{DR_STATUS}$ bit state of '0', no new data is available since the last check.

3. Module: Internal Oscillator

The Internal Oscillator PSRR and temperature coefficient can be significantly degraded when operating above 85°C.

Work around

It is recommended to write the code 0x900F00 at the register address 0xB before using the Internal Oscillator. If this workaround is not sufficient, an external clock is recommended.

4. Module: POR Events During Full-Shutdown Mode

Device CHIPID Bits can become corrupted if power-loss occurs while in Full-Shutdown mode. The CHIPID Bits determine the feature set of the device and corruption of these bits can cause unintended operational behavior of the device.

Work around

As explained in **Section 5.9 Full-Shutdown Mode** of the MCP346x/356x Data Sheet, the AV_{DD}/DV_{DD} voltage levels during power-down (when in Full-Shutdown mode) must reach a level of 100 mV or less, before power can be reapplied. If the application cannot comply with these power cycling requirements, then Full-Shutdown mode is not recommended as a power-saving mode. Instead, Partial-Shutdown mode is recommended where the POR monitoring circuits remain active, allowing the device to properly resume operation in case of a POR event.

Data Sheet Clarifications:

In the MCP346x/356x Data Sheets (DS20006180B and DS20006181B, respectively), the following clarifications and corrections should be noted:

- a) None to report at this time.

APPENDIX A: REVISION HISTORY

Rev. A Document (August 2019)

- Initial release of this document.

Rev B Document (February 2020)

- Updated Module 3: Internal Oscillator.
- Added Module 4: POR Events During Full-Shutdown Mode describing CHIPID corruption.

Note the following details of the code protection feature on Microchip devices:

- Microchip products meet the specification contained in their particular Microchip Data Sheet.
- Microchip believes that its family of products is one of the most secure families of its kind on the market today, when used in the intended manner and under normal conditions.
- There are dishonest and possibly illegal methods used to breach the code protection feature. All of these methods, to our knowledge, require using the Microchip products in a manner outside the operating specifications contained in Microchip's Data Sheets. Most likely, the person doing so is engaged in theft of intellectual property.
- Microchip is willing to work with the customer who is concerned about the integrity of their code.
- Neither Microchip nor any other semiconductor manufacturer can guarantee the security of their code. Code protection does not mean that we are guaranteeing the product as “unbreakable.”

Code protection is constantly evolving. We at Microchip are committed to continuously improving the code protection features of our products. Attempts to break Microchip's code protection feature may be a violation of the Digital Millennium Copyright Act. If such acts allow unauthorized access to your software or other copyrighted work, you may have a right to sue for relief under that Act.

Information contained in this publication regarding device applications and the like is provided only for your convenience and may be superseded by updates. It is your responsibility to ensure that your application meets with your specifications. MICROCHIP MAKES NO REPRESENTATIONS OR WARRANTIES OF ANY KIND WHETHER EXPRESS OR IMPLIED, WRITTEN OR ORAL, STATUTORY OR OTHERWISE, RELATED TO THE INFORMATION, INCLUDING BUT NOT LIMITED TO ITS CONDITION, QUALITY, PERFORMANCE, MERCHANTABILITY OR FITNESS FOR PURPOSE. Microchip disclaims all liability arising from this information and its use. Use of Microchip devices in life support and/or safety applications is entirely at the buyer's risk, and the buyer agrees to defend, indemnify and hold harmless Microchip from any and all damages, claims, suits, or expenses resulting from such use. No licenses are conveyed, implicitly or otherwise, under any Microchip intellectual property rights unless otherwise stated.

Trademarks

The Microchip name and logo, the Microchip logo, Adaptec, AnyRate, AVR, AVR logo, AVR Freaks, BesTime, BitCloud, chipKIT, chipKIT logo, CryptoMemory, CryptoRF, dsPIC, FlashFlex, flexPWR, HELDO, IGLOO, JukeBlox, KeeLoq, Klear, LANCheck, LinkMD, maXStylus, maXTouch, MediaLB, megaAVR, Microsemi, Microsemi logo, MOST, MOST logo, MPLAB, OptoLyzer, PackeTime, PIC, picoPower, PICSTART, PIC32 logo, PolarFire, Prochip Designer, QTouch, SAM-BA, SenGenuity, SpyNIC, SST, SST Logo, SuperFlash, Symmetricom, SyncServer, Tachyon, TempTrackr, TimeSource, tinyAVR, UNI/O, Vectron, and XMEGA are registered trademarks of Microchip Technology Incorporated in the U.S.A. and other countries.

APT, ClockWorks, The Embedded Control Solutions Company, EtherSynch, FlashTec, Hyper Speed Control, HyperLight Load, IntelliMOS, Libero, motorBench, mTouch, Powermite 3, Precision Edge, ProASIC, ProASIC Plus, ProASIC Plus logo, Quiet-Wire, SmartFusion, SyncWorld, Temux, TimeCesium, TimeHub, TimePictra, TimeProvider, Vite, WinPath, and ZL are registered trademarks of Microchip Technology Incorporated in the U.S.A.

Adjacent Key Suppression, AKS, Analog-for-the-Digital Age, Any Capacitor, AnyIn, AnyOut, BlueSky, BodyCom, CodeGuard, CryptoAuthentication, CryptoAutomotive, CryptoCompanion, CryptoController, dsPICDEM, dsPICDEM.net, Dynamic Average Matching, DAM, ECAN, EtherGREEN, In-Circuit Serial Programming, ICSP, INICnet, Inter-Chip Connectivity, JitterBlocker, KlearNet, KlearNet logo, memBrain, Mindi, MiWi, MPASM, MPF, MPLAB Certified logo, MPLIB, MPLINK, MultiTRAK, NetDetach, Omniscient Code Generation, PICDEM, PICDEM.net, PICKit, PICtail, PowerSmart, PureSilicon, QMatrix, REAL ICE, Ripple Blocker, SAM-ICE, Serial Quad I/O, SMART-I.S., SQI, SuperSwitcher, SuperSwitcher II, Total Endurance, TSHARC, USBCheck, VariSense, ViewSpan, WiperLock, Wireless DNA, and ZENA are trademarks of Microchip Technology Incorporated in the U.S.A. and other countries.

SQTP is a service mark of Microchip Technology Incorporated in the U.S.A.

The Adaptec logo, Frequency on Demand, Silicon Storage Technology, and Symmcom are registered trademarks of Microchip Technology Inc. in other countries.

GestIC is a registered trademark of Microchip Technology Germany II GmbH & Co. KG, a subsidiary of Microchip Technology Inc., in other countries.

All other trademarks mentioned herein are property of their respective companies.

© 2019-2020, Microchip Technology Incorporated, All Rights Reserved.

ISBN: 978-1-5224-5631-5

For information regarding Microchip's Quality Management Systems, please visit www.microchip.com/quality.



MICROCHIP

Worldwide Sales and Service

AMERICAS

Corporate Office
2355 West Chandler Blvd.
Chandler, AZ 85224-6199
Tel: 480-792-7200
Fax: 480-792-7277
Technical Support:
<http://www.microchip.com/support>
Web Address:
www.microchip.com

Atlanta

Duluth, GA
Tel: 678-957-9614
Fax: 678-957-1455

Austin, TX

Tel: 512-257-3370

Boston

Westborough, MA
Tel: 774-760-0087
Fax: 774-760-0088

Chicago

Itasca, IL
Tel: 630-285-0071
Fax: 630-285-0075

Dallas

Addison, TX
Tel: 972-818-7423
Fax: 972-818-2924

Detroit

Novi, MI
Tel: 248-848-4000

Houston, TX

Tel: 281-894-5983

Indianapolis

Noblesville, IN
Tel: 317-773-8323
Fax: 317-773-5453
Tel: 317-536-2380

Los Angeles

Mission Viejo, CA
Tel: 949-462-9523
Fax: 949-462-9608
Tel: 951-273-7800

Raleigh, NC

Tel: 919-844-7510

New York, NY

Tel: 631-435-6000

San Jose, CA

Tel: 408-735-9110
Tel: 408-436-4270

Canada - Toronto

Tel: 905-695-1980
Fax: 905-695-2078

ASIA/PACIFIC

Australia - Sydney
Tel: 61-2-9868-6733

China - Beijing
Tel: 86-10-8569-7000

China - Chengdu
Tel: 86-28-8665-5511

China - Chongqing
Tel: 86-23-8980-9588

China - Dongguan
Tel: 86-769-8702-9880

China - Guangzhou
Tel: 86-20-8755-8029

China - Hangzhou
Tel: 86-571-8792-8115

China - Hong Kong SAR
Tel: 852-2943-5100

China - Nanjing
Tel: 86-25-8473-2460

China - Qingdao
Tel: 86-532-8502-7355

China - Shanghai
Tel: 86-21-3326-8000

China - Shenyang
Tel: 86-24-2334-2829

China - Shenzhen
Tel: 86-755-8864-2200

China - Suzhou
Tel: 86-186-6233-1526

China - Wuhan
Tel: 86-27-5980-5300

China - Xian
Tel: 86-29-8833-7252

China - Xiamen
Tel: 86-592-2388138

China - Zhuhai
Tel: 86-756-3210040

ASIA/PACIFIC

India - Bangalore
Tel: 91-80-3090-4444

India - New Delhi
Tel: 91-11-4160-8631

India - Pune
Tel: 91-20-4121-0141

Japan - Osaka
Tel: 81-6-6152-7160

Japan - Tokyo
Tel: 81-3-6880-3770

Korea - Daegu
Tel: 82-53-744-4301

Korea - Seoul
Tel: 82-2-554-7200

Malaysia - Kuala Lumpur
Tel: 60-3-7651-7906

Malaysia - Penang
Tel: 60-4-227-8870

Philippines - Manila
Tel: 63-2-634-9065

Singapore
Tel: 65-6334-8870

Taiwan - Hsin Chu
Tel: 886-3-577-8366

Taiwan - Kaohsiung
Tel: 886-7-213-7830

Taiwan - Taipei
Tel: 886-2-2508-8600

Thailand - Bangkok
Tel: 66-2-694-1351

Vietnam - Ho Chi Minh
Tel: 84-28-5448-2100

EUROPE

Austria - Wels
Tel: 43-7242-2244-39
Fax: 43-7242-2244-393

Denmark - Copenhagen
Tel: 45-4450-2828
Fax: 45-4485-2829

Finland - Espoo
Tel: 358-9-4520-820

France - Paris
Tel: 33-1-69-53-63-20
Fax: 33-1-69-30-90-79

Germany - Garching
Tel: 49-8931-9700

Germany - Haan
Tel: 49-2129-3766400

Germany - Heilbronn
Tel: 49-7131-72400

Germany - Karlsruhe
Tel: 49-721-625370

Germany - Munich
Tel: 49-89-627-144-0
Fax: 49-89-627-144-44

Germany - Rosenheim
Tel: 49-8031-354-560

Israel - Ra'anana
Tel: 972-9-744-7705

Italy - Milan
Tel: 39-0331-742611
Fax: 39-0331-466781

Italy - Padova
Tel: 39-049-7625286

Netherlands - Drunen
Tel: 31-416-690399
Fax: 31-416-690340

Norway - Trondheim
Tel: 47-7288-4388

Poland - Warsaw
Tel: 48-22-3325737

Romania - Bucharest
Tel: 40-21-407-87-50

Spain - Madrid
Tel: 34-91-708-08-90
Fax: 34-91-708-08-91

Sweden - Gothenberg
Tel: 46-31-704-60-40

Sweden - Stockholm
Tel: 46-8-5090-4654

UK - Wokingham
Tel: 44-118-921-5800
Fax: 44-118-921-5820

SYST-17XJQD349 - ERRATA - MCP346X/MCP356X Silicon Errata and Data Sheet Clarification

Affected Catalog Part Numbers(CPN)

MCP3461-E/ST
MCP3461T-E/NC
MCP3461T-E/ST
MCP3462-E/ST
MCP3462T-E/NC
MCP3462T-E/ST
MCP3464-E/ST
MCP3464T-E/NC
MCP3464T-E/ST
MCP3561-E/ST
MCP3561T-E/NC
MCP3561T-E/ST
MCP3562-E/ST
MCP3562T-E/NC
MCP3562T-E/ST
MCP3564-E/ST
MCP3564T-E/NC
MCP3564T-E/ST