

Information note

N° 10342AERRA

Dear customer,

With this Infineon Technologies AG information note, we would like to inform you about the following

Errata affecting products TLE986x and TLE987x



On 16 April 2020, Infineon acquired Cypress. We are now in the process of merging and consolidating our tools and processes for PCN, Information Notes, Errata and Product Discontinuance. For further details, please visit our website: <https://www.infineon.com/cms/en/about-infineon/company/cypress-acquisition/>

Infineon Technologies AG

Postal address D-81726 München Internet www.infineon.com Headquarters Am Campeon 1-15, D-85579 Neubiberg Phone +49 (0)89 234-0

Chairman of the Supervisory Board Dr. Wolfgang Eder

Management Board Jochen Hanebeck (CEO), Constanze Hufenbecher, Dr. Sven Schneider, Andreas Urschitz, Dr. Rutger Wijburg

Registered office Neubiberg Commercial register Amtsgericht München HRB 12649

Information note

N° 10342AERRA

- ▶ **Products affected** Please refer to attached affected product list 1_cip10342

- ▶ **Detailed change information**

Subject	Errata affecting products TLE986x and TLE987x	
Reason	<p>With this Errata, former Errata IN 092/19 becomes obsolete. An issue affecting the UH step has been added in the Errata sheet, which might have an impact on the user software in the application.</p> <p>The Errata sheet has been updated, removing several items of the previous version that have been solved with the release of the last data sheet and user manual versions.</p>	
Description	<u>Old</u>	<u>New</u>
Errata sheet	■ Rev. 1.2	■ Rev. 1.3

- ▶ **Product identification** Not applicable (no change of product)

- ▶ **Impact of change** Assessment in application required!

- ▶ **Attachments**
 - 1_cip10342 affected product list
 - 3_cip10342 errata sheet (MyICP [link](#))

- ▶ **Intended start of delivery** Not applicable, valid with immediate effect.

If you have any questions, please do not hesitate to contact your local sales office.

TLE986xQX Family - BF and UH steps TLE987xQX Family - BF and UH steps

Overview

This document lists the errata of the TLE986xQX family and the TLE987xQX family.

It is strongly recommended that the device behavior and possible proposed workarounds are considered for the application.

Referenced documents:

Table 1 Reference documents

Document type	Document reference	Issue date
Datasheet	See Table 2	
User Manual	Infineon-TLE986x-UM-v01_70-EN.pdf	2022-03-11
User Manual	Infineon-TLE987x-UM-v01_70-EN.pdf	2022-03-11
BootROM User Manual	Infineon-TLE986x_TLE987x-BootROM-UM-v01_70-EN.pdf	2022-03-21

Affected products, BF and UH steps only:

Table 2 List of affected products

Device	Reference datasheet	Issue date
TLE9861QXA20	Infineon-TLE9861QXA20-DS-v02_00-EN.pdf	2022-04-14
TLE9867QXA20	Infineon-TLE9867QXA20-DS-v02_00-EN.pdf	2022-04-14
TLE9867QXA40	Infineon-TLE9867QXA40-DS-v02_00-EN.pdf	2022-04-14
TLE9867QXW20	Infineon-TLE9867QXW20-DS-v02_00-EN.pdf	2022-04-14
TLE9868QXB20	Infineon-TLE9868QXB20-DS-v02_00-EN.pdf	2022-04-14
TLE9869QXA20	Infineon-TLE9869QXA20-DS-v02_00-EN.pdf	2022-04-14
TLE9871QXA20	Infineon-TLE9871QXA20-DS-v02_00-EN.pdf	2022-04-14
TLE9873QXW40	Infineon-TLE9873QXW40-DS-v02_00-EN.pdf	2022-04-14
TLE9877QXA40	Infineon-TLE9877QXA40-DS-v02_00-EN.pdf	2022-04-14
TLE9877QXW40	Infineon-TLE9877QXW40-DS-v02_00-EN.pdf	2022-04-14
TLE9879QXA40	Infineon-TLE9879QXA40-DS-v02_00-EN.pdf	2022-04-14
TLE9879QXW40	Infineon-TLE9879QXW40-DS-v02_00-EN.pdf	2022-04-14
TLE9879-2QXA40	Infineon-TLE9879_2QXA40-DS-v02_00-EN.pdf	2022-04-14

Table of contents

1	Product errata	3
1.1	PORT2 CTRAP active level (0000057330-1)	3
1.1.1	Planned fixes	3
1.2	RESET pin pull-up (0000057330-4)	4
1.2.1	Planned fixes	4
1.3	BootROM USER_ERASE_SECTOR, USER_ERASEPG, and USER_PROG (0000062134-25)	5
1.3.1	Workaround	5
1.3.2	Planned fixes	5
2	Latest documentation information	6
2.1	ADC1 accuracy (0000057330-8)	6
2.2	ADC2 accuracy (0000057330-9)	6
2.3	DC parameters of Port 0, Port 1, TMS and Reset (0000057330-11)	6
3	Revision history	7

Product errata

1 Product errata

This chapter lists the errata of the referenced products and documentation.

1.1 PORT2 CTRAP active level (000057330-1)

Specified

In the “Port 2 Input Functions” table the P2.3 - CTRAP#_1 alternate function is specified to be a high-active input.

Table 10 Port 2 Input Functions

Port Pin	Input/Output	Select	Connected Signal(s)	From/to Module
P2.1	Input	GPI	P2_DATA.P1	
		INP1	CCPOS0_0	CCU6
		INP2	T5INB	GPT12T5
		INP3	T12HR_1	CCU6
		INP4	T5EUDB	GPT12T5
		INP5	CC61_1	CCU6
		ANALOG	AN1	ADC
P2.3	Input	GPI	P2_DATA.P3	
		INP1	CCPOS1_0	CCU6
		INP2	T3IND	GPT12T3
		INP3	CTRAP#_1	CCU6
		INP4	T21EX_2	Timer 21
		INP5	CC60_1	CCU6
		INP6	EXINT0_3	SCU
		ANALOG	AN3	ADC

Figure 1 Extraction from Table 10, specified

Implemented

The P2.3 - CTRAP#_1 alternate function is implemented to be low-active.

Table 10 Port 2 Input Functions

Port Pin	Input/Output	Select	Connected Signal(s)	From/to Module
P2.1	Input	GPI	P2_DATA.P1	
		INP1	CCPOS0_0	CCU6
		INP2	T5INB	GPT12T5
		INP3	T12HR_1	CCU6
		INP4	T5EUDB	GPT12T5
		INP5	CC61_1	CCU6
		ANALOG	AN1	ADC
P2.3	Input	GPI	P2_DATA.P3	
		INP1	CCPOS1_0	CCU6
		INP2	T3IND	GPT12T3
		INP3	CTRAP#_1	CCU6
		INP4	T21EX_2	Timer 21
		INP5	CC60_1	CCU6
		INP6	EXINT0_3	SCU
		ANALOG	AN3	ADC

Figure 2 Extraction from Table 10, implemented

1.1.1 Planned fixes

Fix with next user documentation update.

Product errata

1.2 RESET pin pull-up (0000057330-4)

Specified

Figure 3 shows an extraction of Table 2 of the “Pin Definitions and Functions”. The column “Reset State” defines the state of the pin in the reset condition of the device.

Table 2 Pin Definitions and Functions

Symbol	Pin Number	Type	Reset State ¹⁾	Function
RESET	22	I/O	–	Reset input, not available during Sleep Mode

Figure 3 Extraction of Table 2, specified RESET pin conditions

Implemented

Figure 4 shows an extraction of Table 2 of the “Pin Definitions and Functions”. In the device reset condition the RESET pin is either being pulled low from external or driven low from internal, the device furthermore implements an internal pull-up which prevents the RESET pin from floating.

Table 2 Pin Definitions and Functions

Symbol	Pin Number	Type	Reset State ¹⁾	Function
RESET	22	I/O	PU	Reset input, not available during Sleep Mode

Figure 4 Extraction of Table 2, implemented RESET pin conditions

1.2.1 Planned fixes

Fix with next user documentation update.

Product errata

**1.3 BootROM USER_ERASE_SECTOR, USER_ERASEPG, and USER_PROG
(0000062134-25)**

Scope

This erratum applies only to UH steps.

Implemented

The USER_ERASE_SECTOR, USER_ERASEPG, and USER_PROG routines make use of the RAM byte at 0x18000014. Any data being stored there is overwritten.

1.3.1 Workaround

The user code must not use the RAM location 0x18000014.

1.3.2 Planned fixes

Fix to be implemented in the next design step.

2 Latest documentation information

This chapter provides extended information on referenced documentation.

2.1 ADC1 accuracy (000057330-8)

The accuracies stated include the ADC1 total unadjusted error (TUE_{10B}) which includes the V_{AREF} tolerance. This applies to the following specification items:

- P_8.1.39
- P_8.1.71
- P_8.1.74
- P_8.1.77¹⁾
- P_8.1.78¹⁾
- P_8.1.80¹⁾

2.2 ADC2 accuracy (000057330-9)

The accuracies stated include the following tolerance:

- ADC2 offset error - P_8.3.19
- ADC2 gain error - P_8.3.20
- ADC2 differential non-linearity error - P_8.3.28¹⁾
- ADC2 integral non-linearity error - P_8.3.29¹⁾
- V_{BG} - P_8.3.1

This applies to the following specification items:

- P_8.1.70
- P_8.1.73
- P_8.1.44
- P_8.1.47
- P_8.1.62
- P_8.1.68
- P_8.1.5
- P_8.1.48
- P_8.1.6
- P_8.2.5
- P_8.2.6
- P_8.2.7
- P_8.1.75¹⁾

2.3 DC parameters of Port 0, Port 1, TMS and Reset (000057330-11)

Table 31 in the referenced datasheet applies as well to TMS and Reset.

1) Applies to Grade 0 devices only.

Revision history

3 Revision history

Revision	Date	Changes
1.0	2017-05-17	Errata obsolete
1.1	2018-05-02	Errata obsolete
		ADC1 Accuracy Addendum
		ADC2 Accuracy Addendum
1.2	2019-09-17	BootROM - USER_NVM_ECC_CHECK (0000048454-124) added
		PORT2 CTRAP active level (0000057330-1) added
		CPU->SHPR2 wrong address (0000057330-2) added
		MON wake-up/monitoring threshold voltage (0000048438-7) added
		SCU->OSC_CON Bit5 (0000057330-3) added
		RESET pin pull-up (0000057330-4) added
		Operation amplifier (0000057330-10) added
		DC parameters of Port 0, Port 1, TMS and Reset (0000057330-11) added
		ADC1 accuracy (0000057330-8) added
		ADC2 accuracy (0000057330-9) added
1.3	2022-06-03	BootROM - USER_NVM_ECC_CHECK (0000048454-124) obsolete
		CPU->SHPR2 wrong address (0000057330-2) obsolete
		MON wake-up/monitoring threshold voltage (0000048438-7) obsolete
		SCU->OSC_CON Bit5 (0000057330-3) obsolete
		BootROM USER_ERASE_SECTOR, USER_ERASEPG, and USER_PROG (0000062134-25) added
		Operational amplifier (0000057330-10) obsolete

Trademarks of Infineon Technologies AG

All referenced product or service names and trademarks are the property of their respective owners.

Edition 2022-06-03

**Published by
Infineon Technologies AG
81726 Munich, Germany**

**© 2022 Infineon Technologies AG.
All Rights Reserved.**

**Do you have a question about any
aspect of this document?
Email: erratum@infineon.com**

IMPORTANT NOTICE

The information contained in this document is given as a hint for the implementation of the product only and shall in no event be regarded as a description or warranty of a certain functionality, condition or quality of the product. Before implementation of the product, the recipient of this document must verify any function and other technical information given herein in the real application. Infineon Technologies hereby disclaims any and all warranties and liabilities of any kind (including without limitation warranties of non-infringement of intellectual property rights of any third party) with respect to any and all information given in this document.

The data contained in this document is exclusively intended for technically trained staff. It is the responsibility of customer's technical departments to evaluate the suitability of the product for the intended application and the completeness of the product information given in this document with respect to such application.

For further information on technology, delivery terms and conditions and prices, please contact the nearest Infineon Technologies Office (www.infineon.com).

WARNINGS

Due to technical requirements products may contain dangerous substances. For information on the types in question please contact your nearest Infineon Technologies office.

Except as otherwise explicitly approved by Infineon Technologies in a written document signed by authorized representatives of Infineon Technologies, Infineon Technologies' products may not be used in any applications where a failure of the product or any consequences of the use thereof can reasonably be expected to result in personal injury.

Errata 10342AERRA

Errata affecting products TLE986x and TLE987x

Sales name	SP number	OPN	Package
TLE9861QXA20	SP001583362	TLE9861QXA20XUMA2	PG-VQFN-48-31
TLE9867QXA20	SP001583368	TLE9867QXA20XUMA2	PG-VQFN-48-31
TLE9867QXA40	SP001583374	TLE9867QXA40XUMA2	PG-VQFN-48-31
TLE9867QXW20	SP001380954	TLE9867QXW20XUMA1	PG-VQFN-48-29
TLE9868QXB20	SP001404498	TLE9868QXB20XUMA2	PG-VQFN-48-31
TLE9869QXA20	SP001583382	TLE9869QXA20XUMA2	PG-VQFN-48-31
TLE9871QXA20	SP001583398	TLE9871QXA20XUMA2	PG-VQFN-48-31
TLE9873QXW40	SP001380956	TLE9873QXW40XUMA1	PG-VQFN-48-29
TLE9877QXA40	SP001583424	TLE9877QXA40XUMA2	PG-VQFN-48-31
TLE9877QXW40	SP001380958	TLE9877QXW40XUMA1	PG-VQFN-48-29
TLE9879-2QXA40	SP001611352	TLE98792QXA40XUMA1	PG-VQFN-48-31
TLE9879QXA40	SP001583434	TLE9879QXA40XUMA2	PG-VQFN-48-31
TLE9879QXW40	SP001380960	TLE9879QXW40XUMA1	PG-VQFN-48-29