



## Product Change Notification / SYST-14GLUM074

---

**Date:**

16-Jun-2022

**Product Category:**

8-bit Microcontrollers

**PCN Type:**

Document Change

**Notification Subject:**

ERRATA - PIC16F15213/14/23/24/43/44 Silicon Errata and Data Sheet Clarifications Document Revision

**Affected CPNs:**

[SYST-14GLUM074\\_Affected\\_CPN\\_06162022.pdf](#)

[SYST-14GLUM074\\_Affected\\_CPN\\_06162022.csv](#)

**Notification Text:**

SYST-14GLUM074

Microchip has released a new Errata for the PIC16F15213/14/23/24/43/44 Silicon Errata and Data Sheet Clarifications of devices. If you are using one of these devices please read the document located at [PIC16F15213/14/23/24/43/44 Silicon Errata and Data Sheet Clarifications](#).

**Notification Status:** Final

**Description of Change:** Updated DS revision letter to 'E' to match DS revision.

**Impacts to Data Sheet:** None

**Reason for Change:** To Improve Productivity

**Change Implementation Status:** Complete

**Date Document Changes Effective:** 16 Jun 2022

**NOTE:** Please be advised that this is a change to the document only the product has not been changed.

**Markings to Distinguish Revised from Unrevised Devices:** N/A

## **Attachments:**

[PIC16F15213/14/23/24/43/44 Silicon Errata and Data Sheet Clarifications](#)

Please contact your local [Microchip sales office](#) with questions or concerns regarding this notification.

## **Terms and Conditions:**

If you wish to receive Microchip PCNs via email please register for our PCN email service at our [PCN home page](#) select register then fill in the required fields. You will find instructions about registering for Microchips PCN email service in the [PCN FAQ](#) section.

If you wish to change your PCN profile, including opt out, please go to the [PCN home page](#) select login and sign into your myMicrochip account. Select a profile option from the left navigation bar and make the applicable selections.



# PIC16F15213/14/23/24/43/44

## PIC16F15213/14/23/24/43/44 Silicon Errata and Data Sheet Clarifications

The PIC16F15213/14/23/24/43/44 devices that you have received conform functionally to the current device data sheet (DS40002195E), except for the anomalies described in this document.

The silicon issues discussed in the following pages are for silicon revisions with the Device and Revision IDs listed in the table below.

The errata described in this document will be addressed in future revisions of the PIC16F15213/14/23/24/43/44 silicon.

**Note:** This document summarizes all silicon errata issues from all revisions of silicon, previous as well as current.

**Table 1. Silicon Device Identification**

| Part Number | Device ID | Revision ID |        |        |
|-------------|-----------|-------------|--------|--------|
|             |           | A3          | A5     | A6     |
| PIC16F15213 | 0x30E3    | 0x2003      | 0x2005 | 0x2006 |
| PIC16F15214 | 0x30E6    | 0x2003      | 0x2005 | 0x2006 |
| PIC16F15223 | 0x30E4    | 0x2003      | 0x2005 | 0x2006 |
| PIC16F15224 | 0x30E7    | 0x2003      | 0x2005 | 0x2006 |
| PIC16F15243 | 0x30E5    | 0x2003      | 0x2005 | 0x2006 |
| PIC16F15244 | 0x30E8    | 0x2003      | 0x2005 | 0x2006 |

## Silicon Issue Summary

Table 2. Silicon Issue Summary

| Module  | Feature                           | Item No. | Issue Summary   | Affected Revisions |    |    |
|---|-----------------------------------|----------|---|--------------------|----|----|
|   |                                   |          |   | A3                 | A5 | A6 |
| Nonvolatile Memory (NVM)  | Self-write operation              | 1.1.1    | Self-write operation may not work above 85°C with V <sub>DD</sub> above 5.3V                      | X                  |    |    |
| Pulse-Width Modulation (PWM)  | PWM mode                          | 1.2.1    | Duty cycle values are incorrect   | X                  | X  | X  |
| Enhanced Universal Synchronous Asynchronous Receiver Transmitter (EUSART) | Transmit mode                     | 1.3.1    | Possible duplicate byte transmitted   | X                  | X  | X  |
| Host Synchronous Serial Port (MSSP)                                       | Start and Stop interrupt function | 1.4.1    | A race condition can cause the Start and/or Stop flags to be set when I <sup>2</sup> C is enabled | X                  | X  | X  |
| In-Circuit Serial Programming™  | Low-Voltage Programming           | 1.5.1    | Low-Voltage Programming is not possible when V <sub>DD</sub> is below BORV while BOR is enabled   | X                  | X  | X  |
| Watchdog Timer (WDT)  | Watchdog Timer Reset              | 1.6.1    | WDT reset may not work properly while device is not in Sleep                                      | X                  | X  | X  |

**Note:** Only those issues indicated in the last column apply to the current silicon revision.

# 1. Silicon Errata Issues

**CAUTION** Notice: This document summarizes all silicon errata issues from all revisions of silicon, previous as well as current. Only the issues indicated by the bold font in the following tables apply to the current silicon revision.

## 1.1 Module: Nonvolatile Memory (NVM)

### 1.1.1 Self-Write Operation

When performing self-write operations at 85°C or above, the writes may not occur at  $V_{DD}$  voltages above 5.3V.

**Work around**

Perform self-write operations at a temperature below 85°C while operating at  $V_{DD}$  voltages above 5.3V.

**Affected Silicon Revisions**

| A3 | A5 | A6 |  |  |  |  |  |
|----|----|----|--|--|--|--|--|
| X  |    |    |  |  |  |  |  |

## 1.2 Module: Pulse-Width Modulation (PWM)

### 1.2.1 Wrong Duty Cycle for CCP Module

While in PWM mode and the Timer2 prescaler is configured to 1:1, the duty cycle of the PWM output is as expected. When the Timer2 prescaler is changed to a value other than 1:1, while  $T2PR = 0$  (PWM resolution of two bits), the expected duty cycle is wrong. The corrected duty cycle values are shown in the table below.

**Table 1-1. Corrected Duty Cycle Values**

| Prescaler/CCPR | 0   | 1   | 2   | 3   | 4    |
|----------------|-----|-----|-----|-----|------|
| 1:1            | 0%  | 25% | 50% | 75% | 100% |
| 1:2            | 50% | 75% | 50% | 75% | 100% |
| 1:4...1:128    | 75% | 75% | 75% | 75% | 100% |

**Work around**

None.

**Affected Silicon Revisions**

| A3 | A5 | A6 |  |  |  |  |  |
|----|----|----|--|--|--|--|--|
| X  | X  | X  |  |  |  |  |  |

### 1.3 Module: Enhanced Universal Synchronous Asynchronous Receiver Transmitter (EUSART)

#### 1.3.1 Double Byte Transmit

Under certain conditions, a byte written to the TXREG register can be transmitted twice. This happens when a byte is written to TXREG just as the TSR register becomes empty. This new byte is immediately transferred to the TSR register, but also remains in the TXREG register until the completion of the current instruction cycle. If the new byte in the TSR register is transmitted before this instruction cycle has completed, the duplicate in the TXREG register will subsequently be transferred to the TSR register on the following instruction clock cycle and transmitted.

#### Work around

Method 1: Monitor the Transmit Interrupt Flag (TXIF) bit. Writes to the TXREG register can be performed once the TXIF bit is set, indicating that the TXREG register is empty. If using this method, ensure that the second byte is filled in the TXREG before bit 6 of the first byte is transmitted. If the delay is more than six bit times, there is a possibility of double byte transmission.

Method 2: Monitor the TMRT bit of the TXxSTA register. Writes to the TXREG register can be performed once the TMRT bit is set, indicating that the Transmit Shift Register (TSR) is empty. This work around can be applied if back-to-back transmissions are not necessary.

#### Affected Silicon Revisions

| A3 | A5 | A6 |  |  |  |  |  |
|----|----|----|--|--|--|--|--|
| X  | X  | X  |  |  |  |  |  |

### 1.4 Module: Host Synchronous Serial Port (MSSP)

#### 1.4.1 The I<sup>2</sup>C Start and/or Stop Flags May Be Set When I<sup>2</sup>C Is Enabled

When I<sup>2</sup>C is enabled, erroneous Start and/or Stop conditions may be detected. This can generate erroneous I<sup>2</sup>C interrupts if enabled.

#### Work around

Use the following procedure to correctly detect the Start and Stop conditions:

1. Disable the Start and Stop conditions interrupt functions.
2. Enable the I<sup>2</sup>C module.
3. Wait 250 ns + six instructions cycles ( $F_{OSC}/4$ ).
4. Clear the Start and Stop conditions interrupt flags.
5. Enable the Start and Stop conditions interrupt functions if used.

```

SSPxCON3bits.SCIE = 0;           // Disable Start condition interrupt
SSPxCON3bits.PCIE = 0;           // Disable Stop condition interrupt
SSPxCON1bits.SSPEN = 1;          // Enable I2C
Delay();                          // Wait for 250 ns + 6 instruction cycles (FOSC/4)
PIRxbits.SSPxIF = 0;            // Clear the MSSP interrupt flag
SSPxCON3bits.SCIE = 1;           // Enable Start condition interrupt if used
SSPxCON3bits.PCIE = 1;           // Enable Stop condition interrupt if used
    
```

#### Affected Silicon Revisions

| A3 | A5 | A6 |  |  |  |  |  |
|----|----|----|--|--|--|--|--|
| X  | X  | X  |  |  |  |  |  |

## 1.5 Module: Low-Voltage In-Circuit Serial Programming™ (LVP)

### 1.5.1 Low-Voltage Programming Not Possible

Low-Voltage Programming is not possible when  $V_{DD}$  is below the selected BORV voltage level, while BOR is enabled.

#### Work around

Method 1: Disable BOR to use Low-Voltage Programming.

Method 2: Raise  $V_{DD}$  above the selected BORV level while using Low-Voltage Programming.

#### Affected Silicon Revisions

| A3 | A5 | A6 |  |  |  |  |  |
|----|----|----|--|--|--|--|--|
| X  | X  | X  |  |  |  |  |  |

## 1.6 Module: Watchdog Timer (WDT)

### 1.6.1 Watchdog Timer Reset

The Watchdog Timer (WDT) Reset feature may not work properly outside of Sleep mode. Reliance on WDT Reset while executing a program is not recommended. Operation in Sleep is not impacted by this errata.

#### Work around

Use an independent timer to emulate a watchdog feature, outside of Sleep mode, using the following steps:

1. Configure the chosen timer for the desired timeout period
2. Enable the timer interrupt
3. Enable Peripheral and Global interrupts
4. Enable the timer, which starts the count
5. At the end of the Main loop, restore the timer values
6. If the timer interrupt occurs, issue a RESET command

A code example using Timer1 is shown below.

```

void __interrupt() isr(void)
{
    if( TMR1IF && TMR1IE )
    {
        asm("RESET");
    }
}

void main(void)
{
    configure_TMR1();
    GIE = 1;
    PEIE = 1;

    T1CONbits.ON = 1;

    while(1)
    {
        // user code here
        restore_TMR1();
    }
}

```

# PIC16F15213/14/23/24/43/44

## Silicon Errata Issues

---

---

### Affected Silicon Revisions

| A3 | A5 | A6 |  |  |  |  |  |
|----|----|----|--|--|--|--|--|
| X  | X  | X  |  |  |  |  |  |



## **2. Data Sheet Clarifications**

The following typographic corrections and clarifications are to be noted for the latest version of the device data sheet (DS40002195E):

**Note:**

Corrections are shown in **bold**. Where possible, the original bold text formatting has been removed for clarity.

### **2.1 None**

There are no known data sheet clarifications as of this publication date.

**3. Appendix A: Revision History**

| Doc. Rev. | Date    | Comments   |
|-----------|---------|--|
| F         | 6/2022  | Updated DS revision letter to 'E' to match DS revision.                    |
| E         | 5/2022  | Added silicon errata item 1.6.1.   |
| D         | 10/2021 | Updated Table 2. Added silicon errata items 1.2.1, 1.3.1, 1.4.1 and 1.5.1. |
| C         | 2/2021  | Added silicon revision A6  |
| B         | 10/2020 | Adding silicon revision A5   |
| A         | 9/2020  | Initial document release   |

---

## Microchip Information

---

### The Microchip Website

---

Microchip provides online support via our website at [www.microchip.com/](http://www.microchip.com/). This website is used to make files and information easily available to customers. Some of the content available includes:

- **Product Support** – Data sheets and errata, application notes and sample programs, design resources, user's guides and hardware support documents, latest software releases and archived software
- **General Technical Support** – Frequently Asked Questions (FAQs), technical support requests, online discussion groups, Microchip design partner program member listing
- **Business of Microchip** – Product selector and ordering guides, latest Microchip press releases, listing of seminars and events, listings of Microchip sales offices, distributors and factory representatives

### Product Change Notification Service

---

Microchip's product change notification service helps keep customers current on Microchip products. Subscribers will receive email notification whenever there are changes, updates, revisions or errata related to a specified product family or development tool of interest.

To register, go to [www.microchip.com/pcn](http://www.microchip.com/pcn) and follow the registration instructions.

### Customer Support

---

Users of Microchip products can receive assistance through several channels:

- Distributor or Representative
- Local Sales Office
- Embedded Solutions Engineer (ESE)
- Technical Support

Customers should contact their distributor, representative or ESE for support. Local sales offices are also available to help customers. A listing of sales offices and locations is included in this document.

Technical support is available through the website at: [www.microchip.com/support](http://www.microchip.com/support)

### Microchip Devices Code Protection Feature

---

Note the following details of the code protection feature on Microchip products:

- Microchip products meet the specifications contained in their particular Microchip Data Sheet.
- Microchip believes that its family of products is secure when used in the intended manner, within operating specifications, and under normal conditions.
- Microchip values and aggressively protects its intellectual property rights. Attempts to breach the code protection features of Microchip product is strictly prohibited and may violate the Digital Millennium Copyright Act.
- Neither Microchip nor any other semiconductor manufacturer can guarantee the security of its code. Code protection does not mean that we are guaranteeing the product is "unbreakable". Code protection is constantly evolving. Microchip is committed to continuously improving the code protection features of our products.

### Legal Notice

---

This publication and the information herein may be used only with Microchip products, including to design, test, and integrate Microchip products with your application. Use of this information in any other manner violates these terms. Information regarding device applications is provided only for your convenience and may be superseded

by updates. It is your responsibility to ensure that your application meets with your specifications. Contact your local Microchip sales office for additional support or, obtain additional support at [www.microchip.com/en-us/support/design-help/client-support-services](http://www.microchip.com/en-us/support/design-help/client-support-services).

THIS INFORMATION IS PROVIDED BY MICROCHIP "AS IS". MICROCHIP MAKES NO REPRESENTATIONS OR WARRANTIES OF ANY KIND WHETHER EXPRESS OR IMPLIED, WRITTEN OR ORAL, STATUTORY OR OTHERWISE, RELATED TO THE INFORMATION INCLUDING BUT NOT LIMITED TO ANY IMPLIED WARRANTIES OF NON-INFRINGEMENT, MERCHANTABILITY, AND FITNESS FOR A PARTICULAR PURPOSE, OR WARRANTIES RELATED TO ITS CONDITION, QUALITY, OR PERFORMANCE.

IN NO EVENT WILL MICROCHIP BE LIABLE FOR ANY INDIRECT, SPECIAL, PUNITIVE, INCIDENTAL, OR CONSEQUENTIAL LOSS, DAMAGE, COST, OR EXPENSE OF ANY KIND WHATSOEVER RELATED TO THE INFORMATION OR ITS USE, HOWEVER CAUSED, EVEN IF MICROCHIP HAS BEEN ADVISED OF THE POSSIBILITY OR THE DAMAGES ARE FORESEEABLE. TO THE FULLEST EXTENT ALLOWED BY LAW, MICROCHIP'S TOTAL LIABILITY ON ALL CLAIMS IN ANY WAY RELATED TO THE INFORMATION OR ITS USE WILL NOT EXCEED THE AMOUNT OF FEES, IF ANY, THAT YOU HAVE PAID DIRECTLY TO MICROCHIP FOR THE INFORMATION.

Use of Microchip devices in life support and/or safety applications is entirely at the buyer's risk, and the buyer agrees to defend, indemnify and hold harmless Microchip from any and all damages, claims, suits, or expenses resulting from such use. No licenses are conveyed, implicitly or otherwise, under any Microchip intellectual property rights unless otherwise stated.

## Trademarks

---

The Microchip name and logo, the Microchip logo, Adaptec, AVR, AVR logo, AVR Freaks, BesTime, BitCloud, CryptoMemory, CryptoRF, dsPIC, flexPWR, HELDO, IGLOO, JukeBlox, KeeLoq, Kleer, LANCheck, LinkMD, maXStylus, maXTouch, MediaLB, megaAVR, Microsemi, Microsemi logo, MOST, MOST logo, MPLAB, OptoLyzer, PIC, picoPower, PICSTART, PIC32 logo, PolarFire, Prochip Designer, QTouch, SAM-BA, SenGenuity, SpyNIC, SST, SST Logo, SuperFlash, Symmetricom, SyncServer, Tachyon, TimeSource, tinyAVR, UNI/O, Vectron, and XMEGA are registered trademarks of Microchip Technology Incorporated in the U.S.A. and other countries.

AgileSwitch, APT, ClockWorks, The Embedded Control Solutions Company, EtherSynch, Flashtec, Hyper Speed Control, HyperLight Load, Libero, motorBench, mTouch, Powermite 3, Precision Edge, ProASIC, ProASIC Plus, ProASIC Plus logo, Quiet-Wire, SmartFusion, SyncWorld, Temux, TimeCesium, TimeHub, TimePictra, TimeProvider, TrueTime, and ZL are registered trademarks of Microchip Technology Incorporated in the U.S.A.

Adjacent Key Suppression, AKS, Analog-for-the-Digital Age, Any Capacitor, AnyIn, AnyOut, Augmented Switching, BlueSky, BodyCom, Clockstudio, CodeGuard, CryptoAuthentication, CryptoAutomotive, CryptoCompanion, CryptoController, dsPICDEM, dsPICDEM.net, Dynamic Average Matching, DAM, ECAN, Espresso T1S, EtherGREEN, GridTime, IdealBridge, In-Circuit Serial Programming, ICSP, INICnet, Intelligent Paralleling, IntellIMOS, Inter-Chip Connectivity, JitterBlocker, Knob-on-Display, KoD, maxCrypto, maxView, memBrain, Mindi, MiWi, MPASM, MPF, MPLAB Certified logo, MPLIB, MPLINK, MultiTRAK, NetDetach, Omniscient Code Generation, PICDEM, PICDEM.net, PICkit, PICtail, PowerSmart, PureSilicon, QMatrix, REAL ICE, Ripple Blocker, RTAX, RTG4, SAM-ICE, Serial Quad I/O, simpleMAP, SimpliPHY, SmartBuffer, SmartHLS, SMART-I.S., storClad, SQL, SuperSwitcher, SuperSwitcher II, Switchtec, SynchroPHY, Total Endurance, Trusted Time, TSHARC, USBCheck, VariSense, VectorBlox, VeriPHY, ViewSpan, WiperLock, XpressConnect, and ZENA are trademarks of Microchip Technology Incorporated in the U.S.A. and other countries.

SQTP is a service mark of Microchip Technology Incorporated in the U.S.A.

The Adaptec logo, Frequency on Demand, Silicon Storage Technology, and Symmcom are registered trademarks of Microchip Technology Inc. in other countries.

GestIC is a registered trademark of Microchip Technology Germany II GmbH & Co. KG, a subsidiary of Microchip Technology Inc., in other countries.

All other trademarks mentioned herein are property of their respective companies.

© 2020-2022, Microchip Technology Incorporated and its subsidiaries. All Rights Reserved.

ISBN: 978-1-6683-0495-2

## Quality Management System

---

For information regarding Microchip's Quality Management Systems, please visit [www.microchip.com/quality](http://www.microchip.com/quality).

## Worldwide Sales and Service

| AMERICAS   | ASIA/PACIFIC   | ASIA/PACIFIC  | EUROPE  |
|--|--|---|---|
| <b>Corporate Office</b><br>2355 West Chandler Blvd.<br>Chandler, AZ 85224-6199<br>Tel: 480-792-7200<br>Fax: 480-792-7277<br>Technical Support:<br><a href="http://www.microchip.com/support">www.microchip.com/support</a><br>Web Address:<br><a href="http://www.microchip.com">www.microchip.com</a>   | <b>Australia - Sydney</b><br>Tel: 61-2-9868-6733<br><b>China - Beijing</b><br>Tel: 86-10-8569-7000<br><b>China - Chengdu</b><br>Tel: 86-28-8665-5511<br><b>China - Chongqing</b><br>Tel: 86-23-8980-9588<br><b>China - Dongguan</b><br>Tel: 86-769-8702-9880<br><b>China - Guangzhou</b><br>Tel: 86-20-8755-8029<br><b>China - Hangzhou</b><br>Tel: 86-571-8792-8115<br><b>China - Hong Kong SAR</b><br>Tel: 852-2943-5100<br><b>China - Nanjing</b><br>Tel: 86-25-8473-2460<br><b>China - Qingdao</b><br>Tel: 86-532-8502-7355<br><b>China - Shanghai</b><br>Tel: 86-21-3326-8000<br><b>China - Shenyang</b><br>Tel: 86-24-2334-2829<br><b>China - Shenzhen</b><br>Tel: 86-755-8864-2200<br><b>China - Suzhou</b><br>Tel: 86-186-6233-1526<br><b>China - Wuhan</b><br>Tel: 86-27-5980-5300<br><b>China - Xian</b><br>Tel: 86-29-8833-7252<br><b>China - Xiamen</b><br>Tel: 86-592-2388138<br><b>China - Zhuhai</b><br>Tel: 86-756-3210040 | <b>India - Bangalore</b><br>Tel: 91-80-3090-4444<br><b>India - New Delhi</b><br>Tel: 91-11-4160-8631<br><b>India - Pune</b><br>Tel: 91-20-4121-0141<br><b>Japan - Osaka</b><br>Tel: 81-6-6152-7160<br><b>Japan - Tokyo</b><br>Tel: 81-3-6880-3770<br><b>Korea - Daegu</b><br>Tel: 82-53-744-4301<br><b>Korea - Seoul</b><br>Tel: 82-2-554-7200<br><b>Malaysia - Kuala Lumpur</b><br>Tel: 60-3-7651-7906<br><b>Malaysia - Penang</b><br>Tel: 60-4-227-8870<br><b>Philippines - Manila</b><br>Tel: 63-2-634-9065<br><b>Singapore</b><br>Tel: 65-6334-8870<br><b>Taiwan - Hsin Chu</b><br>Tel: 886-3-577-8366<br><b>Taiwan - Kaohsiung</b><br>Tel: 886-7-213-7830<br><b>Taiwan - Taipei</b><br>Tel: 886-2-2508-8600<br><b>Thailand - Bangkok</b><br>Tel: 66-2-694-1351<br><b>Vietnam - Ho Chi Minh</b><br>Tel: 84-28-5448-2100 | <b>Austria - Wels</b><br>Tel: 43-7242-2244-39<br>Fax: 43-7242-2244-393<br><b>Denmark - Copenhagen</b><br>Tel: 45-4485-5910<br>Fax: 45-4485-2829<br><b>Finland - Espoo</b><br>Tel: 358-9-4520-820<br><b>France - Paris</b><br>Tel: 33-1-69-53-63-20<br>Fax: 33-1-69-30-90-79<br><b>Germany - Garching</b><br>Tel: 49-8931-9700<br><b>Germany - Haan</b><br>Tel: 49-2129-3766400<br><b>Germany - Heilbronn</b><br>Tel: 49-7131-72400<br><b>Germany - Karlsruhe</b><br>Tel: 49-721-625370<br><b>Germany - Munich</b><br>Tel: 49-89-627-144-0<br>Fax: 49-89-627-144-44<br><b>Germany - Rosenheim</b><br>Tel: 49-8031-354-560<br><b>Israel - Ra'anana</b><br>Tel: 972-9-744-7705<br><b>Italy - Milan</b><br>Tel: 39-0331-742611<br>Fax: 39-0331-466781<br><b>Italy - Padova</b><br>Tel: 39-049-7625286<br><b>Netherlands - Drunen</b><br>Tel: 31-416-690399<br>Fax: 31-416-690340<br><b>Norway - Trondheim</b><br>Tel: 47-72884388<br><b>Poland - Warsaw</b><br>Tel: 48-22-3325737<br><b>Romania - Bucharest</b><br>Tel: 40-21-407-87-50<br><b>Spain - Madrid</b><br>Tel: 34-91-708-08-90<br>Fax: 34-91-708-08-91<br><b>Sweden - Gothenberg</b><br>Tel: 46-31-704-60-40<br><b>Sweden - Stockholm</b><br>Tel: 46-8-5090-4654<br><b>UK - Wokingham</b><br>Tel: 44-118-921-5800<br>Fax: 44-118-921-5820 |
| <b>Atlanta</b><br>Duluth, GA<br>Tel: 678-957-9614<br>Fax: 678-957-1455<br><b>Austin, TX</b><br>Tel: 512-257-3370<br><b>Boston</b><br>Westborough, MA<br>Tel: 774-760-0087<br>Fax: 774-760-0088<br><b>Chicago</b><br>Itasca, IL<br>Tel: 630-285-0071<br>Fax: 630-285-0075<br><b>Dallas</b><br>Addison, TX<br>Tel: 972-818-7423<br>Fax: 972-818-2924<br><b>Detroit</b><br>Novi, MI<br>Tel: 248-848-4000<br><b>Houston, TX</b><br>Tel: 281-894-5983<br><b>Indianapolis</b><br>Noblesville, IN<br>Tel: 317-773-8323<br>Fax: 317-773-5453<br>Tel: 317-536-2380<br><b>Los Angeles</b><br>Mission Viejo, CA<br>Tel: 949-462-9523<br>Fax: 949-462-9608<br>Tel: 951-273-7800<br><b>Raleigh, NC</b><br>Tel: 919-844-7510<br><b>New York, NY</b><br>Tel: 631-435-6000<br><b>San Jose, CA</b><br>Tel: 408-735-9110<br>Tel: 408-436-4270<br><b>Canada - Toronto</b><br>Tel: 905-695-1980<br>Fax: 905-695-2078 |  |   |   |

SYST-14GLUM074 - ERRATA - PIC16F15213/14/23/24/43/44 Silicon Errata and Data Sheet Clarifications Docum

Affected Catalog Part Numbers(CPN)

PIC16F15213-E/MF  
PIC16F15213-E/MFVAO  
PIC16F15213-E/SN  
PIC16F15213-E/SNVAO  
PIC16F15213-E/P  
PIC16F15213-I/MF  
PIC16F15213-I/SN  
PIC16F15213-I/P  
PIC16F15213T-I/MF  
PIC16F15213T-I/SN  
PIC16F15213T-E/MFVAO  
PIC16F15213T-E/SN  
PIC16F15213T-E/SNVAO  
PIC16F15214-E/MF  
PIC16F15214-E/MFVAO  
PIC16F15214-E/SN  
PIC16F15214-E/P  
PIC16F15214-I/MF  
PIC16F15214-I/SN  
PIC16F15214-I/P  
PIC16F15214T-I/MF  
PIC16F15214T-I/SN  
PIC16F15214T-E/MFVAO  
PIC16F15214T-E/SN  
PIC16F15223-E/P  
PIC16F15223-E/SL  
PIC16F15223-E/SLVAO  
PIC16F15223-E/ST  
PIC16F15223-E/MG  
PIC16F15223-I/P  
PIC16F15223-I/SL  
PIC16F15223-I/ST  
PIC16F15223-I/MG  
PIC16F15223T-I/SL  
PIC16F15223T-I/ST  
PIC16F15223T-I/MG  
PIC16F15223T-E/SLVAO  
PIC16F15223T-E/MG  
PIC16F15224-E/P  
PIC16F15224-E/SL  
PIC16F15224-E/SLVAO  
PIC16F15224-E/ST

PIC16F15224-E/MG  
PIC16F15224-E/MGVAO  
PIC16F15224-I/7NVAO  
PIC16F15224-I/P  
PIC16F15224-I/SL  
PIC16F15224-I/ST  
PIC16F15224-I/MG  
PIC16F15224-I/MGVAO  
PIC16F15224T-I/SL  
PIC16F15224T-I/ST  
PIC16F15224T-I/MG  
PIC16F15224T-I/MGVAO  
PIC16F15224T-E/SLVAO  
PIC16F15224T-E/MG  
PIC16F15224T-E/MGVAO  
PIC16F15243-E/SS  
PIC16F15243-E/SO  
PIC16F15243-E/P  
PIC16F15243-E/REB  
PIC16F15243-I/SS  
PIC16F15243-I/SO  
PIC16F15243-I/P  
PIC16F15243-I/REB  
PIC16F15243T-I/SS  
PIC16F15243T-I/SO  
PIC16F15243T-I/REB  
PIC16F15244-E/SS  
PIC16F15244-E/SO  
PIC16F15244-E/P  
PIC16F15244-E/REB  
PIC16F15244-I/SS  
PIC16F15244-I/SSV01  
PIC16F15244-I/SSVAO  
PIC16F15244-I/SO  
PIC16F15244-I/P  
PIC16F15244-I/REB  
PIC16F15244T-I/SS  
PIC16F15244T-I/SSV02  
PIC16F15244T-I/SSVAO  
PIC16F15244T-I/SO  
PIC16F15244T-I/REB