



## Product Change Notification / SYST-13SJKW842

---

**Date:**

14-Jul-2022

**Product Category:**

Real-Time Clock/Calendar

**PCN Type:**

Document Change

**Notification Subject:**

ERRATA - MCP795WXX Family Silicon Errata Document Revision

**Affected CPNs:**

[SYST-13SJKW842\\_Affected\\_CPN\\_07142022.pdf](#)

[SYST-13SJKW842\\_Affected\\_CPN\\_07142022.csv](#)

**Notification Text:**

SYST-13SJKW842

Microchip has released a new Errata for the MCP795WXX Family Silicon Errata of devices. If you are using one of these devices please read the document located at [MCP795WXX Family Silicon Errata](#).

**Notification Status:** Final

**Description of Change:** Edited Issue 7.

**Impacts to Data Sheet:** None

**Change Implementation Status:** Complete

**Date Document Changes Effective:** 14 Jul 2022

**NOTE:** Please be advised that this is a change to the document only the product has not been changed.

**Markings to Distinguish Revised from Unrevised Devices:** N/A

## Attachments:

[MCP795WXX Family Silicon Errata](#)

Please contact your local [Microchip sales office](#) with questions or concerns regarding this notification.

## Terms and Conditions:

If you wish to receive Microchip PCNs via email please register for our PCN email service at our [PCN home page](#) select register then fill in the required fields. You will find instructions about registering for Microchips PCN email service in the [PCN FAQ](#) section.

If you wish to change your PCN profile, including opt out, please go to the [PCN home page](#) select login and sign into your myMicrochip account. Select a profile option from the left navigation bar and make the applicable selections.

SYST-13SJKW842 - ERRATA - MCP795WXX Family Silicon Errata Document Revision

Affected Catalog Part Numbers(CPN)

MCP795W20-I/SL  
MCP795W21-I/SL  
MCP795W22-I/SL  
MCP795W20-I/ST  
MCP795W21-I/ST  
MCP795W22-I/ST  
MCP795W20T-I/SL  
MCP795W21T-I/SL  
MCP795W22T-I/SL  
MCP795W20T-I/ST  
MCP795W21T-I/ST  
MCP795W22T-I/ST  
MCP795W10-I/SL  
MCP795W11-I/SL  
MCP795W12-I/SL  
MCP795W12-I/SLVAO  
MCP795W10-I/ST  
MCP795W11-I/ST  
MCP795W12-I/ST  
MCP795W10T-I/SL  
MCP795W11T-I/SL  
MCP795W12T-I/SL  
MCP795W12T-I/SLVAO  
MCP795W10T-I/ST  
MCP795W11T-I/ST  
MCP795W12T-I/ST

## MCP795WXX Family Silicon Errata

The MCP795WXX family devices that you have received conform functionally to the current Device Data Sheet (DS20002280D), except for the anomalies described in this document.

The silicon issues discussed in the following pages are for devices listed in [Table 1](#). The silicon issues are summarized in [Table 2](#).

The errata described in this document will be addressed in future revisions of the MCP795WXX silicon.

**TABLE 1: AFFECTED PART NUMBERS**

Part Number
MCP795W10
MCP795W11
MCP795W12
MCP795W20
MCP795W21
MCP795W22

**Note:** This document summarizes all silicon errata issues from all revisions of silicon, previous as well as current. Only the issues indicated in the last column of [Table 2](#) apply to the current silicon revision.

**Note:** For more information on identifying the product date code, refer to Packaging Information section of the product Data Sheet or contact your local Microchip sales office.

**TABLE 2: SILICON ISSUE SUMMARY**

Issue Number	Issue Summary	Affected Date Codes <sup>(1, 2)</sup>
		All
1	Time running fast when Vcc > 3.6V.	X
2	Incorrect square wave clock output frequency when Vcc > 3.6V.	X
3	Incorrect EVLS debounce period when Vcc > 3.6V.	X
4	Incorrect WDT time-out period and pulse width when Vcc > 3.6V.	X
5	Incorrect alarm interrupt output pulse width when using the $\overline{\text{WDO}}$ pin and Vcc > 3.6V.	X
6	Date incrementing at noon.	X
7	Month or Year write changing date value.	X
8	Day of week write resetting to 1.	X
9	Hundredth-second out of sync with second.	X
10	Hundredth of Second value not changing.	X

**Note 1:** Only those issues indicated in the last column apply to the current silicon revision.

**2:** The date codes are presented in YYWW format.

# MCP795WXX

## Silicon Errata Issues

**Note:** This document summarizes all silicon errata issues from all revisions of silicon, previous as well as current. Only the issues indicated by the shaded column in the following tables apply to the current silicon revision.

### 1. Issue: Time Running Fast

When Vcc is greater than 3.6V, the internal time keeping registers do not count correctly, resulting in fast operation.

#### Work around

Operate the device at or below 3.6V.

#### Affected Silicon Revisions

All
X

### 2. Issue: Incorrect Clock Output Frequency

When Vcc is greater than 3.6V, selecting a square wave frequency for the CLKOUT pin other than 32.768 kHz will result in the incorrect frequency being outputted.

#### Work around

Operate the device at or below 3.6V or select 32.768 kHz output.

#### Affected Silicon Revisions

All
X

### 3. Issue: Incorrect EVLS Debounce Timing

When Vcc is greater than 3.6V, the low-speed event detect debounce period will not match the data sheet-specified values.

#### Work around

Operate the device at or below 3.6V.

#### Affected Silicon Revisions

All
X

### 4. Issue: Incorrect WDT Timings

When Vcc is greater than 3.6V, the Watchdog Timer time-out period and output pulse width will not match the data sheet-specified values.

#### Work around

Operate the device at or below 3.6V.

#### Affected Silicon Revisions

All
X

### 5. Issue: Incorrect Alarm Output Pulse Width

When Vcc is greater than 3.6V, if the  $\overline{WDO}$  pin is selected as the alarm interrupt output pin, the output pulse width will not match the data sheet-specified value.

#### Work around

Operate the device at or below 3.6V.

#### Affected Silicon Revisions

All
X

### 6. Issue: Date Increment

When operating in 12-hour mode (RTCHOUR<6> is set), if the application loads an hour value before 12:00 PM while the oscillator is running, then the date and day of week may increment at 12:00 PM. When this occurs, the month and year will also increment according to the normal rollover rules. The date will increment again at 12:00 AM.

#### Work around

Disable the oscillator by ensuring both the ST and EXTOSC bits are cleared and wait for the OSCON bit to clear before loading the new hour value.

#### Affected Silicon Revisions

All
X

**7. Issue: Date Changes after Month or Year Write**

When writing a new value in the Year, Month or Date registers, the Date register value may change unexpectedly.

**Work around**

If any of the Date, Month or Year values is to be changed, then write new Date, Month and Year value, in that order (this write can be continuous or discontinuous operation). Then, write Date value again. The ST bit can remain set during this operation, or it can be cleared and set again afterward.

**Affected Silicon Revisions**

All
X

**8. Issue: Day of Week Reset after Day of Week Write**

If the day of week (RTCWKDAY<2:0>) is equal to the value of 7 and the application writes a new day of week value to the timekeeping registers while the oscillator is not running, then when the oscillator is enabled, the day of week may reset the value to 1.

**Work around**

Update the day of week while the oscillator is enabled. Or, change the day of week value to another value besides 7 before disabling the oscillator, then set to the correct day while the oscillator is disabled, before re-enabling the oscillator.

**Affected Silicon Revisions**

All
X

**9. Issue: HSEC Value Not Synchronized with Second Value**

When reading the HSEC register and Second register shortly after the time values are set, the two registers may not roll over at the same moment.

**Work around**

The HSEC register does not cause the Second value to change, but instead the values are clocked off an internal clock divisor independently. The HSEC value is automatically synchronized with the Second value at the beginning of the minute, when the second rolls over from 59 to 00. Following that first minute change, the HSEC and Second registers will be in sync.

**Affected Silicon Revisions**

All
X

**10. Issue: HSEC Value Not Changing**

The HSEC register may appear stuck at the same value for two or more successive reads, even though more than 10 ms have passed. If the oscillator is running, then the internal value is still counting, but the value may not be updated every time it is read.

**Work around**

Read the HSEC value, then read it again 120  $\mu$ s later to ensure an unstuck value. Alternatively, read the HSEC register and compare the present value with the previous value, and if the same, re-read the HSEC register until it is different.

# MCP795WXX

---

## APPENDIX A: DOCUMENT REVISION HISTORY

### Rev E Document (07/2022)

Edited Issue 7.

### Rev D Document (06/2017)

Edited Issue 7; Added Issues 9 and 10.

### Rev C Document (12/2016)

Added Issue 8: Day of Week Reset after Day of Week Write.

### Rev B Document (12/2015)

Adopted new document format. Added silicon issues 6 (date incrementing at noon) and 7 (month write resetting date to 1). Removed MCP795BXX part numbers.

### Rev A Document (03/2012)

Initial release of this document.

---

**Note the following details of the code protection feature on Microchip products:**

- Microchip products meet the specifications contained in their particular Microchip Data Sheet.
- Microchip believes that its family of products is secure when used in the intended manner, within operating specifications, and under normal conditions.
- Microchip values and aggressively protects its intellectual property rights. Attempts to breach the code protection features of Microchip product is strictly prohibited and may violate the Digital Millennium Copyright Act.
- Neither Microchip nor any other semiconductor manufacturer can guarantee the security of its code. Code protection does not mean that we are guaranteeing the product is "unbreakable" Code protection is constantly evolving. Microchip is committed to continuously improving the code protection features of our products.

This publication and the information herein may be used only with Microchip products, including to design, test, and integrate Microchip products with your application. Use of this information in any other manner violates these terms. Information regarding device applications is provided only for your convenience and may be superseded by updates. It is your responsibility to ensure that your application meets with your specifications. Contact your local Microchip sales office for additional support or, obtain additional support at <https://www.microchip.com/en-us/support/design-help/client-support-services>.

THIS INFORMATION IS PROVIDED BY MICROCHIP "AS IS". MICROCHIP MAKES NO REPRESENTATIONS OR WARRANTIES OF ANY KIND WHETHER EXPRESS OR IMPLIED, WRITTEN OR ORAL, STATUTORY OR OTHERWISE, RELATED TO THE INFORMATION INCLUDING BUT NOT LIMITED TO ANY IMPLIED WARRANTIES OF NON-INFRINGEMENT, MERCHANTABILITY, AND FITNESS FOR A PARTICULAR PURPOSE, OR WARRANTIES RELATED TO ITS CONDITION, QUALITY, OR PERFORMANCE.

IN NO EVENT WILL MICROCHIP BE LIABLE FOR ANY INDIRECT, SPECIAL, PUNITIVE, INCIDENTAL, OR CONSEQUENTIAL LOSS, DAMAGE, COST, OR EXPENSE OF ANY KIND WHATSOEVER RELATED TO THE INFORMATION OR ITS USE, HOWEVER CAUSED, EVEN IF MICROCHIP HAS BEEN ADVISED OF THE POSSIBILITY OR THE DAMAGES ARE FORESEEABLE. TO THE FULLEST EXTENT ALLOWED BY LAW, MICROCHIP'S TOTAL LIABILITY ON ALL CLAIMS IN ANY WAY RELATED TO THE INFORMATION OR ITS USE WILL NOT EXCEED THE AMOUNT OF FEES, IF ANY, THAT YOU HAVE PAID DIRECTLY TO MICROCHIP FOR THE INFORMATION.

Use of Microchip devices in life support and/or safety applications is entirely at the buyer's risk, and the buyer agrees to defend, indemnify and hold harmless Microchip from any and all damages, claims, suits, or expenses resulting from such use. No licenses are conveyed, implicitly or otherwise, under any Microchip intellectual property rights unless otherwise stated.

For information regarding Microchip's Quality Management Systems, please visit [www.microchip.com/quality](http://www.microchip.com/quality).

**Trademarks**

The Microchip name and logo, the Microchip logo, Adaptec, AVR, AVR logo, AVR Freaks, BesTime, BitCloud, CryptoMemory, CryptoRF, dsPIC, flexPWR, HELDO, IGLoo, JukeBlox, KeeLoq, Klear, LANCheck, LinkMD, maXStylus, maXTouch, MediaLB, megaAVR, Microsemi, Microsemi logo, MOST, MOST logo, MPLAB, OptoLyzer, PIC, picoPower, PICSTART, PIC32 logo, PolarFire, Prochip Designer, QTouch, SAM-BA, SenGenuity, SpyNIC, SST, SST Logo, SuperFlash, Symmetricom, SyncServer, Tachyon, TimeSource, tinyAVR, UNI/O, Vectron, and XMEGA are registered trademarks of Microchip Technology Incorporated in the U.S.A. and other countries.

AgileSwitch, APT, ClockWorks, The Embedded Control Solutions Company, EtherSynch, Flashtec, Hyper Speed Control, HyperLight Load, Libero, motorBench, mTouch, Powermite 3, Precision Edge, ProASIC, ProASIC Plus, ProASIC Plus logo, Quiet-Wire, SmartFusion, SyncWorld, Temux, TimeCesium, TimeHub, TimePictra, TimeProvider, TrueTime, and ZL are registered trademarks of Microchip Technology Incorporated in the U.S.A.

Adjacent Key Suppression, AKS, Analog-for-the-Digital Age, Any Capacitor, AnyIn, AnyOut, Augmented Switching, BlueSky, BodyCom, Clockstudio, CodeGuard, CryptoAuthentication, CryptoAutomotive, CryptoCompanion, CryptoController, dsPICDEM, dsPICDEM.net, Dynamic Average Matching, DAM, ECAN, Espresso T1S, EtherGREEN, GridTime, IdealBridge, In-Circuit Serial Programming, ICSP, INICnet, Intelligent Paralleling, IntelliMOS, Inter-Chip Connectivity, JitterBlocker, Knob-on-Display, KoD, maxCrypto, maxView, memBrain, Mindi, MiWi, MPASM, MPF, MPLAB Certified logo, MPLIB, MPLINK, MultiTRAK, NetDetach, Omniscient Code Generation, PICDEM, PICDEM.net, PICkit, PICtail, PowerSmart, PureSilicon, QMatrix, REAL ICE, Ripple Blocker, RTAX, RTG4, SAM-ICE, Serial Quad I/O, simpleMAP, SimpliPHY, SmartBuffer, SmartHLS, SMART-I.S., storClad, SQI, SuperSwitcher, SuperSwitcher II, Switchtec, SynchroPHY, Total Endurance, Trusted Time, TSHARC, USBCheck, VariSense, VectorBlox, VeriPHY, ViewSpan, WiperLock, XpressConnect, and ZENA are trademarks of Microchip Technology Incorporated in the U.S.A. and other countries.

SQTP is a service mark of Microchip Technology Incorporated in the U.S.A.

The Adaptec logo, Frequency on Demand, Silicon Storage Technology, and Symmcom are registered trademarks of Microchip Technology Inc. in other countries.

GestIC is a registered trademark of Microchip Technology Germany II GmbH & Co. KG, a subsidiary of Microchip Technology Inc., in other countries.

All other trademarks mentioned herein are property of their respective companies.

© 2012-2022, Microchip Technology Incorporated and its subsidiaries.

All Rights Reserved.

ISBN: 978-1-6683-0770-0





# MICROCHIP

## Worldwide Sales and Service

### AMERICAS

**Corporate Office**  
2355 West Chandler Blvd.  
Chandler, AZ 85224-6199  
Tel: 480-792-7200  
Fax: 480-792-7277  
Technical Support:  
<http://www.microchip.com/support>  
Web Address:  
[www.microchip.com](http://www.microchip.com)

#### Atlanta

Duluth, GA  
Tel: 678-957-9614  
Fax: 678-957-1455

#### Austin, TX

Tel: 512-257-3370

#### Boston

Westborough, MA  
Tel: 774-760-0087  
Fax: 774-760-0088

#### Chicago

Itasca, IL  
Tel: 630-285-0071  
Fax: 630-285-0075

#### Dallas

Addison, TX  
Tel: 972-818-7423  
Fax: 972-818-2924

#### Detroit

Novi, MI  
Tel: 248-848-4000

#### Houston, TX

Tel: 281-894-5983

#### Indianapolis

Noblesville, IN  
Tel: 317-773-8323  
Fax: 317-773-5453  
Tel: 317-536-2380

#### Los Angeles

Mission Viejo, CA  
Tel: 949-462-9523  
Fax: 949-462-9608  
Tel: 951-273-7800

#### Raleigh, NC

Tel: 919-844-7510

#### New York, NY

Tel: 631-435-6000

#### San Jose, CA

Tel: 408-735-9110  
Tel: 408-436-4270

#### Canada - Toronto

Tel: 905-695-1980  
Fax: 905-695-2078

### ASIA/PACIFIC

**Australia - Sydney**  
Tel: 61-2-9868-6733

**China - Beijing**  
Tel: 86-10-8569-7000

**China - Chengdu**  
Tel: 86-28-8665-5511

**China - Chongqing**  
Tel: 86-23-8980-9588

**China - Dongguan**  
Tel: 86-769-8702-9880

**China - Guangzhou**  
Tel: 86-20-8755-8029

**China - Hangzhou**  
Tel: 86-571-8792-8115

**China - Hong Kong SAR**  
Tel: 852-2943-5100

**China - Nanjing**  
Tel: 86-25-8473-2460

**China - Qingdao**  
Tel: 86-532-8502-7355

**China - Shanghai**  
Tel: 86-21-3326-8000

**China - Shenyang**  
Tel: 86-24-2334-2829

**China - Shenzhen**  
Tel: 86-755-8864-2200

**China - Suzhou**  
Tel: 86-186-6233-1526

**China - Wuhan**  
Tel: 86-27-5980-5300

**China - Xian**  
Tel: 86-29-8833-7252

**China - Xiamen**  
Tel: 86-592-2388138

**China - Zhuhai**  
Tel: 86-756-3210040

### ASIA/PACIFIC

**India - Bangalore**  
Tel: 91-80-3090-4444

**India - New Delhi**  
Tel: 91-11-4160-8631

**India - Pune**  
Tel: 91-20-4121-0141

**Japan - Osaka**  
Tel: 81-6-6152-7160

**Japan - Tokyo**  
Tel: 81-3-6880-3770

**Korea - Daegu**  
Tel: 82-53-744-4301

**Korea - Seoul**  
Tel: 82-2-554-7200

**Malaysia - Kuala Lumpur**  
Tel: 60-3-7651-7906

**Malaysia - Penang**  
Tel: 60-4-227-8870

**Philippines - Manila**  
Tel: 63-2-634-9065

**Singapore**  
Tel: 65-6334-8870

**Taiwan - Hsin Chu**  
Tel: 886-3-577-8366

**Taiwan - Kaohsiung**  
Tel: 886-7-213-7830

**Taiwan - Taipei**  
Tel: 886-2-2508-8600

**Thailand - Bangkok**  
Tel: 66-2-694-1351

**Vietnam - Ho Chi Minh**  
Tel: 84-28-5448-2100

### EUROPE

**Austria - Wels**  
Tel: 43-7242-2244-39  
Fax: 43-7242-2244-393

**Denmark - Copenhagen**  
Tel: 45-4485-5910  
Fax: 45-4485-2829

**Finland - Espoo**  
Tel: 358-9-4520-820

**France - Paris**  
Tel: 33-1-69-53-63-20  
Fax: 33-1-69-30-90-79

**Germany - Garching**  
Tel: 49-8931-9700

**Germany - Haan**  
Tel: 49-2129-3766400

**Germany - Heilbronn**  
Tel: 49-7131-72400

**Germany - Karlsruhe**  
Tel: 49-721-625370

**Germany - Munich**  
Tel: 49-89-627-144-0  
Fax: 49-89-627-144-44

**Germany - Rosenheim**  
Tel: 49-8031-354-560

**Israel - Ra'anana**  
Tel: 972-9-744-7705

**Italy - Milan**  
Tel: 39-0331-742611  
Fax: 39-0331-466781

**Italy - Padova**  
Tel: 39-049-7625286

**Netherlands - Drunen**  
Tel: 31-416-690399  
Fax: 31-416-690340

**Norway - Trondheim**  
Tel: 47-7288-4388

**Poland - Warsaw**  
Tel: 48-22-3325737

**Romania - Bucharest**  
Tel: 40-21-407-87-50

**Spain - Madrid**  
Tel: 34-91-708-08-90  
Fax: 34-91-708-08-91

**Sweden - Gothenberg**  
Tel: 46-31-704-60-40

**Sweden - Stockholm**  
Tel: 46-8-5090-4654

**UK - Wokingham**  
Tel: 44-118-921-5800  
Fax: 44-118-921-5820