



Product Change Notification / SYST-14FRDR055

Date:

17-Oct-2022

Product Category:

Wireless IC, Wireless Modules

PCN Type:

Document Change

Notification Subject:

ERRATA - PIC32CX-BZ2 Family Silicon Errata Sheet Document Revision

Affected CPNs:

[SYST-14FRDR055_Affected_CPN_10172022.pdf](#)

[SYST-14FRDR055_Affected_CPN_10172022.csv](#)

Notification Text:

SYST-14FRDR055

Microchip has released a new Errata for the PIC32CX-BZ2 Family Silicon Errata Sheet of devices. If you are using one of these devices please read the document located at [PIC32CX-BZ2 Family Silicon Errata Sheet](#).

Notification Status: Final

Description of Change: Initial release of document

Impacts to Data Sheet: None

Reason for Change: To Improve Productivity

Change Implementation Status: Complete

Date Document Changes Effective: 17 Oct 2022

NOTE: Please be advised that this is a change to the document only the product has not been changed.

Markings to Distinguish Revised from Unrevised Devices: N/A

Attachments:

[PIC32CX-BZ2 Family Silicon Errata Sheet](#)

Please contact your local [Microchip sales office](#) with questions or concerns regarding this notification.

Terms and Conditions:

If you wish to receive Microchip PCNs via email please register for our PCN email service at our [PCN home page](#) select register then fill in the required fields. You will find instructions about registering for Microchips PCN email service in the [PCN FAQ](#) section.

If you wish to change your PCN profile, including opt out, please go to the [PCN home page](#) select login and sign into your myMicrochip account. Select a profile option from the left navigation bar and make the applicable selections.

Affected Catalog Part Numbers (CPN)

PIC32CX1012BZ25048-E/MYX

PIC32CX1012BZ25048-I/MYX

PIC32CX1012BZ25048T-I/MYX

PIC32CX1012BZ25048T-E/MYX

WBZ451PE-I

WBZ451UE-I



PIC32CX-BZ2 Family

PIC32CX-BZ2 Family Silicon Errata Sheet

PIC32CX-BZ2 Family Errata

The PIC32CX-BZ2 family of devices that you have received conform functionally to the current Device Data Sheet, except for the anomalies described in this document.

The silicon issues discussed and summarized in the following pages are for silicon revisions with the Device and Revision IDs listed in the following table.

The errata described in this document will be addressed in future revisions of the PIC32CX-BZ2 family silicon.

Note: This document summarizes all silicon errata issues from all revisions of silicon, previous as well as current.

Table 1. PIC32CX-BZ2 Family Silicon Device Identification

Part Number	Device Identification (DID[31:0])	Revision ID (DID.REVISION[3:0])
		A0
PIC32CX1012BZ25048/WBZ451	0x09B8F053	0x0

Note: Refer to the “**Device Service Unit**” chapter in the current device data sheet for detailed information on Device Identification and Revision IDs for your specific device.

Table of Contents

PIC32CX-BZ2 Family Errata.....	1
1. Silicon Errata Summary.....	3
2. Silicon Errata Issues.....	7
2.1. Analog-to-Digital Converter (ADC).....	7
2.2. Analog Comparator (AC).....	7
2.3. Clock Reset Unit (CRU).....	8
2.4. Configurable Custom Logic (CCL).....	9
2.5. Device.....	9
2.6. Device Service Unit (DSU).....	10
2.7. Direct Memory Access Controller (DMAC).....	10
2.8. External Interrupt Controller (EIC).....	10
2.9. RAM Error Correction Code (ECC).....	11
2.10. Event System (EVSYS).....	11
2.11. General Purpose Input/Output (GPIO).....	12
2.12. Peripheral Access Controller (PAC).....	12
2.13. Prefetch Cache.....	13
2.14. Real-Time Counter (RTC).....	13
2.15. Serial Communication Interface (SERCOM).....	15
2.16. System Bus.....	18
2.17. System Configuration Registers.....	18
2.18. Timer/Counter for Control Applications (TCC).....	19
2.19. Timer/Counter (TC).....	20
2.20. Watchdog Timer (WDT).....	21
3. Document Revision History.....	22
Microchip Information.....	23
The Microchip Website.....	23
Product Change Notification Service.....	23
Customer Support.....	23
Microchip Devices Code Protection Feature.....	23
Legal Notice.....	23
Trademarks.....	24
Quality Management System.....	25
Worldwide Sales and Service.....	26

1. Silicon Errata Summary

Table 1-1. Errata Summary

Module	Feature	Issue Summary	Affected Revisions
			A0
Analog-to-Digital Converter (ADC)	2.1.1. Level Trigger	The ADC level trigger does not perform burst conversions in Debug mode.	X
	2.1.2. Scan	The Scan list conversions defined in the ADCCSS1 register will restart without finishing the current scan list and does not generate an EOSRDY bit (ADCCON2[29]) end of scan interrupt status if a new trigger event from the STRGSR[4:0]bits (ADCCON1[20:16]) trigger source occurs before the scan list completion on the shared ADC2 core.	X
Analog Comparator (AC)	2.2.1. Disabling Analog Comparator	Analog Comparator output (AC_CMPx) will not be disabled by setting either COMPCTRLx.ENABLE = '0' or PMD1.ACMD = '1'.	X
	2.2.2. Wrong VDD Scaler Reference for AC_CMP0	AC_CMP0 uses a fixed VDD/2 reference. But, the observed reference voltage is not equal to VDD/2.	X
	2.2.3. Wrong VDD Scaler Reference with CMP0 and CMP1 Enabled Concurrently	Wrong VDD scaler reference voltage is observed when AC_CMP0 and AC_CMP1 are enabled concurrently with VDD scaler as reference for both the comparators. Both the comparators will see same VDD scaler reference.	X
Clock Reset Unit (CRU)	2.3.1. Peripheral Bus Clocks	The Power-on Reset (POR) value of the PB3 clock is not correct.	X
Configurable Custom Logic (CCL)	2.4.1. Enable Protected Registers	The SEQCTRLx and LUCTRLx registers are enable-protected by the CTRL.ENABLE bit; however, they should be enable-protected by the LUTCTRLx.ENABLE bits.	X
	2.4.2. Sequential Logic	LUT output is corrupted after enabling CCL when sequential logic is used.	X
Device	2.5.1. VIL Input Low Voltage	There is degraded VIL/VIH performance when the GPIO pull-up/pull-down resistors are enabled on PB0, PB1, PB2, PB3,PB4, PB5, PB6, PB8 or PB9. These pins may not be able to recognize a logic low level if the pull-up on that pad is enabled.	X
Device Service Unit (DSU)	2.6.1. Programming or Debugging	Device debugging and programming is not supported when the device's supply voltage is greater than 3.0 V and the device is operating outside of room temperature.	X
	2.6.2. CRC32	DSU CRC32 will not complete when targeting NVM memory space while the NVM cache is disabled.	X
Direct Memory Access Controller (DMAC)	2.7.1. DMAC in Debug Mode	In debug mode, DMAC does not restart after a debug halt when DBGCTRL.DBGRUN=0.	X
External Interrupt Controller (EIC)	2.8.1. Edge Detection	When enabling EIC, SYNCBUSY.ENABLE is released before EIC is fully enabled. Edge detection can be done only after three cycles of the selected GCLK (GCLK_EIC or CLK_ULP32K).	X
	2.8.2. Asynchronous Edge Detection	When the asynchronous edge detection is enabled and the system is in Standby mode, only the first edge will be detected. The following edges are ignored until the system wakes up.	X
RAM Error Correction Code (ECC)	2.9.1. ERRADDR Register may Read as '0' when PB-Bridge-B (PB2_CLK) is Not Equal to System Clock (SYS_CLK)	If PB2_CLK is not equal to System Clock (sys_clk), ERRADDR register read will not return the failing address (caused by Single Bit Error/Dual Bit Error), instead it may return '0'.	X

PIC32CX-BZ2 Family

Silicon Errata Summary

.....continued			
Module	Feature	Issue Summary	Affected Revisions
			A0
Event System (EVSYS)	2.10.1. Software Event	BUSYCH flag never resets upon software events in synchronous/resynchronized path modes with event detection on falling edges If a software event occurs when the EVSYS is set in synchronous/resynchronized path modes (CHANNELn.PATH=0x0/0x1) with event detection set on falling edges (CHANNELn.EDGSEL=0x2), the CHSTATUS.BUSYCHn flag will be set but will never come back to 0. It is then impossible to know if the event user for this channel is ready to accept new events or not.	X
	2.10.2. Spurious Overrun	Overrun interrupt flag may be incorrectly set upon software events in synchronous/resynchronized path modes with event detection on both rising and falling edges. If a software event occurs when the EVSYS is set in synchronous/resynchronized path modes (CHANNELn.PATH=0x0/0x1) with event detection set on both rising and falling edges (CHANNELn.EDGSEL=0x3), spurious overrun interrupts may occur (INTFLAG.OVRn).	X
General Purpose Input/Output (GPIO)	2.11.1. GPIO Output Configuration in Deep Sleep and Extreme Deep Sleep	In Deep Sleep and Extreme Deep Sleep Mode, GPIO should not be set to the output state of pin HIGH. Configuring the GPIO state to pin High during Deep Sleep and Extreme Deep Sleep Mode will cause leakage current and potential reliability issues on the Silicon. This issue is only applicable when CPU is in Deep Sleep/Extreme Deep Sleep Mode and when GPIO is configured as output state pin HIGH	X
Peripheral Access Controller (PAC)	2.12.1. PAC Protection Error in FREQM	FREQM reads on the Control B register (FREQM.CTRLB) generate a PAC protection error.	X
	2.12.2. PAC Protection Error in CCL	Writing the Software Reset bit in the Control A register (CTRLASWRST) will trigger a PAC protection error.	X
Prefetch Cache	2.13.1. CPU Hang Configuration Switch	CPU hang is observed when CHECON.ADRWS configuration switches from 1 to 0 and a flash read access. When CHECON.ADRWS is configured to '0' (default is '1'), the cache_adrws will be latched at next clock and if a flash read access happens at the same clock, the system hangs waiting for an internal ack due to the PFM cache miss.	X
Real-Time Counter (RTC)	2.14.1. Write Corruption	A 8-bit or 16-bit write access for a 32-bit register, or 8-bit write access for a 16-bit register, can fail for the following registers: <ul style="list-style-type: none"> The COUNT register in COUNT32 mode The COUNT register in COUNT16 mode The CLOCK register in CLOCK mode 	X
	2.14.2. COUNTSYNC	When COUNTSYNC is enabled, the first COUNT value is not correctly synchronized and, therefore, it is a wrong value.	X
	2.14.3. Tamper Input Filter	Majority debouncing, as part of RTC tamper detection, does not work when enabled by setting the Debouncer Majority Enable bit CTRLB.DEBJMAJ.	X
	2.14.4. Tamper Detection	Upon enabling the RTC, a false tamper detection could be reported by the RTC.	X
	2.14.5. Tamper Detection Timestamp	If an external reset occurs during a tamper detection, the TIMESTAMP register will not be updated when the next tamper detection is triggered.	X

PIC32CX-BZ2 Family

Silicon Errata Summary

.....continued			
Module	Feature	Issue Summary	Affected Revisions
			A0
Serial Communication Interface (SERCOM)	2.15.1. SERCOM-USART: Auto-Baud Mode	In USART Auto-Baud mode, missing stop bits are not recognized as inconsistent sync (ISF) or framing (FERR) errors.	X
	2.15.2. SERCOM-USART: Collision Detection	In USART operating mode with Collision Detection enabled (CTRLB.COLDEN=1), the SERCOM will not abort the current transfer as expected if a collision is detected and if the SERCOM APB Clock is lower than the SERCOM Generic Clock.	X
	2.15.3. SERCOM-USART: Debug Mode	In USART operating mode, if DBGCTRL.DBGSTOP=1, data transmission is not halted after entering Debug mode.	X
	2.15.4. SERCOM-USART: 32-bit Extension Mode	When 32-bit Extension mode is enabled and data to be sent are not in multiples of 4 bytes (which means the length counter must be enabled), additional bytes will be sent over the line.	X
	2.15.5. SERCOM-UART: TXINV and RXINV Bits	The TXINV and RXINV bits in the CTRLA register have inverted functionality.	X
	2.15.6. STATUS.CLKHOLD Bit in Host and Client Modes	The STATUS.CLKHOLD bit in host and client modes can be written; however, it is a read-only status bit.	X
	2.15.7. SERCOM-I2C: I2C in Client Mode	In I ² C mode, LENERR, SEXTOUT, LOWTOUT, COLL and BUSERR bits are not cleared when INTFLAG.AMATCH is cleared.	X
	2.15.8. SERCOM-I2C: Client Mode with DMA	In I ² C Client Transmitter mode, at the reception of a NACK, if there is still data to be sent in the DMA buffer, the DMA will push a data to the DATA register.	X
	2.15.9. SERCOM-I2C: I2C Client in DATA32B Mode	When SERCOM is configured as an I ² C client in 32-bit Data Mode (DATA32B=1) and the I ² C host reads from the I ² C client (client transmitter) and outputs its NACK (indicating no more data is needed), the I ² C client still receives a DRDY interrupt.	X
	2.15.10. SERCOM-I2C: Repeated Start	When the Quick command is enabled (CTRLB.QCEN=1), software can issue a repeated Start by writing either CTRLB.CMD or ADDR.ADDR bit fields.	X
	2.15.11. SERCOM-SPI: Data Preload	In SPI Client mode and with Client Data Preload Enabled (CTRLB.PLOADEN=1), the first data sent from the client will be a dummy byte if the host cannot keep the Client Select (SS) line low until the end of transmission.	X
	2.15.12. SERCOM-SPI: Client Data Preload	Preloading a new SPI data (CTRLB.PLOADEN = 1) before going into Standby Sleep mode may lead to extra power consumption.	X
	2.15.13. SERCOM-SPI: Hardware Client Select Control	When Hardware Client Select Control is enabled (CTRLB.MSSEN = 1), the Client Select (SS) pin goes high after.	X
System Bus	2.16.1. Bus Error Address Checks	When accessing peripherals on the PB-PIC bus, an access beyond the implemented memory region 0x4401_FFFF will cause the CPU to hang, waiting for a bus error signal.	X
System Configuration Registers	2.17.1. CFGCON0 Registers	CFGCON0.SWOEN is non-functional, which makes the PB7 function SWO during debugging only.	X
	2.17.2. System Bus QoS	The Power-on Reset values of the CFGPGQOS register sets all bus host QoS values to zero (Background) instead of the required Power-on Reset values.	X

PIC32CX-BZ2 Family

Silicon Errata Summary

.....continued

Module	Feature	Issue Summary	Affected Revisions
			A0
Timer/Counter for Control Applications (TCC)	2.18.1. Re-trigger in RAMP2 Operations	Re-trigger in RAMP2 operations (RAMP2, RAMP2A, RAMP2C) is not supported if a prescaler is used (CTRLA.PRESCALER != 0) and the re-trig of the counter is done on the next GCLK (CTRLA.PRESCSYNC = GCLK or CTRLA.PRESCSYNC = RESYNC).	X
	2.18.2. Re-trigger	If a Re-trigger event (EVCTRL.EVACTn = 0x1, RETRIGGER) occurs at the Channel Compare Match [n] time, the next Waveform Output [n] is corrupted.	X
	2.18.3. TCC Outputs	TCC0/TCC1 output not working as expected with PPS, output signals not visible on output pins via PPS even though the TCC is working correctly. TCC2 cannot be used to drive external pins.	X
	2.18.4. DMA Request is Not Set on Overflow Condition in One-shot DMA Trigger Mode of RAMP2C Operation	TCC Overflow (OVF) will not trigger a DMA request in One-shot DMA trigger (DMAOS) mode of RAMP2C operation.	X
Timer/Counter (TC)	2.19.1. TC Outputs	TC0/1/2 output not working as expected with PPS, output signals are not visible on output pins via PPS even though the TC is working correctly. TC3 cannot be used to drive external pins.	X
	2.19.2. ALOCK Feature	ALOCK feature is not functional.	X
Watchdog Timer (WDT)	2.20.1. Watchdog Counter	When the interval between clearing the watchdog timer (in other words, clearing the Run mode watchdog counter) and the sleep instruction is less than 1 WDT clock cycle, the "Run Mode" watchdog counter is not cleared.	X

Notes:

- Cells with 'X' indicate the issue is present in this revision of the silicon.
- Cells with '—' indicate this silicon revision does not exist for this issue.
- The blank cell indicates the issue was corrected or does not exist in this revision of the silicon.

2. Silicon Errata Issues

The following errata issues apply to the PIC32CX-BZ2 family of devices.

Notes:

- Cells with an 'X' indicate the issue is present in this revision of the silicon.
- Cells with a dash ('—') indicate this silicon revision does not exist for this issue.
- Blank cells indicate the issue was corrected or does not exist in this revision of the silicon.

Note: Traditional Inter-Integrated Circuit (I²C) and Serial Peripheral Interface (SPI) documentation use the terminology “Master” and “Slave”. The equivalent Microchip terminology used in this document is “Host” and “Client”, respectively.

2.1 Analog-to-Digital Converter (ADC)

2.1.1 Level Trigger

The ADC level trigger does not perform burst conversions in Debug mode.

Workaround:

None

Affected Silicon Revisions

A0						
X						

2.1.2 Scan

The scan list conversions defined in the ADCCSS1 register will restart without finishing the current scan list and does not generate an EOSRDY bit (ADCCON2[29]) end of scan interrupt status if a new trigger event from the STRGSRC[4:0]bits (ADCCON1[20:16]) trigger source occurs before the scan list completion on the shared ADC core.

Workaround:

Ensure that the STRGSRC[4:0] bits trigger source repetition rate.

Affected Silicon Revisions

A0						
X						

2.2 Analog Comparator (AC)

2.2.1 Disabling Analog Comparator

AC_CMPx output is not gated either by COMPCTRLx.ENABLE or PMD1.ACMD.

Workaround:

Write the CFGCON1.CMPx_OE register bit to '0' to disable the AC_CMPx output.

Affected Silicon Revisions

A0						
X						

2.2.2 Wrong VDD Scaler Reference for AC_CMP0

AC_CMP0 uses a fixed VDD/2 reference. But, the observed reference voltage is not equal to VDD/2.

Workaround:

Get the expected VDD scaler for AC_CMP0 from SCALER1.VALUE[3:0] = 0x02 value. For example, VDD = 3.3V voltage, the VDD scaler reference for AC_CMP0 is:

$$VScale = VDD \times (R_Bottom) / R_Total$$

$$VScale = 3.3 \times 598.5 / 900 = 2.1945V$$

Affected Silicon Revisions

A0						
X						

2.2.3 Wrong VDD Scaler Reference with CMP0 and CMP1 Enabled Concurrently

Wrong VDD scaler reference voltage is observed when AC_CMP0 and AC_CMP1 are enabled concurrently with VDD scaler as reference for both the comparators. Both the comparators will see same VDD scaler reference.

Workaround:

Get the expected VDD scaler for both AC_CMP0, AC_CMP1 comparators using following formula.

$$R_Bottom = R_Bottom \text{ of configured SCALER1.VALUE[3:0]}$$

$$R_Total = 900 - [598.5 - R_Bottom]$$

$$VScale = VDD \cdot (R_Bottom) / R_Total$$

For details on R_Bottom and R_Total values, refer to the *Analog Comparator (AC)* chapter of the device data sheet.

Affected Silicon Revisions

A0						
X						

2.3 Clock Reset Unit (CRU)

2.3.1 Peripheral Bus Clocks

The Power-on Reset value of the PB3 clock is not correct.

Workaround:

Use Microchip-provided SDK and bootloader. This software will initialize the CRU.PB3DIV register to the data sheet-specified default value. If using third-party tools and other custom developed software, set this register to the data sheet default value of 0x0000_8809.

Affected Silicon Revisions

A0						
X						

2.4 Configurable Custom Logic (CCL)

2.4.1 Enable Protected Registers

The SEQCTRLx and LUCTRLx registers are enable-protected by the CTRL.ENABLE bit; however, they must be enable-protected by the LUTCTRLx.ENABLE bits.

Workaround:

None

Affected Silicon Revisions

A0						
X						

2.4.2 Sequential Logic

LUT output is corrupted after enabling CCL when sequential logic is used.

Workaround:

Write the CTRL register twice when enabling the CCL.

Affected Silicon Revisions

A0						
X						

2.5 Device

2.5.1 Vil Input Low Voltage

There is degraded VIL/VIH performance when the GPIO pull-up/pull-down resistors are enabled on PB0, PB1, PB2, PB3, PB4, PB5, PB6, PB8 or PB9. These pins may not be able to recognize a logic low level if the pull-up on that pad is enabled.

Workaround:

If using PB0, PB1, PB2, PB3, PB4, PB5, PB6, PB8 or PB9 for GPIO, do not enable pull-up or pull-down; use external resistors.

Affected Silicon Revisions

A0						
X						

2.6 Device Service Unit (DSU)

2.6.1 Programming or Debugging

Device debugging or programming can only be supported using ICD4 at room temperature. When programming or debugging, the device's supply voltage can only range between 1.9 (min) and 3.0 (max) V, including the min and max voltages.

Workaround:
None

Affected Silicon Revisions

A0						
X						

2.6.2 CRC32

The DSU CRC32 will not complete when targeting NVM memory space while the NVM cache is disabled.

Workaround:
Be sure to always enable the NVM cache when performing a DSU CRC32 request targeting the NVM memory space.

Affected Silicon Revisions

A0						
X						

2.7 Direct Memory Access Controller (DMAC)

2.7.1 DMAC in Debug Mode

In Debug mode, DMAC does not restart after a debug halt when DBGCTRL.DBGRUN = 0.

Workaround:
Set DBGCTRL.DBGRUN to '1' so that the DMAC continues normal operation when the CPU is halted by an external debugger.

Affected Silicon Revisions

A0						
X						

2.8 External Interrupt Controller (EIC)

2.8.1 Edge Detection

When enabling EIC, the SYNCBUSY.ENABLE bit resets before EIC is fully enabled. Edge detection can be done only after three cycles of the selected GCLK (GCLK_EIC or CLK_ULP32K).

Workaround:
None

Affected Silicon Revisions

A0						
X						

2.8.2 Asynchronous Edge Detection

When the asynchronous edge detection is enabled and the system is in Standby mode, only the first edge will be detected. The following edges are ignored until the system wakes-up.

Workaround:

Use the asynchronous edge detection with debouncer enabled. It is recommended to set the DPRESALER.PRESCALER and DPRESALER.TICKON to have the lowest frequency possible. To reduce the power consumption, set the EIC GCLK frequency as low as possible or select the ULP32K clock (EIC CTRLA.CKSEL set).

Affected Silicon Revisions

A0						
X						

2.9 RAM Error Correction Code (ECC)

2.9.1 ERRADDR Register may Read as '0' when PB-Bridge-B (PB2_CLK) is Not Equal to System Clock (SYS_CLK)

If PB2_CLK is not equal to System Clock (sys_clk), ERRADDR register read will not return the failing address (caused by Single Bit Error/Dual Bit Error); instead it may return '0'.

Workaround:

When using RAM ECC in application, configure PB2_CLK to be equal to SYS_CLK without any divisions.

Affected Silicon Revisions

A0						
X						

2.10 Event System (EVSYS)

2.10.1 Software Event

BUSYCH flag never resets upon software events in synchronous/resynchronized path modes with event detection on falling edges.

If a software event occurs when the EVSYS is set in synchronous/resynchronized path modes (CHANNELn.PATH=0x0/0x1) with event detection set on falling edges (CHANNELn.EDGSEL=0x2), the CHSTATUS.BUSYCHn flag will be set but will never come back to 0. It is, then, impossible to know if the event user for this channel is ready to accept new events or not.

Workaround:

Generate software events for this user through a dedicated channel configured with event detection set on rising edges (CHANNELn.EDGSEL=0x1).

Affected Silicon Revisions

A0						
X						

2.10.2 Spurious Overrun

Overrun interrupt flag may be incorrectly set upon software events in synchronous/resynchronized path modes with event detection on both rising and falling edges.

If a software event occurs when the EVSYS is set in synchronous/resynchronized path modes (CHANNELn.PATH=0x0/0x1) with event detection set on both rising and falling edges (CHANNELn.EDGSEL=0x3), spurious overrun interrupts may occur (INTFLAG.OVRn).

Workaround:

Generate software events for the event user through a dedicated channel configured with event detection set on rising edges (CHANNELn.EDGSEL=0x1).

Affected Silicon Revisions

A0						
X						

2.11 General Purpose Input/Output (GPIO)

2.11.1 GPIO Output Configuration in Deep Sleep and Extreme Deep Sleep

In Deep Sleep and Extreme Deep Sleep Mode, do not set GPIO to output state of pin high.

Configuring the GPIO state to pin high during Deep Sleep and Extreme Deep Sleep Mode will cause leakage current and potential reliability issues on the silicon.

This issue is only applicable when the CPU is in Deep Sleep or Extreme Deep Sleep Mode and when GPIO is configured as output state pin high.

Workaround:

None

Affected Silicon Revisions

A0						
X						

2.12 Peripheral Access Controller (PAC)

2.12.1 PAC Protection Error in FREQM

FREQM reads on the Control B register (FREQM.CTRLB) generate a PAC protection error.

Workaround:

None

Affected Silicon Revisions

A0						
X						

2.12.2 PAC Protection Error in CCL

Writing the Software Reset bit in the Control A register (CTRLASWRST) will trigger a PAC protection error.

Workaround:

Clear the CCL PAC error each time a CCL software reset is executed.

Affected Silicon Revisions

A0						
X						

2.13 Prefetch Cache

2.13.1 CPU Hang Configuration Switch

CPU hang is observed when CHECON.ADRWS configuration switches from 1 to 0 and a Flash read access.

When CHECON.ADRWS is configured to '0' (default is '1'), the cache_adrws will be latched at next clock, and if a Flash read access happens at the same clock, the system hangs waiting for an internal ack due to the PFM cache miss.

Workaround:

Execute the CHECON configuration from SRAM (at the very beginning of system initialization) until the configuration is done, and resume execution from Flash after configuration is set.

Affected Silicon Revisions

A0						
X						

2.14 Real-Time Counter (RTC)

2.14.1 Write Corruption

An 8-bit or 16-bit write access for a 32-bit register, or 8-bit write access for a 16-bit register can fail for the following registers:

- COUNT register in COUNT32 mode
- COUNT register in COUNT16 mode
- CLOCK register in CLOCK mode

Workaround:

Write the registers with:

- A 32-bit write access for COUNT register in COUNT32 mode, CLOCK register in CLOCK mode
- A 16-bit write access for the COUNT register in COUNT16 mode

Affected Silicon Revisions

A0						
X						

2.14.2 COUNTSYNC

When COUNTSYNC is enabled, the first COUNT value is not correctly synchronized and, thus, it is an incorrect value.

Workaround:

After enabling COUNTSYNC, read the COUNT register until its value is changed when compared to its first value read. After this, all subsequent values read from the COUNT register are valid.

Affected Silicon Revisions

A0						
X						

2.14.3 Tamper Input Filter

Majority debouncing, as part of RTC tamper detection, does not work when enabled by setting the Debouncer Majority Enable bit, CTRLB.DEBMAJ.

Workaround:

None

Affected Silicon Revisions

A0						
X						

2.14.4 Tamper Detection

Upon enabling the RTC tamper detection feature, a false tamper detection can be reported by the RTC.

Workaround:

Use any one of the following workarounds:

1. Configure tamper detection to only falling edge.
2. If the user software has to use tamper detection as rising edge, it must ignore the first tamper interrupt generated after enabling the RTC tamper detection.

Affected Silicon Revisions

A0						
X						

2.14.5 Tamper Detection Timestamp

If an external reset occurs during a tamper detection, the timestamp register will not be updated when the next tamper detection is triggered.

Workaround:

Enable RTC tamper interrupt and copy the timestamp from the RTC CLOCK COUNT register to one of the following destinations:

- SRAM
- GPx register in RTC
- BKUPx register in RTC

Affected Silicon Revisions

A0						
X						

2.15 Serial Communication Interface (SERCOM)

2.15.1 SERCOM-USART: Auto-Baud Mode

In USART Auto-Baud mode, missing stop bits are not recognized as inconsistent sync (ISF) or framing (FERR) errors.

Workaround:
None

Affected Silicon Revisions

A0						
X						

2.15.2 SERCOM-USART: Collision Detection

In USART operating mode with Collision Detection enabled (CTRLB.COLDEN = 1), the SERCOM will not abort the current transfer as expected if a collision is detected and if the SERCOM APB Clock is lower than the SERCOM Generic Clock.

Workaround:
The SERCOM APB clock must always be higher than the SERCOM Generic Clock to support collision detection.

Affected Silicon Revisions

A0						
X						

2.15.3 SERCOM-USART: Debug Mode

In USART operating mode, if DBGCTRL.DBGSTOP = 1, data transmission is not halted after entering Debug mode.

Workaround:
None

Affected Silicon Revisions

A0						
X						

2.15.4 SERCOM-USART: 32-bit Extension Mode

When the 32-bit Extension mode is enabled and data to be sent are not in multiples of 4 bytes, which means the length counter must be enabled, additional bytes will be sent over the line.

Workaround:

Use any one of the following workarounds:

1. Write the Inter-Character Spacing bits (CTRLC.ICSPACE) to a non-zero-value.
2. Do not use the length counter in firmware by keeping the data to be sent in multiples of 4 bytes.

Affected Silicon Revisions

A0						
X						

2.15.5 SERCOM-UART: TXINV and RXINV Bits

The TXINV and RXINV bits in CTRLA are interchanged. TXINV controls the RX signal inversion and RXINV controls the TX signal inversion.

Workaround:

In software, interpret the TXINV bit as a functionality of RXINV, and, conversely, interpret the RXINV bit as a functionality of TXINV.

Affected Silicon Revisions

A0						
X						

2.15.6 STATUS.CLKHOLD Bit in Host and Client Modes

The STATUS.CLKHOLD bit in host and client modes can be written even though it is specified as a read-only status bit.

Workaround:

Do not clear the STATUS.CLKHOLD bit to preserve the current clock hold state.

Affected Silicon Revisions

A0						
X						

2.15.7 SERCOM-I²C: I²C in Client Mode

In I²C mode, LENERR, SEXTOUT, LOWTOUT, COLL and BUSERR bits are not cleared when INTFLAG.AMATCH is cleared.

Workaround:

Manually clear status bits LENERR, SEXTOUT, LOWTOUT, COLL and BUSERR by writing these bits to '1' when set.

Affected Silicon Revisions

A0						
X						

2.15.8 SERCOM-I²C: Client Mode with DMA

In I²C Client Transmitter mode, at the reception of a NACK, if there is still data to be sent in the DMA buffer, the DMA will push a data to the DATA register. Because a NACK was received, the transfer on the I²C bus will not occur, causing the loss of this data.

Workaround:

Configure the DMA transfer size to the number of data to be received by the I²C host. DMA cannot be used if the number of data to be received by the host is not known..

Affected Silicon Revisions

A0						
X						

2.15.9 SERCOM-I²C: I²C Client in DATA32B Mode

When SERCOM is configured as an I²C client in 32-bit Data mode (DATA32B = 1) and the I²C host reads from the I²C client (client transmitter) and outputs its NACK (indicating no more data is needed), the I²C client still receives a DRDY interrupt.

If the CPU does not write new data to the I²C client DATA register, I²C client will pull the SDA line, which will result in stalling the bus permanently.

Workaround:

1. Write dummy data to the data register when a NACK is received from the host.
2. Use command #2 (SERCOMx->I2CS.CTRLB.bit.CMD = 2) when a NACK is received from the host.



Important: Because STATUS.RXNACK always indicates the last received ACK, to determine when a NACK is received from the I²C host, the I²C client software needs to consider I2CS.STATUS.RXNACK only on the second DRDY interrupt after receiving the AMATCH interrupt.

Affected Silicon Revisions

A0						
X						

2.15.10 SERCOM-I²C: Repeated Start

When the quick command is enabled (CTRLB.QCEN = 1), software can issue a repeated start by writing either CTRLB.CMD or ADDR.ADDR bit fields. If, in these conditions, SCL Stretch mode is CTRLA.SCLSM = 1, a bus error will be generated.

Workaround:

Use Quick Command mode (CTRLB.QCEN = 1) only if SCL Stretch mode is CTRLA.SCLSM = 0.

Affected Silicon Revisions

A0						
X						

2.15.11 SERCOM-SPI: Data Preload

In SPI Client mode and with Client Data Preload Enabled (CTRLB.PLOADEN = 1), the first data sent from the client will be a dummy byte if the host cannot keep the client select (SS) line low until the end of transmission.

Workaround:

In SPI Client mode, the client select (SS) pin must be kept low by the host until the end of the transmission if the client data preload feature is used (CTRLB.PLOADEN = 1).

Affected Silicon Revisions

A0							
X							

2.15.12 SERCOM-SPI: Client Data Preload

Preloading new SPI data (CTRLB.PLOADEN = 1) before going into Standby Sleep mode may lead to extra power consumption.

Workaround:
None

Affected Silicon Revisions

A0							
X							

2.15.13 SERCOM-SPI: Hardware Client Select Control

When hardware client select control is enabled (CTRLB.MSEN = 1), the client select (SS) pin goes high after.

Workaround:
Set CTRLB.MSEN = 0, and handle the client select (SS) pin by software.

Affected Silicon Revisions

A0							
X							

2.16 System Bus

2.16.1 Bus Error Address Checks

When accessing peripherals on the PB-PIC bus, an access beyond the implemented memory region 0x4401_FFFF causes the CPU to hang, waiting for a bus error signal.

Workaround:
Use the Microchip-provided peripheral drivers from Harmony 3 and the Microchip-provided SDK. This software will not generate addresses outside the implemented regions. If using third-party tools and other custom developed software, do not create accesses outside this region or an MCU reset will be required to recover.

Affected Silicon Revisions

A0							
X							

2.17 System Configuration Registers

2.17.1 CFGCON0 Registers

CFGCON0.SWOEN is non-functional, which makes PB7 function as SWO during debugging only. PB7 works normally when not doing debug.

Workaround:

Do not use PB7 as GPIO while debugging.

Affected Silicon Revisions

A0						
X						

2.17.2 System Bus QoS

The Power-on Reset values of the CFGPGQOS register sets all bus host QoS values to zero (Background) instead of the required Power-on Reset values.

Workaround:

Use the Microchip-provided SDK and bootloader. This software will initialize the CFGPGQOS register to the data sheet-specified default value. If using third-party tools and other custom developed software, set this register to the data sheet default value of 0xE040_004C.

Affected Silicon Revisions

A0						
X						

2.18 Timer/Counter for Control Applications (TCC)

2.18.1 Re-trigger in RAMP2 Operations

Re-trigger in RAMP2 operations (RAMP2, RAMP2A, RAMP2C) is not supported if a prescaler is used (CTRLA.PRESCALER != 0) and the re-trig of the counter is done on the next GCLK (CTRLA.PRESCSYNC = GCLK or CTRLA.PRESCSYNC = RESYNC).

Workaround:

Configure the re-trigger of the counter on the next prescaler clock (CTRLA.PRESCSYNC = PRESC).

Affected Silicon Revisions

A0						
X						

2.18.2 Re-trigger

If a Re-trigger event (EVCTRL.EVACTn = 0x1, RETRIGGER) occurs at the Channel Compare Match [n] time, the next Waveform Output [n] is corrupted.

Workaround:

Use two channels to store their two successive (n and n+1) CC register values and combine their related waveform outputs to make signal redundancy.

Affected Silicon Revisions

A0						
X						

2.18.3 TCC Outputs

TCC0/TCC1 output not working as expected with PPS, output signals not visible on output pins via PPS even though the TCC is working correctly. TCC2 cannot be used to drive external pins.

Workaround: Use CCL module to route TCC outputs

Use the CCL module to output up to 2 TCCx_WO[n] signals on CCL0_OUT and CCL1_OUT using PPS to the desired pins.

The required configuration in CCL1/2:

- CCL.CTRL.ENABLE = 1 – To enable CCL
- CCL.LUTCTRLx.ENABLE = 1 – To enable LUT in CCL
- CCL.LUTCTRLx.INSELx = 8 – To select TCC as input source
- CCL.LUTCTRLx.TRUTH – To match the toggle of TCC
 - CCL.LUTCTRLx.TRUTH = 0xAA – To match toggle on WO[0]
 - CCL.LUTCTRLx.TRUTH = 0xCC – To match toggle on WO[1]
 - CCL.LUTCTRLx.TRUTH = 0xF0 – To match toggle on WO[2]
- CFGCON1.CCL_OE = 1 – To enable CCL output onto PADs

Then, configure PPS for CCL output to desired pin.

Note: CCL0_OUT allows one instance of TCC0_WO[n], and CCL1_OUT allows one instance of TCC1_WO[n].

Affected Silicon Revisions

A0						
X						

2.18.4 DMA Request is Not Set on Overflow Condition in One-shot DMA Trigger Mode of RAMP2C Operation

TCC Overflow (OVF) will not trigger a DMA request in the One-shot DMA trigger (DMAOS) mode of RAMP2C operation.

DMA triggers are not applicable for the RAMP2C mode.

Workaround:
None

Affected Silicon Revisions

A0						
X						

2.19 Timer/Counter (TC)

2.19.1 TC Outputs

TC0/1/2 output not working as expected with PPS, output signals are not visible on output pins via PPS even though the TC is working correctly. TC3 cannot be used to drive external pins.

Workaround: Set COPENx and CAPTENx before enabling/re-enabling the Timer Counter

Set TC.CTRLA.COPENx = 1 and TC.CTRLA.CAPTENx = 1 before enabling/re-enabling the timer counter.

- Configure PPS for output to desired pin
- Initialize timer counter
- TC.CTRLA.COPENx = 1

- TC.CTRLA.CAPTENx = 1
- Start/enable timer counter

Affected Silicon Revisions

A0						
X						

2.19.2 ALOCK Feature

ALOCK feature is not functional.

Workaround:

None

Affected Silicon Revisions

A0						
X						

2.20 Watchdog Timer (WDT)

2.20.1 Watchdog Counter

When the interval between clearing the watchdog timer (in other words, clearing the Run mode watchdog counter) and the sleep instruction is less than 1 WDT clock cycle, the “Run Mode” watchdog counter is not cleared. When using LPRC as clock source, the interval is 1 LPRC clock. Because the watchdog timer is in LPRC domain, which is much slower than CPU clock, the sleep instruction is executed even before the “Run mode” watchdog counter is cleared. Hence, the “Run mode” watchdog counter remains frozen to its last count instead of clearing to 0.

While in Sleep mode, the “Sleep mode” watchdog counter is incrementing, and at the end of the WDTPS, it generates an NMI which causes the CPU to wake-up.

After wake-up, the user would expect that, because they cleared the WDT just before going to sleep, they have an entire WDT period available to them before they have to clear WDT again. But because the “Run mode” counter was not cleared before going into sleep, the WDT reset occurs earlier than expected.

Workaround (either or both can be used):

1. Add a delay of more than 1 WDT Clock (LPRC clock), between clearing of the WDT and execution of sleep instruction.
2. Execute the WDT clear instruction as soon as the CPU wakes-up.

Affected Silicon Revisions

A0						
X						

3. Document Revision History

Revision	Date	Section	Description
A	10/2022	Document	Initial revision

Microchip Information

The Microchip Website

Microchip provides online support via our website at www.microchip.com/. This website is used to make files and information easily available to customers. Some of the content available includes:

- **Product Support** – Data sheets and errata, application notes and sample programs, design resources, user's guides and hardware support documents, latest software releases and archived software
- **General Technical Support** – Frequently Asked Questions (FAQs), technical support requests, online discussion groups, Microchip design partner program member listing
- **Business of Microchip** – Product selector and ordering guides, latest Microchip press releases, listing of seminars and events, listings of Microchip sales offices, distributors and factory representatives

Product Change Notification Service

Microchip's product change notification service helps keep customers current on Microchip products. Subscribers will receive email notification whenever there are changes, updates, revisions or errata related to a specified product family or development tool of interest.

To register, go to www.microchip.com/pcn and follow the registration instructions.

Customer Support

Users of Microchip products can receive assistance through several channels:

- Distributor or Representative
- Local Sales Office
- Embedded Solutions Engineer (ESE)
- Technical Support

Customers should contact their distributor, representative or ESE for support. Local sales offices are also available to help customers. A listing of sales offices and locations is included in this document.

Technical support is available through the website at: www.microchip.com/support

Microchip Devices Code Protection Feature

Note the following details of the code protection feature on Microchip products:

- Microchip products meet the specifications contained in their particular Microchip Data Sheet.
- Microchip believes that its family of products is secure when used in the intended manner, within operating specifications, and under normal conditions.
- Microchip values and aggressively protects its intellectual property rights. Attempts to breach the code protection features of Microchip product is strictly prohibited and may violate the Digital Millennium Copyright Act.
- Neither Microchip nor any other semiconductor manufacturer can guarantee the security of its code. Code protection does not mean that we are guaranteeing the product is "unbreakable". Code protection is constantly evolving. Microchip is committed to continuously improving the code protection features of our products.

Legal Notice

This publication and the information herein may be used only with Microchip products, including to design, test, and integrate Microchip products with your application. Use of this information in any other manner violates these terms. Information regarding device applications is provided only for your convenience and may be superseded

by updates. It is your responsibility to ensure that your application meets with your specifications. Contact your local Microchip sales office for additional support or, obtain additional support at www.microchip.com/en-us/support/design-help/client-support-services.

THIS INFORMATION IS PROVIDED BY MICROCHIP "AS IS". MICROCHIP MAKES NO REPRESENTATIONS OR WARRANTIES OF ANY KIND WHETHER EXPRESS OR IMPLIED, WRITTEN OR ORAL, STATUTORY OR OTHERWISE, RELATED TO THE INFORMATION INCLUDING BUT NOT LIMITED TO ANY IMPLIED WARRANTIES OF NON-INFRINGEMENT, MERCHANTABILITY, AND FITNESS FOR A PARTICULAR PURPOSE, OR WARRANTIES RELATED TO ITS CONDITION, QUALITY, OR PERFORMANCE.

IN NO EVENT WILL MICROCHIP BE LIABLE FOR ANY INDIRECT, SPECIAL, PUNITIVE, INCIDENTAL, OR CONSEQUENTIAL LOSS, DAMAGE, COST, OR EXPENSE OF ANY KIND WHATSOEVER RELATED TO THE INFORMATION OR ITS USE, HOWEVER CAUSED, EVEN IF MICROCHIP HAS BEEN ADVISED OF THE POSSIBILITY OR THE DAMAGES ARE FORESEEABLE. TO THE FULLEST EXTENT ALLOWED BY LAW, MICROCHIP'S TOTAL LIABILITY ON ALL CLAIMS IN ANY WAY RELATED TO THE INFORMATION OR ITS USE WILL NOT EXCEED THE AMOUNT OF FEES, IF ANY, THAT YOU HAVE PAID DIRECTLY TO MICROCHIP FOR THE INFORMATION.

Use of Microchip devices in life support and/or safety applications is entirely at the buyer's risk, and the buyer agrees to defend, indemnify and hold harmless Microchip from any and all damages, claims, suits, or expenses resulting from such use. No licenses are conveyed, implicitly or otherwise, under any Microchip intellectual property rights unless otherwise stated.

Trademarks

The Microchip name and logo, the Microchip logo, Adaptec, AVR, AVR logo, AVR Freaks, BesTime, BitCloud, CryptoMemory, CryptoRF, dsPIC, flexPWR, HELDO, IGLOO, JukeBlox, KeeLoq, Kleer, LANCheck, LinkMD, maXStylus, maXTouch, MediaLB, megaAVR, Microsemi, Microsemi logo, MOST, MOST logo, MPLAB, OptoLyzer, PIC, picoPower, PICSTART, PIC32 logo, PolarFire, Prochip Designer, QTouch, SAM-BA, SenGenuity, SpyNIC, SST, SST Logo, SuperFlash, Symmetricom, SyncServer, Tachyon, TimeSource, tinyAVR, UNI/O, Vectron, and XMEGA are registered trademarks of Microchip Technology Incorporated in the U.S.A. and other countries.

AgileSwitch, APT, ClockWorks, The Embedded Control Solutions Company, EtherSynch, Flashtec, Hyper Speed Control, HyperLight Load, Libero, motorBench, mTouch, Powermite 3, Precision Edge, ProASIC, ProASIC Plus, ProASIC Plus logo, Quiet-Wire, SmartFusion, SyncWorld, Temux, TimeCesium, TimeHub, TimePictra, TimeProvider, TrueTime, and ZL are registered trademarks of Microchip Technology Incorporated in the U.S.A.

Adjacent Key Suppression, AKS, Analog-for-the-Digital Age, Any Capacitor, AnyIn, AnyOut, Augmented Switching, BlueSky, BodyCom, Clockstudio, CodeGuard, CryptoAuthentication, CryptoAutomotive, CryptoCompanion, CryptoController, dsPICDEM, dsPICDEM.net, Dynamic Average Matching, DAM, ECAN, Espresso T1S, EtherGREEN, GridTime, IdealBridge, In-Circuit Serial Programming, ICSP, INICnet, Intelligent Paralleling, IntelliMOS, Inter-Chip Connectivity, JitterBlocker, Knob-on-Display, KoD, maxCrypto, maxView, memBrain, Mindi, MiWi, MPASM, MPF, MPLAB Certified logo, MPLIB, MPLINK, MultiTRAK, NetDetach, Omniscient Code Generation, PICDEM, PICDEM.net, PICkit, PICtail, PowerSmart, PureSilicon, QMatrix, REAL ICE, Ripple Blocker, RTAX, RTG4, SAM-ICE, Serial Quad I/O, simpleMAP, SimpliPHY, SmartBuffer, SmartHLS, SMART-I.S., storClad, SQL, SuperSwitcher, SuperSwitcher II, Switchtec, SynchroPHY, Total Endurance, Trusted Time, TSHARC, USBCheck, VariSense, VectorBlox, VeriPHY, ViewSpan, WiperLock, XpressConnect, and ZENA are trademarks of Microchip Technology Incorporated in the U.S.A. and other countries.

SQTP is a service mark of Microchip Technology Incorporated in the U.S.A.

The Adaptec logo, Frequency on Demand, Silicon Storage Technology, and Symmcom are registered trademarks of Microchip Technology Inc. in other countries.

GestIC is a registered trademark of Microchip Technology Germany II GmbH & Co. KG, a subsidiary of Microchip Technology Inc., in other countries.

All other trademarks mentioned herein are property of their respective companies.

© 2022, Microchip Technology Incorporated and its subsidiaries. All Rights Reserved.

ISBN: 978-1-6683-0986-5

Quality Management System

For information regarding Microchip's Quality Management Systems, please visit www.microchip.com/quality.

Worldwide Sales and Service

AMERICAS	ASIA/PACIFIC	ASIA/PACIFIC	EUROPE
Corporate Office 2355 West Chandler Blvd. Chandler, AZ 85224-6199 Tel: 480-792-7200 Fax: 480-792-7277 Technical Support: www.microchip.com/support Web Address: www.microchip.com	Australia - Sydney Tel: 61-2-9868-6733 China - Beijing Tel: 86-10-8569-7000 China - Chengdu Tel: 86-28-8665-5511 China - Chongqing Tel: 86-23-8980-9588 China - Dongguan Tel: 86-769-8702-9880 China - Guangzhou Tel: 86-20-8755-8029 China - Hangzhou Tel: 86-571-8792-8115 China - Hong Kong SAR Tel: 852-2943-5100 China - Nanjing Tel: 86-25-8473-2460 China - Qingdao Tel: 86-532-8502-7355 China - Shanghai Tel: 86-21-3326-8000 China - Shenyang Tel: 86-24-2334-2829 China - Shenzhen Tel: 86-755-8864-2200 China - Suzhou Tel: 86-186-6233-1526 China - Wuhan Tel: 86-27-5980-5300 China - Xian Tel: 86-29-8833-7252 China - Xiamen Tel: 86-592-2388138 China - Zhuhai Tel: 86-756-3210040	India - Bangalore Tel: 91-80-3090-4444 India - New Delhi Tel: 91-11-4160-8631 India - Pune Tel: 91-20-4121-0141 Japan - Osaka Tel: 81-6-6152-7160 Japan - Tokyo Tel: 81-3-6880-3770 Korea - Daegu Tel: 82-53-744-4301 Korea - Seoul Tel: 82-2-554-7200 Malaysia - Kuala Lumpur Tel: 60-3-7651-7906 Malaysia - Penang Tel: 60-4-227-8870 Philippines - Manila Tel: 63-2-634-9065 Singapore Tel: 65-6334-8870 Taiwan - Hsin Chu Tel: 886-3-577-8366 Taiwan - Kaohsiung Tel: 886-7-213-7830 Taiwan - Taipei Tel: 886-2-2508-8600 Thailand - Bangkok Tel: 66-2-694-1351 Vietnam - Ho Chi Minh Tel: 84-28-5448-2100	Austria - Wels Tel: 43-7242-2244-39 Fax: 43-7242-2244-393 Denmark - Copenhagen Tel: 45-4485-5910 Fax: 45-4485-2829 Finland - Espoo Tel: 358-9-4520-820 France - Paris Tel: 33-1-69-53-63-20 Fax: 33-1-69-30-90-79 Germany - Garching Tel: 49-8931-9700 Germany - Haan Tel: 49-2129-3766400 Germany - Heilbronn Tel: 49-7131-72400 Germany - Karlsruhe Tel: 49-721-625370 Germany - Munich Tel: 49-89-627-144-0 Fax: 49-89-627-144-44 Germany - Rosenheim Tel: 49-8031-354-560 Israel - Ra'anana Tel: 972-9-744-7705 Italy - Milan Tel: 39-0331-742611 Fax: 39-0331-466781 Italy - Padova Tel: 39-049-7625286 Netherlands - Drunen Tel: 31-416-690399 Fax: 31-416-690340 Norway - Trondheim Tel: 47-72884388 Poland - Warsaw Tel: 48-22-3325737 Romania - Bucharest Tel: 40-21-407-87-50 Spain - Madrid Tel: 34-91-708-08-90 Fax: 34-91-708-08-91 Sweden - Gothenberg Tel: 46-31-704-60-40 Sweden - Stockholm Tel: 46-8-5090-4654 UK - Wokingham Tel: 44-118-921-5800 Fax: 44-118-921-5820
Atlanta Duluth, GA Tel: 678-957-9614 Fax: 678-957-1455 Austin, TX Tel: 512-257-3370 Boston Westborough, MA Tel: 774-760-0087 Fax: 774-760-0088 Chicago Itasca, IL Tel: 630-285-0071 Fax: 630-285-0075 Dallas Addison, TX Tel: 972-818-7423 Fax: 972-818-2924 Detroit Novi, MI Tel: 248-848-4000 Houston, TX Tel: 281-894-5983 Indianapolis Noblesville, IN Tel: 317-773-8323 Fax: 317-773-5453 Tel: 317-536-2380 Los Angeles Mission Viejo, CA Tel: 949-462-9523 Fax: 949-462-9608 Tel: 951-273-7800 Raleigh, NC Tel: 919-844-7510 New York, NY Tel: 631-435-6000 San Jose, CA Tel: 408-735-9110 Tel: 408-436-4270 Canada - Toronto Tel: 905-695-1980 Fax: 905-695-2078			