



## Product Change Notification / SYST-09TYIJ481

---

**Date:**

11-Feb-2021

**Product Category:**

8-bit Microcontrollers

**PCN Type:**

Document Change

**Notification Subject:**

ERRATA - ATmega808/809/1608/1609 Silicon Errata and Data Sheet Clarification

**Affected CPNs:**

[SYST-09TYIJ481\\_Affected\\_CPN\\_02112021.pdf](#)

[SYST-09TYIJ481\\_Affected\\_CPN\\_02112021.csv](#)

**Notification Text:**

SYST-09TYIJ481

Microchip has released a new Product Documents for the ATmega808/809/1608/1609 Silicon Errata and Data Sheet Clarification of devices. If you are using one of these devices please read the document located at [ATmega808/809/1608/1609 Silicon Errata and Data Sheet Clarification](#).

**Notification Status:** Final

**Description of Change:** 1) Device: 2.2.1 Writing the OSCLOCK Fuse in FUSE.OSCCFG to '1' Prevents Automatic Loading of Calibration Values

2) CCL: 2.5.1 The CCL Must be Disabled to Change the Configuration of a Single LUT

3) CRCSCAN: 2.6.1 The CRCSCAN Background Mode May Fail During an EEPROM or USERROW Write/Erase

4) TCA: 2.7.1 Restart Will Reset Counter Direction in NORMAL and FRQ Mode

5) TCB: 2.8.3 CCMP and CNT Registers Operate as 16-Bit Registers in 8-Bit PWM Mode

6) USART:

- 2.9.2 Open-Drain Mode Does Not Work When TXD is Configured as Output

- 2.9.3 Start-of-Frame Detection Can Unintentionally Be Triggered in Active Mode

**Impacts to Data Sheet:** None

**Reason for Change:** To Improve Productivity

**Change Implementation Status:** Complete

**Date Document Changes Effective:** 11 Feb 2021

**NOTE:** Please be advised that this is a change to the document only the product has not been changed.

**Markings to Distinguish Revised from Unrevised Devices:** N/A

## **Attachments:**

[ATmega808/809/1608/1609 Silicon Errata and Data Sheet Clarification](#)

Please contact your local [Microchip sales office](#) with questions or concerns regarding this notification.

## **Terms and Conditions:**

If you wish to receive Microchip PCNs via email please register for our PCN email service at our [PCN home page](#) select register then fill in the required fields. You will find instructions about registering for Microchips PCN email service in the [PCN FAQ](#) section.

If you wish to change your PCN profile, including opt out, please go to the [PCN home page](#) select login and sign into your myMicrochip account. Select a profile option from the left navigation bar and make the applicable selections.



# ATmega808/809/1608/1609 Silicon Errata and Data Sheet Clarification

---

## ATmega808/809/1608/1609 Silicon Errata and Data Sheet Clarification

---

The ATmega808/809/1608/1609 devices of the megaAVR® 0-series you have received conform functionally to the current device data sheet ([www.microchip.com/DS40002172](http://www.microchip.com/DS40002172)), except for the anomalies described in this document. The errata described in this document will likely be addressed in future revisions of the ATmega808/809/1608/1609 devices.

**Notes:**

- This document summarizes all the silicon errata issues from all revisions of silicon, previous as well as current
- Refer to the Device/Revision ID section in the current device data sheet ([www.microchip.com/DS40002172](http://www.microchip.com/DS40002172)) for more detailed information on Device Identification and Revision IDs for your specific device, or contact your local Microchip sales office for assistance

### 1. Silicon Issue Summary

#### Legend

- Erratum is not applicable.
- X Erratum is applicable.

#### Errata Overview

Peripheral	Short Description	Valid for Silicon Revision
		Rev. A <sup>(1)</sup>
Device	2.2.1 Writing the OSCLOCK Fuse in FUSE.OSCCFG to '1' Prevents Automatic Loading of Calibration Values	X
PORTMUX	2.3.1 SPI SS Pin is Connected to Pin Even if SPI is Configured to Have No Port Connection	X
ADC	2.4.1 One Extra Measurement Performed After Disabling ADC Free-Running Mode	X
	2.4.2 ADC Functionality Cannot be Ensured with CLKADC Above 1.5 MHz and a Setting of 25% Duty Cycle	X
	2.4.3 ADC Performance Degrades with CLKADC Above 1.5 MHz and VDD < 2.7V	X
CCL	2.5.1 The CCL Must be Disabled to Change the Configuration of a Single LUT	X
CRSCAN	2.6.1 The CRSCAN Background Mode May Fail During an EEPROM or USERROW Write/Erase	X
TCA	2.7.1 Restart Will Reset Counter Direction in NORMAL and FRQ Mode	X
TCB	2.8.1 The TCA Restart Command Does Not Force a Restart of TCB	X
	2.8.2 Minimum Event Duration Must Exceed the Selected Clock Period	X
	2.8.3 CCMP and CNT Registers Operate as 16-Bit Registers in 8-Bit PWM Mode	X
USART	2.9.1 TXD Pin Override Not Released When Disabling the Transmitter	X
	2.9.2 Open-Drain Mode Does Not Work When TXD is Configured as Output	X
	2.9.3 Start-of-Frame Detection Can Unintentionally Be Triggered in Active Mode	X

#### Note:

1. This revision is the initial release of the silicon.

## 2. Silicon Errata

### 2.1 Errata Details

- Erratum is not applicable.
- X Erratum is applicable.

### 2.2 Device

#### 2.2.1 Writing the OSCLOCK Fuse in FUSE.OSCCFG to '1' Prevents Automatic Loading of Calibration Values

Writing the OSCLOCK fuse in FUSE.OSCCFG to '1' prevents the automatic loading of calibration values from the signature row. The device will run with an uncalibrated OSC20M oscillator.

##### Work Around

Do not use OSCLOCK for locking the oscillator calibration value. The oscillator calibration value can be locked by writing LOCK in CLKCTRL.OSC20MCALIBB to '1'.

##### Affected Silicon Revisions

Rev. A
X

### 2.3 PORTMUX

#### 2.3.1 SPI $\overline{SS}$ Pin is Connected to Pin Even if SPI is Configured to Have No Port Connection

The SPIn  $\overline{SS}$  pin is connected even if NONE is selected in the SPIn field in PORTMUX.TWISPIROUTE. If SPIn is operating in Host mode and the  $\overline{SS}$  pin goes low, or input is disabled, the SPIn will exit Host mode.

##### Work around

Write the SSD bit in SPIn.CTRLB to '1' to ignore the  $\overline{SS}$  signal.

##### Affected Silicon Revisions

Rev. A
X

### 2.4 ADC

#### 2.4.1 One Extra Measurement Performed After Disabling ADC Free-Running Mode

The ADC may perform one additional measurement after clearing ADCn.CTRLA.FREERUN.

##### Work Around

Write ADCn.CTRLA.ENABLE to '0' to stop the Free-Running mode immediately.

### Affected Silicon Revisions

Rev. A
X

#### 2.4.2 ADC Functionality Cannot be Ensured with CLK<sub>ADC</sub> Above 1.5 MHz and a Setting of 25% Duty Cycle

The ADC functionality cannot be ensured if CLK<sub>ADC</sub> > 1.5 MHz with ADCn.CALIB.DUTYCYC set to '1'.

#### Work around

If ADC is operated with CLK<sub>ADC</sub> > 1.5 MHz, ADCn.CALIB.DUTYCYC must be set to '0' (50% duty cycle).

### Affected Silicon Revisions

Rev. A
X

#### 2.4.3 ADC Performance Degrades with CLK<sub>ADC</sub> Above 1.5 MHz and V<sub>DD</sub> < 2.7V

The ADC INL performance degrades if CLK<sub>ADC</sub> > 1.5 MHz and ADCn.CALIB.DUTYCYC set to '0' for V<sub>DD</sub> < 2.7V.

#### Work Around

None.

### Affected Silicon Revisions

Rev. A
X

## 2.5 CCL

#### 2.5.1 The CCL Must be Disabled to Change the Configuration of a Single LUT

To reconfigure a LUT, the CCL peripheral must be disabled (write ENABLE in CCL.CTRLA to '0'). Writing ENABLE to '0' will disable all the LUTs, and affects the LUTs not under reconfiguration.

#### Work Around

None

### Affected Silicon Revisions

Rev. A
X

## 2.6 CRCSCAN

#### 2.6.1 The CRCSCAN Background Mode May Fail During an EEPROM or USERROW Write/Erase

The CRCSCAN module may read incorrect data from Flash if the CPU reads or writes the NVMCTRL registers during an EEPROM or USERROW write/erase.

**Work Around**

There are three possible work arounds:

- Do not read or write to the NVMCTRL registers when an EEPROM or USERROW write/erase is ongoing
- Disable and let the CRCSCAN module complete before starting an EEPROM or USERROW write/erase
- Reset the CRCSCAN module before starting an EEPROM or USERROW write/erase

**Affected Silicon Revisions**

Rev. A
X

**2.7 TCA****2.7.1 Restart Will Reset Counter Direction in NORMAL and FRQ Mode**

When the TCA is configured to the NORMAL or FRQ mode (WGMode in TCAn.CTRLB is '0x0' or '0x1'), a RESTART command or Restart event will reset direction to default. The default is counting upwards.

**Work Around**

None.

**Affected Silicon Revisions**

Rev. A
X

**2.8 TCB****2.8.1 The TCA Restart Command Does Not Force a Restart of TCB**

The TCA restart command does not force restarting the TCB when TCB is running in SYNCUPD mode. TCB is restarted only after a TCA OVF.

**Work Around**

None.

**Affected Silicon Revisions**

Rev. A
X

**2.8.2 Minimum Event Duration Must Exceed the Selected Clock Period**

Event detection will fail if TCBn receives an input event with a high/low period shorter than the period of the selected clock source (CLKSEL in TCBn.CTRLA). This applies to the TCB modes (CNTMODE in TCBn.CTRLB) *Time-Out Check* and *Input Capture Frequency and Pulse-Width Measurement* mode.

**Work Around**

Ensure that the high/low period of input events is equal to or longer than the selected clock source (CLKSEL in TCBn.CTRLA) period.

### Affected Silicon Revisions

Rev. A
X

### 2.8.3 CCMP and CNT Registers Operate as 16-Bit Registers in 8-Bit PWM Mode

When the TCB operates in 8-bit PWM mode (CNTMODE in TCBn.CTRLB is '0x7'), the low and high bytes for the CNT and CCMP registers operate as 16-bit registers for read and write. They cannot be read or written independently.

#### Work Around

Use 16-bit register access. Refer to the data sheet for further information.

### Affected Silicon Revisions

Rev. A
X

## 2.9 USART

### 2.9.1 TXD Pin Override Not Released When Disabling the Transmitter

The USART will not release the TXD pin override if:

- The USART transmitter is disabled by writing the TXEN bit in USART.CTRLB to '0' while the USART receiver is disabled (RXEN in USART.CTRLB is '0')
- Both the USART transmitter and receiver are disabled at the same time by writing the TXEN and RXEN bits in USART.CTRLB to '0'

#### Work Around

There are two possible work arounds:

- Make sure the receiver is enabled (RXEN in USART.CTRLB is '1') while disabling the transmitter (writing TXEN in USART.CTRLB to '0')
- Writing to any register in the USART after disabling the transmitter will start the USART for long enough to release the pin override of the TXD pin

### Affected Silicon Revisions

Rev. A
X

### 2.9.2 Open-Drain Mode Does Not Work When TXD is Configured as Output

When the USART TXD pin is configured as an output, it can drive the pin high regardless of whether the Open-Drain mode is enabled or not.

#### Work Around

Configure the TXD pin as an input by writing the corresponding bit in PORTx.DIR to '0' when using Open-Drain mode.

### Affected Silicon Revisions

Rev. A
--------



X
---

### 2.9.3 Start-of-Frame Detection Can Unintentionally Be Triggered in Active Mode

The Start-of-Frame Detection feature enables the USART to wake up from Standby sleep mode upon data reception.

The Start-of-Frame Detector can unintentionally be triggered when the Start-of-Frame Detection Enable (SFDEN) bit in the USART Control B (USARTn.CTRLB) register is set, and the device is in Active mode. If the Receive Data (RXDATA) registers are read while receiving new data, the Receive Complete Interrupt Flag (RXCIF) in the USARTn.STATUS register is cleared. This results in the Start-of-Frame Detector being triggered and falsely detecting the following falling edge as a start bit. When the Start-of-Frame Detector detects a start condition, the frame reception is restarted, resulting in corrupt received data.

Note that the USART Receive Start Interrupt Flag (RXSIF) always is '0' when in Active mode. No interrupt will be triggered.

#### Work Around

Disable Start-of-Frame Detection by writing '0' to the Start-of-Frame Detection Enable (SFDEN) bit in the USART Control B (USARTn.CTRLB) register when the device is in Active mode. Enable it again by writing the bit to '1' before transitioning to Standby sleep mode. This work around depends on a protocol preventing a new incoming frame when re-enabling Start-of-Frame Detection. Re-enabling Start-of-Frame Detection, while a new frame is already incoming, will result in corrupted received data.

#### Affected Silicon Revisions

Rev. A
--------

X
---

### 3. Data Sheet Clarifications

None.

## 4. Document Revision History

**Note:** The data sheet clarification document revision is independent of the die revision and the device variant (last letter of the ordering number).

### 4.1 Revision History

Doc Rev.	Date	Comments
B	02/2021	<ul style="list-style-type: none"> <li>Added new errata:               <ul style="list-style-type: none"> <li>Device: <a href="#">2.2.1 Writing the OSCLOCK Fuse in FUSE.OSCCFG to '1' Prevents Automatic Loading of Calibration Values</a></li> <li>CCL: <a href="#">2.5.1 The CCL Must be Disabled to Change the Configuration of a Single LUT</a></li> <li>CRCSCAN: <a href="#">2.6.1 The CRCSCAN Background Mode May Fail During an EEPROM or USERROW Write/Erase</a></li> <li>TCA: <a href="#">2.7.1 Restart Will Reset Counter Direction in NORMAL and FRQ Mode</a></li> <li>TCB: <a href="#">2.8.3 CCMP and CNT Registers Operate as 16-Bit Registers in 8-Bit PWM Mode</a></li> <li>USART:                   <ul style="list-style-type: none"> <li><a href="#">2.9.2 Open-Drain Mode Does Not Work When TXD is Configured as Output</a></li> <li><a href="#">2.9.3 Start-of-Frame Detection Can Unintentionally Be Triggered in Active Mode</a></li> </ul> </li> </ul> </li> </ul>
A	01/2020	<ul style="list-style-type: none"> <li>Document               <ul style="list-style-type: none"> <li>Change document structure from one document for the entire megaAVR 0-series to one document per data sheet:                   <ul style="list-style-type: none"> <li>from: megaAVR-0-series-Errata-and-Clarification-80000777C.pdf</li> <li>to: ATmega808_809_1608_1609-Errata-and-Clarification-DS80000868A.pdf</li> </ul> </li> <li>Updated document template</li> </ul> </li> <li>Errata               <ul style="list-style-type: none"> <li>The ADC errata, ADC Functionality Cannot be Ensured with ADCCLK Above 1.5 MHz for All Conditions, has been split into two separate erratas and rewritten</li> </ul> </li> </ul>

### 4.2 Appendix - Obsolete Revision History

**Note:** Due to document structure change from a single megaAVR 0-series to one document per data sheet, the following history from [www.microchip.com/DS80000777](http://www.microchip.com/DS80000777) is provided as reference.

Doc Rev.	Date	Comments
C	08/2019	<ul style="list-style-type: none"> <li>New Errata:               <ul style="list-style-type: none"> <li>CPUINT: Interrupt Level 1 Does Not Work</li> </ul> </li> </ul> <p><b>Note:</b> Only applicable to ATmega4808/4809 for specific date codes.</p>

# ATmega808/809/1608/1609 Silicon Err...

## Document Revision History

.....continued		
Doc Rev.	Date	Comments
B	07/2019	<ul style="list-style-type: none"><li>• Document<ul style="list-style-type: none"><li>– Adding variants with 16 KB and 8 KB Flash</li><li>– Adding 40-pin variant of ATmega4809</li><li>– Changing document title</li><li>– Adding section "Data Sheet Clarifications"</li></ul></li><li>• New Errata:<ul style="list-style-type: none"><li>– PORTMUX: SPI SS is Connected to Pin Even if SPI is Configured to Have No Port Connection</li><li>– TCB: Minimum Event Duration Must Exceed Selected Clock Period</li><li>– USART: TXD Pin Override Not Released When Disabling the Transmitter</li></ul></li><li>• Erratum for TCA removed: Issuing a restart will clear the direction bit - the data sheet is describing this correctly.</li></ul>
A	02/2018	<ul style="list-style-type: none"><li>• Initial document release.</li></ul>

## The Microchip Website

---

Microchip provides online support via our website at [www.microchip.com/](http://www.microchip.com/). This website is used to make files and information easily available to customers. Some of the content available includes:

- **Product Support** – Data sheets and errata, application notes and sample programs, design resources, user's guides and hardware support documents, latest software releases and archived software
- **General Technical Support** – Frequently Asked Questions (FAQs), technical support requests, online discussion groups, Microchip design partner program member listing
- **Business of Microchip** – Product selector and ordering guides, latest Microchip press releases, listing of seminars and events, listings of Microchip sales offices, distributors and factory representatives

## Product Change Notification Service

---

Microchip's product change notification service helps keep customers current on Microchip products. Subscribers will receive email notification whenever there are changes, updates, revisions or errata related to a specified product family or development tool of interest.

To register, go to [www.microchip.com/pcn](http://www.microchip.com/pcn) and follow the registration instructions.

## Customer Support

---

Users of Microchip products can receive assistance through several channels:

- Distributor or Representative
- Local Sales Office
- Embedded Solutions Engineer (ESE)
- Technical Support

Customers should contact their distributor, representative or ESE for support. Local sales offices are also available to help customers. A listing of sales offices and locations is included in this document.

Technical support is available through the website at: [www.microchip.com/support](http://www.microchip.com/support)

## Microchip Devices Code Protection Feature

---

Note the following details of the code protection feature on Microchip devices:

- Microchip products meet the specifications contained in their particular Microchip Data Sheet.
- Microchip believes that its family of products is secure when used in the intended manner and under normal conditions.
- There are dishonest and possibly illegal methods being used in attempts to breach the code protection features of the Microchip devices. We believe that these methods require using the Microchip products in a manner outside the operating specifications contained in Microchip's Data Sheets. Attempts to breach these code protection features, most likely, cannot be accomplished without violating Microchip's intellectual property rights.
- Microchip is willing to work with any customer who is concerned about the integrity of its code.
- Neither Microchip nor any other semiconductor manufacturer can guarantee the security of its code. Code protection does not mean that we are guaranteeing the product is "unbreakable." Code protection is constantly evolving. We at Microchip are committed to continuously improving the code protection features of our products. Attempts to break Microchip's code protection feature may be a violation of the Digital Millennium Copyright Act. If such acts allow unauthorized access to your software or other copyrighted work, you may have a right to sue for relief under that Act.

## Legal Notice

---

Information contained in this publication is provided for the sole purpose of designing with and using Microchip products. Information regarding device applications and the like is provided only for your convenience and may be superseded by updates. It is your responsibility to ensure that your application meets with your specifications.

THIS INFORMATION IS PROVIDED BY MICROCHIP "AS IS". MICROCHIP MAKES NO REPRESENTATIONS OR WARRANTIES OF ANY KIND WHETHER EXPRESS OR IMPLIED, WRITTEN OR ORAL, STATUTORY OR OTHERWISE, RELATED TO THE INFORMATION INCLUDING BUT NOT LIMITED TO ANY IMPLIED WARRANTIES OF NON-INFRINGEMENT, MERCHANTABILITY, AND FITNESS FOR A PARTICULAR PURPOSE OR WARRANTIES RELATED TO ITS CONDITION, QUALITY, OR PERFORMANCE.

IN NO EVENT WILL MICROCHIP BE LIABLE FOR ANY INDIRECT, SPECIAL, PUNITIVE, INCIDENTAL OR CONSEQUENTIAL LOSS, DAMAGE, COST OR EXPENSE OF ANY KIND WHATSOEVER RELATED TO THE INFORMATION OR ITS USE, HOWEVER CAUSED, EVEN IF MICROCHIP HAS BEEN ADVISED OF THE POSSIBILITY OR THE DAMAGES ARE FORESEEABLE. TO THE FULLEST EXTENT ALLOWED BY LAW, MICROCHIP'S TOTAL LIABILITY ON ALL CLAIMS IN ANY WAY RELATED TO THE INFORMATION OR ITS USE WILL NOT EXCEED THE AMOUNT OF FEES, IF ANY, THAT YOU HAVE PAID DIRECTLY TO MICROCHIP FOR THE INFORMATION. Use of Microchip devices in life support and/or safety applications is entirely at the buyer's risk, and the buyer agrees to defend, indemnify and hold harmless Microchip from any and all damages, claims, suits, or expenses resulting from such use. No licenses are conveyed, implicitly or otherwise, under any Microchip intellectual property rights unless otherwise stated.

## Trademarks

---

The Microchip name and logo, the Microchip logo, Adaptec, AnyRate, AVR, AVR logo, AVR Freaks, BesTime, BitCloud, chipKIT, chipKIT logo, CryptoMemory, CryptoRF, dsPIC, FlashFlex, flexPWR, HELDO, IGLOO, JukeBlox, KeeLoq, Klear, LANCheck, LinkMD, maXStylus, maXTouch, MediaLB, megaAVR, Microsemi, Microsemi logo, MOST, MOST logo, MPLAB, OptoLyzer, PackTime, PIC, picoPower, PICSTART, PIC32 logo, PolarFire, Prochip Designer, QTouch, SAM-BA, SenGenuity, SpyNIC, SST, SST Logo, SuperFlash, Symmetricom, SyncServer, Tachyon, TimeSource, tinyAVR, UNI/O, Vectron, and XMEGA are registered trademarks of Microchip Technology Incorporated in the U.S.A. and other countries.

AgileSwitch, APT, ClockWorks, The Embedded Control Solutions Company, EtherSynch, FlashTec, Hyper Speed Control, HyperLight Load, IntelliMOS, Libero, motorBench, mTouch, Powermite 3, Precision Edge, ProASIC, ProASIC Plus, ProASIC Plus logo, Quiet-Wire, SmartFusion, SyncWorld, Temux, TimeCesium, TimeHub, TimePictra, TimeProvider, WinPath, and ZL are registered trademarks of Microchip Technology Incorporated in the U.S.A.

Adjacent Key Suppression, AKS, Analog-for-the-Digital Age, Any Capacitor, AnyIn, AnyOut, Augmented Switching, BlueSky, BodyCom, CodeGuard, CryptoAuthentication, CryptoAutomotive, CryptoCompanion, CryptoController, dsPICDEM, dsPICDEM.net, Dynamic Average Matching, DAM, ECAN, Espresso T1S, EtherGREEN, IdealBridge, In-Circuit Serial Programming, ICSP, INICnet, Intelligent Paralleling, Inter-Chip Connectivity, JitterBlocker, maxCrypto, maxView, memBrain, Mindi, MiWi, MPASM, MPF, MPLAB Certified logo, MPLIB, MPLINK, MultiTRAK, NetDetach, Omniscient Code Generation, PICDEM, PICDEM.net, PICKit, PICtail, PowerSmart, PureSilicon, QMatrix, REAL ICE, Ripple Blocker, RTAX, RTG4, SAM-ICE, Serial Quad I/O, simpleMAP, SimpliPHY, SmartBuffer, SMART-I.S., storClad, SQL, SuperSwitcher, SuperSwitcher II, Switchtec, SynchroPHY, Total Endurance, TSHARC, USBCheck, VariSense, VectorBlox, VeriPHY, ViewSpan, WiperLock, XpressConnect, and ZENA are trademarks of Microchip Technology Incorporated in the U.S.A. and other countries.

SQTP is a service mark of Microchip Technology Incorporated in the U.S.A.

The Adaptec logo, Frequency on Demand, Silicon Storage Technology, and Symmcom are registered trademarks of Microchip Technology Inc. in other countries.

GestIC is a registered trademark of Microchip Technology Germany II GmbH & Co. KG, a subsidiary of Microchip Technology Inc., in other countries.

All other trademarks mentioned herein are property of their respective companies.

© 2021, Microchip Technology Incorporated, Printed in the U.S.A., All Rights Reserved.

ISBN: 978-1-5224-7546-0

## Quality Management System

---

For information regarding Microchip's Quality Management Systems, please visit [www.microchip.com/quality](http://www.microchip.com/quality).

## Worldwide Sales and Service

AMERICAS	ASIA/PACIFIC	ASIA/PACIFIC	EUROPE
<b>Corporate Office</b> 2355 West Chandler Blvd. Chandler, AZ 85224-6199 Tel: 480-792-7200 Fax: 480-792-7277 Technical Support: <a href="http://www.microchip.com/support">www.microchip.com/support</a> Web Address: <a href="http://www.microchip.com">www.microchip.com</a>	<b>Australia - Sydney</b> Tel: 61-2-9868-6733 <b>China - Beijing</b> Tel: 86-10-8569-7000 <b>China - Chengdu</b> Tel: 86-28-8665-5511 <b>China - Chongqing</b> Tel: 86-23-8980-9588 <b>China - Dongguan</b> Tel: 86-769-8702-9880 <b>China - Guangzhou</b> Tel: 86-20-8755-8029 <b>China - Hangzhou</b> Tel: 86-571-8792-8115 <b>China - Hong Kong SAR</b> Tel: 852-2943-5100 <b>China - Nanjing</b> Tel: 86-25-8473-2460 <b>China - Qingdao</b> Tel: 86-532-8502-7355 <b>China - Shanghai</b> Tel: 86-21-3326-8000 <b>China - Shenyang</b> Tel: 86-24-2334-2829 <b>China - Shenzhen</b> Tel: 86-755-8864-2200 <b>China - Suzhou</b> Tel: 86-186-6233-1526 <b>China - Wuhan</b> Tel: 86-27-5980-5300 <b>China - Xian</b> Tel: 86-29-8833-7252 <b>China - Xiamen</b> Tel: 86-592-2388138 <b>China - Zhuhai</b> Tel: 86-756-3210040	<b>India - Bangalore</b> Tel: 91-80-3090-4444 <b>India - New Delhi</b> Tel: 91-11-4160-8631 <b>India - Pune</b> Tel: 91-20-4121-0141 <b>Japan - Osaka</b> Tel: 81-6-6152-7160 <b>Japan - Tokyo</b> Tel: 81-3-6880-3770 <b>Korea - Daegu</b> Tel: 82-53-744-4301 <b>Korea - Seoul</b> Tel: 82-2-554-7200 <b>Malaysia - Kuala Lumpur</b> Tel: 60-3-7651-7906 <b>Malaysia - Penang</b> Tel: 60-4-227-8870 <b>Philippines - Manila</b> Tel: 63-2-634-9065 <b>Singapore</b> Tel: 65-6334-8870 <b>Taiwan - Hsin Chu</b> Tel: 886-3-577-8366 <b>Taiwan - Kaohsiung</b> Tel: 886-7-213-7830 <b>Taiwan - Taipei</b> Tel: 886-2-2508-8600 <b>Thailand - Bangkok</b> Tel: 66-2-694-1351 <b>Vietnam - Ho Chi Minh</b> Tel: 84-28-5448-2100	<b>Austria - Wels</b> Tel: 43-7242-2244-39 Fax: 43-7242-2244-393 <b>Denmark - Copenhagen</b> Tel: 45-4485-5910 Fax: 45-4485-2829 <b>Finland - Espoo</b> Tel: 358-9-4520-820 <b>France - Paris</b> Tel: 33-1-69-53-63-20 Fax: 33-1-69-30-90-79 <b>Germany - Garching</b> Tel: 49-8931-9700 <b>Germany - Haan</b> Tel: 49-2129-3766400 <b>Germany - Heilbronn</b> Tel: 49-7131-72400 <b>Germany - Karlsruhe</b> Tel: 49-721-625370 <b>Germany - Munich</b> Tel: 49-89-627-144-0 Fax: 49-89-627-144-44 <b>Germany - Rosenheim</b> Tel: 49-8031-354-560 <b>Israel - Ra'anana</b> Tel: 972-9-744-7705 <b>Italy - Milan</b> Tel: 39-0331-742611 Fax: 39-0331-466781 <b>Italy - Padova</b> Tel: 39-049-7625286 <b>Netherlands - Drunen</b> Tel: 31-416-690399 Fax: 31-416-690340 <b>Norway - Trondheim</b> Tel: 47-72884388 <b>Poland - Warsaw</b> Tel: 48-22-3325737 <b>Romania - Bucharest</b> Tel: 40-21-407-87-50 <b>Spain - Madrid</b> Tel: 34-91-708-08-90 Fax: 34-91-708-08-91 <b>Sweden - Gothenberg</b> Tel: 46-31-704-60-40 <b>Sweden - Stockholm</b> Tel: 46-8-5090-4654 <b>UK - Wokingham</b> Tel: 44-118-921-5800 Fax: 44-118-921-5820



## SYST-09TYIJ481 - ERRATA - ATmega808/809/1608/1609 Silicon Errata and Data Sheet Clarification

### Affected Catalog Part Numbers(CPN)

ATMEGA1608-AF  
ATMEGA1608-AFR  
ATMEGA1608-AU  
ATMEGA1608-AUR  
ATMEGA1608-MF  
ATMEGA1608-MFR  
ATMEGA1608-MU  
ATMEGA1608-MUR  
ATMEGA1608-XF  
ATMEGA1608-XFR  
ATMEGA1608-XU  
ATMEGA1608-XUR  
ATMEGA1609-AF  
ATMEGA1609-AFR  
ATMEGA1609-AU  
ATMEGA1609-AUR  
ATMEGA1609-MF  
ATMEGA1609-MFR  
ATMEGA1609-MU  
ATMEGA1609-MUR  
ATMEGA808-AF  
ATMEGA808-AFR  
ATMEGA808-AU  
ATMEGA808-AUR  
ATMEGA808-MF  
ATMEGA808-MFR  
ATMEGA808-MU  
ATMEGA808-MUR  
ATMEGA808-XF  
ATMEGA808-XFR  
ATMEGA808-XU  
ATMEGA808-XUR  
ATMEGA809-AF  
ATMEGA809-AFR  
ATMEGA809-AU  
ATMEGA809-AUR  
ATMEGA809-MF  
ATMEGA809-MFR  
ATMEGA809-MU  
ATMEGA809-MUR