



## Product Change Notification / SYST-15IXFZ775

---

### Date:

16-Jul-2021

### Product Category:

32-bit Microcontrollers

### PCN Type:

Document Change

### Notification Subject:

ERRATA - SAM L10/L11 Family Silicon Errata and Data Sheet Clarification Document Revision

### Affected CPNs:

[SYST-15IXFZ775\\_Affected\\_CPN\\_07162021.pdf](#)

[SYST-15IXFZ775\\_Affected\\_CPN\\_07162021.csv](#)

### Notification Text:

SYST-15IXFZ775

Microchip has released a new Product Documents for the SAM L10/L11 Family Silicon Errata and Data Sheet Clarification of devices. If you are using one of these devices please read the document located at [SAM L10/L11 Family Silicon Errata and Data Sheet Clarification](#).

### Notification Status: Final

#### Description of Change:

The SPI, I2S, and I2C standards use the terminology "Master" and "Slave". The equivalent Microchip terminology used in this document is "Host" and "Client" respectively. These terms have been updated throughout this document for this revision.

This revision contains numerous typographical updates, and formatting updates.

Obsolete Data Sheet Clarifications have been removed in this update.

The following errata were added in this revision:

- RTC: 2.9.12 Active Layer Protection
- SERCOM I2C: 2.10.11 Automatic Acknowledge
- TC: 2.13.4 PER register (8-bit mode)
- EVSYS: 2.18.3 Spurious Overrun
- EVSYS: 2.18.4 Software Event
- EVSYS: 2.18.5 PAC Write-Protection
- OSCCTRL: 2.19.4 FDPLL96M On Demand in Standby
- OSCCTRL: 2.19.5 DFLLULP Dithering Mode
- NVMCTRL: 2.22.1 Data FLASH Silent Access and Scrambling

**Impacts to Data Sheet:** None

**Reason for Change:** To Improve Productivity

**Change Implementation Status:** Complete

**Date Document Changes Effective:** 15 Jul 2021

**NOTE:** Please be advised that this is a change to the document only the product has not been changed.

**Markings to Distinguish Revised from Unrevised Devices:** N/A

## Attachments:

[SAM L10/L11 Family Silicon Errata and Data Sheet Clarification](#)

Please contact your local [Microchip sales office](#) with questions or concerns regarding this notification.

## Terms and Conditions:

If you wish to receive Microchip PCNs via email please register for our PCN email service at our [PCN home page](#) select register then fill in the required fields. You will find instructions about registering for Microchips PCN email service in the [PCN FAQ](#) section.

If you wish to change your PCN profile, including opt out, please go to the [PCN home page](#) select login and sign into your myMicrochip account. Select a profile option from the left navigation bar and make the applicable selections.

Affected Catalog Part Numbers (CPN)

ATSAML10D14A-MF  
ATSAML10D14A-MFT  
ATSAML10D14A-MU  
ATSAML10D14A-MUT  
ATSAML10D14A-YF  
ATSAML10D14A-YFT  
ATSAML10D14A-YU  
ATSAML10D14A-YUT  
ATSAML10D15A-MF  
ATSAML10D15A-MFT  
ATSAML10D15A-MU  
ATSAML10D15A-MUT  
ATSAML10D15A-MZ  
ATSAML10D15A-MZT  
ATSAML10D15A-YF  
ATSAML10D15A-YFT  
ATSAML10D15A-YU  
ATSAML10D15A-YUT  
ATSAML10D16A-MF  
ATSAML10D16A-MFT  
ATSAML10D16A-MU  
ATSAML10D16A-MUT  
ATSAML10D16A-MZ  
ATSAML10D16A-MZT  
ATSAML10D16A-MZTV01  
ATSAML10D16A-MZTVAO  
ATSAML10D16A-YF  
ATSAML10D16A-YFT  
ATSAML10D16A-YU  
ATSAML10D16A-YUT  
ATSAML10E14A-AF  
ATSAML10E14A-AFT  
ATSAML10E14A-AU  
ATSAML10E14A-AUT  
ATSAML10E14A-MF  
ATSAML10E14A-MFT  
ATSAML10E14A-MU  
ATSAML10E14A-MUT  
ATSAML10E14A-UUT  
ATSAML10E15A-AF  
ATSAML10E15A-AFT  
ATSAML10E15A-AU  
ATSAML10E15A-AUT  
ATSAML10E15A-AZ  
ATSAML10E15A-AZT  
ATSAML10E15A-MF

ATSAML10E15A-MFT  
ATSAML10E15A-MU  
ATSAML10E15A-MUT  
ATSAML10E15A-MZ  
ATSAML10E15A-MZT  
ATSAML10E15A-UUT  
ATSAML10E16A-AF  
ATSAML10E16A-AFT  
ATSAML10E16A-AU  
ATSAML10E16A-AUT  
ATSAML10E16A-AZ  
ATSAML10E16A-AZT  
ATSAML10E16A-MF  
ATSAML10E16A-MFT  
ATSAML10E16A-MU  
ATSAML10E16A-MUT  
ATSAML10E16A-MZ  
ATSAML10E16A-MZT  
ATSAML10E16A-MZTV02  
ATSAML10E16A-UUT  
ATSAML11D14A-MF  
ATSAML11D14A-MFT  
ATSAML11D14A-MU  
ATSAML11D14A-MUT  
ATSAML11D14A-YF  
ATSAML11D14A-YFT  
ATSAML11D14A-YU  
ATSAML11D14A-YUT  
ATSAML11D15A-MF  
ATSAML11D15A-MFKPH  
ATSAML11D15A-MFT  
ATSAML11D15A-MFTKPH  
ATSAML11D15A-MU  
ATSAML11D15A-MUKPH  
ATSAML11D15A-MUT  
ATSAML11D15A-MUTKPH  
ATSAML11D15A-MZ  
ATSAML11D15A-MZT  
ATSAML11D15A-YF  
ATSAML11D15A-YFT  
ATSAML11D15A-YU  
ATSAML11D15A-YUT  
ATSAML11D16A-MF  
ATSAML11D16A-MFKPH  
ATSAML11D16A-MFT  
ATSAML11D16A-MFTKPH  
ATSAML11D16A-MU  
ATSAML11D16A-MUKPH  
ATSAML11D16A-MUT

ATSAML11D16A-MUTKPH  
ATSAML11D16A-MZ  
ATSAML11D16A-MZT  
ATSAML11D16A-YF  
ATSAML11D16A-YFT  
ATSAML11D16A-YU  
ATSAML11D16A-YUT  
ATSAML11E14A-AF  
ATSAML11E14A-AFT  
ATSAML11E14A-AU  
ATSAML11E14A-AUT  
ATSAML11E14A-MF  
ATSAML11E14A-MFT  
ATSAML11E14A-MU  
ATSAML11E14A-MUT  
ATSAML11E14A-UUT  
ATSAML11E15A-AF  
ATSAML11E15A-AFKPH  
ATSAML11E15A-AFT  
ATSAML11E15A-AFTKPH  
ATSAML11E15A-AU  
ATSAML11E15A-AUKPH  
ATSAML11E15A-AUT  
ATSAML11E15A-AUTKPH  
ATSAML11E15A-AZ  
ATSAML11E15A-AZT  
ATSAML11E15A-MF  
ATSAML11E15A-MFKPH  
ATSAML11E15A-MFT  
ATSAML11E15A-MFTKPH  
ATSAML11E15A-MU  
ATSAML11E15A-MUKPH  
ATSAML11E15A-MUT  
ATSAML11E15A-MUTKPH  
ATSAML11E15A-MZ  
ATSAML11E15A-MZT  
ATSAML11E15A-UUT  
ATSAML11E16A-AF  
ATSAML11E16A-AFKPH  
ATSAML11E16A-AFT  
ATSAML11E16A-AFTKPH  
ATSAML11E16A-AU  
ATSAML11E16A-AUKPH  
ATSAML11E16A-AUT  
ATSAML11E16A-AUTKPH  
ATSAML11E16A-AZ  
ATSAML11E16A-AZT  
ATSAML11E16A-MF  
ATSAML11E16A-MFKPH

ATSAML11E16A-MFT  
ATSAML11E16A-MFTKPH  
ATSAML11E16A-MU  
ATSAML11E16A-MUKPH  
ATSAML11E16A-MUT  
ATSAML11E16A-MUTKPH  
ATSAML11E16A-MZ  
ATSAML11E16A-MZT  
ATSAML11E16A-MZTVAO  
ATSAML11E16A-UUT



# SAM L10/L11 Family

## Silicon Errata and Data Sheet Clarification

### SAM L10/L11 Family

The SAM L10/L11 family of devices that you have received conform functionally to the current Device Data Sheet (DS60001513G), except for the anomalies described in this document.

The silicon issues discussed in the following pages are for silicon revisions with the Device and Revision IDs listed in the following tables. The silicon issues are summarized in the [Silicon Issue Summary](#).

The errata described in this document will be addressed in future revisions of the SAM L10/L11 family silicon.

**Note:** This document summarizes all silicon errata issues from all revisions of silicon, previous as well as current.

Data Sheet clarifications and corrections (if applicable) are located in [3. Data Sheet Clarifications](#), following the discussion of silicon issues.

**Table 1. SAM L10 Family Silicon Device Identification**

Part Number	Device ID (DID[31:0])	Revision (DID.REVISION[3:0])
		B
SAML10E16A	0x2084xx00	0x1
SAML10E15A	0x2084xx01	
SAML10E14A	0x2084xx02	
SAML10D16A	0x2084xx03	
SAML10D15A	0x2084xx04	
SAML10D14A	0x2084xx05	

**Table 2. SAM L11 Family Silicon Device Identification**

Part Number	Device ID (DID[31:0])	Revision (DID.REVISION[3:0])
		B
SAML11E16A	0x2083xx00	0x1
SAML11E15A	0x2083xx01	
SAML11E14A	0x2083xx02	
SAML11D16A	0x2083xx03	
SAML11D15A	0x2083xx04	
SAML11D14A	0x2083xx05	

**Note:** Refer to the “Device Service Unit” chapter in the current Device Data Sheet (DS60001513G) for detailed information on Device Identification and Revision IDs for your specific device.

## Table of Contents

SAM L10/L11 Family.....	1
1. Silicon Issue Summary.....	3
2. SAM L10/L11 Errata Issues.....	8
2.1. Analog-to-Digital Converter (ADC).....	8
2.2. Configurable Custom Logic (CCL).....	8
2.3. DEVICE.....	9
2.4. Direct Memory Access Controller (DMAC).....	10
2.5. External Interrupt Controller (EIC).....	10
2.6. Frequency Meter (FREQM).....	11
2.7. Main Clock (MCLK).....	11
2.8. Operational Amplifier Controller (OPAMP).....	12
2.9. Real Time Clock (RTC).....	13
2.10. Serial Communication Interface Inter-Integrated Circuit (SERCOM I <sup>2</sup> C) .....	17
2.11. Serial Communication Serial Peripheral Interface (SERCOM SPI).....	20
2.12. Serial Communication Interface USART (SERCOM USART).....	21
2.13. Timer Counter (TC).....	23
2.14. True Random Number Generator (TRNG).....	24
2.15. Supply Controller (SUPC).....	25
2.16. OSC32KCTRL.....	25
2.17. Boot ROM.....	27
2.18. Event System (EVSYS).....	27
2.19. Oscillator Controller (OSCCTRL).....	29
2.20. PORT I/O Controller (PORT).....	30
2.21. Trust Ram (TRAM).....	31
2.22. Non Volatile Memory Controller (NVMCTRL).....	31
3. Data Sheet Clarifications.....	32
4. Revision History.....	33
The Microchip Web Site.....	35
Customer Change Notification Service.....	35
Customer Support.....	35
Microchip Devices Code Protection Feature.....	35
Legal Notice.....	36
Trademarks.....	36
Quality Management System Certified by DNV.....	36
Worldwide Sales and Service.....	37



## 1. Silicon Issue Summary

Table 1-1. Silicon Issue Summary

Module	Feature	Errata Number	Summary	Device	Affected Silicon Revisions
					B
ADC	Reference Buffer Offset Compensation	2.1.1	First ADC conversions are incorrect when using Reference Buffer Offset Compensation.	SAM L10	X
				SAM L11	X
ADC	Offset Correction	2.1.2	Offset correction is not supported in the 8-bit and 10-bit conversion resolution.	SAM L10	X
				SAM L11	X
CCL	PAC protection	2.2.1	Writing the Software Reset bit in the Control A register will trigger a PAC protection error.	SAM L10	X
				SAM L11	X
CCL	Enable-protected Registers	2.2.2	The SEQCTRL0 and LUCTRL0/1 registers are enable-protected by the CTRL.ENABLE bit.	SAM L10	X
				SAM L11	X
CCL	Sequential logic	2.2.3	LUT Output is corrupted after enabling CCL when sequential logic is used.	SAM L10	X
				SAM L11	X
Device	Temperature sensor	2.3.1	Temperature sensor is not functional.	SAM L10	X
				SAM L11	X
Device	Standby Entry	2.3.2	Potential hard fault upon standby entry when SysTick interrupt is enabled	SAM L10	X
				SAM L11	X
DMAC	Concurrent Channels Trigger	2.4.1	When using concurrent channel triggers, DMA write-back descriptors may get corrupted.	SAM L10	X
				SAM L11	X
EIC	PAC protection	2.5.1	8-bit and 16-bit reads/writes on the reserved areas of the EIC registers mapping starting from EVCTRL register do not generate a PAC protection error.	SAM L10	X
				SAM L11	X
FREQM	PAC protection	2.6.1	FREQM reads on the Control B register generate a PAC protection error.	SAM L10	X
				SAM L11	X
MCLK	PAC protection	2.7.1	Writes to the MCLK Control A register do not generate a PAC protection error even if this register has been write-protected using the PAC.	SAM L10	X
				SAM L11	X
MCLK	DFLLULP clock	2.7.2	Hardfault exception after having selected DFLLULP clock as main clock.	SAM L10	X
				SAM L11	X
OPAMP	Reference buffer	2.8.1	The internal reference REFBUF is not generated when the voltage doubler is disabled.	SAM L10	X
				SAM L11	X
OPAMP	High Gain Instrumentation Amplifier	2.8.2	High Gain Instrumentation Amplifier is not functional.	SAM L10	X
				SAM L11	X
RTC	Tamper detection	2.9.1	Tamper detection limitation when CTRLB.SEPTO = 0.	SAM L10	X
				SAM L11	X
RTC	Event generation	2.9.2	Periodic Daily Event (PERD) Event Generator never occurs in Clock/Calendar mode.	SAM L10	X
				SAM L11	X
RTC	Write corruption	2.9.3	RTC COUNT and CLOCK registers write corruption.	SAM L10	X
				SAM L11	X

# SAM L10/L11 Family

## Silicon Issue Summary

.....continued

Module	Feature	Errata Number	Summary	Device	Affected Silicon Revisions
					B
RTC	Tamper Detection Timestamp	2.9.4	If an external reset occurs during a tamper detection, the TIMESTAMP register will not be updated when next tamper detection is triggered.	SAM L10	X
				SAM L11	X
RTC	Prescaler	2.9.5	When the tamper or debouncing features (TAMPCTRL) are enabled, periodic interrupts and events are generated when the prescaler is OFF (CTRLA.PRESCALER=0).	SAM L10	X
				SAM L11	X
RTC	Active Layer Protection	2.9.6	Active Layer Protection feature is limited to one tamper channel n (i.e. one RTC INn/OUTn pair).	SAM L10	X
				SAM L11	X
RTC	Tamper Detection Timestamp	2.9.7	The INTFLAG.TAMPER bit is not reset by reading the TIMESTAMP register.	SAM L10	X
				SAM L11	X
RTC	Tamper Detection Timestamp	2.9.8	A wrong timestamp value can be returned if more than one CPU and DMA accesses to the TIMESTAMP register are performed upon a INTFLAG.TAMPER assertion.	SAM L10	X
				SAM L11	X
RTC	Tamper Detection	2.9.9	If the Tamper Channel n Action is set to WAKE or CAPTURE and the Active Layer Protection is enabled for this channel, no tampers are detected on this channel n.	SAM L10	X
				SAM L11	X
RTC	Tamper Detection	2.9.10	False tamper detections may occur when configuring the RTC INn and OUTn pins.	SAM L10	X
				SAM L11	X
RTC	General Purpose Registers	2.9.11	General Purpose Registers n (GPn) are reset on tamper detection even if GPTRST = 0.	SAM L10	X
				SAM L11	X
RTC	Active Layer Protection	2.9.12	When the RTC is configured in Active Layer Protection mode (TAMPCTRL.INACT = 0x3) and the RTC CTRLA.ENABLE bit is not set, a tamper can be detected and a timestamp captured. The TAMPID register and INTFLAG.TAMPER bit may not be set.	SAM L10	X
				SAM L11	X
SERCOM I <sup>2</sup> C	High-speed mode	2.10.1	When configured in HS or Fast-Mode Plus, SDA and SCL fall times are shorter than I <sup>2</sup> C specification requirement and can lead to reflection.	SAM L10	X
				SAM L11	X
SERCOM I <sup>2</sup> C	Repeated start	2.10.2	Bus error is generated during a Repeated Start (when QCEN = 1 and SCLSM = 1).	SAM L10	X
				SAM L11	X
SERCOM I <sup>2</sup> C	Repeated Start / Host mode 10-bit	2.10.3	Repeated Start in 10-bit addressing mode for Host Write operations does not work.	SAM L10	X
				SAM L11	X
SERCOM I <sup>2</sup> C	Repeated Start / Host mode 10-bit	2.10.4	Repeated Start is not supported for High-Speed mode Host Read operations.	SAM L10	X
				SAM L11	X
SERCOM I <sup>2</sup> C	Repeated Start / High-Speed mode	2.10.5	Repeated Start is not supported for High-Speed mode Host Write operations.	SAM L10	X
				SAM L11	X
SERCOM I <sup>2</sup> C	Client Mode with DMA	2.10.6	Character lost in I <sup>2</sup> C Client mode with DMA when a NACK occurs.	SAM L10	X
				SAM L11	X
SERCOM I <sup>2</sup> C	Client mode 10-bit	2.10.7	I <sup>2</sup> C Client 10-bit addressing mode is not functional.	SAM L10	X
				SAM L11	X
SERCOM I <sup>2</sup> C	Status Flags	2.10.8	BUSERR, COLL, LOWTOUT, SEXTTOUT and LENERR Status register bits are not automatically cleared.	SAM L10	X
				SAM L11	X
SERCOM I <sup>2</sup> C	Status Flags	2.10.9	The CLKHOLD Status bit is not read only.	SAM L10	X
				SAM L11	X

# SAM L10/L11 Family

## Silicon Issue Summary

.....continued

Module	Feature	Errata Number	Summary	Device	Affected Silicon Revisions
					B
SERCOM I <sup>2</sup> C	Status Flags	2.10.10	When an unexpected STOP occurs on the I <sup>2</sup> C bus the STATUS.BUSERR & INTFLAG.ERROR bits are set but may not wake the system from sleep mode.	SAM L10	X
				SAM L11	X
SERCOM I <sup>2</sup> C	Automatic Acknowledge	2.10.11	The I <sup>2</sup> C Client Automatic Acknowledge feature (CTRLB.AACKEN = 1) is not supported when doing a repeated start.	SAM L10	X
				SAM L11	X
SERCOM SPI	Data Preload	2.11.1	In SPI Client mode with Client Data Preload Enabled, the client transmitter may discard some data if the host cannot keep the SPI Select pin low until the end of transmission.	SAM L10	X
				SAM L11	X
SERCOM SPI	Hardware SPI Select Control	2.11.2	When Hardware SPI Select Control is enabled, the SPI Select (SS) pin goes high after each byte transfer.	SAM L10	X
				SAM L11	X
SERCOM SPI	Client Data Preload	2.11.3	Preloading a new SPI data before going into Standby Sleep mode, may lead to extra power consumption.	SAM L10	X
				SAM L11	X
SERCOM SPI	Wakeup Interrupt	2.11.4	The Data Register Empty (DRE) wake-up interrupt is not de-asserted when the register interrupt is cleared (INTFLAG.DRE=0).	SAM L10	X
				SAM L11	X
SERCOM USART	Inverted Bits	2.12.1	The TXINV and RXINV bits in the CTRLA register have inverted functionality.	SAM L10	X
				SAM L11	X
SERCOM USART	ISO7816 Mode	2.12.2	In ISO7816 mode, the SERCOM bus clock continues to run in Stand-by Sleep mode causing an extra power consumption.	SAM L10	X
				SAM L11	X
SERCOM USART	Debug Mode	2.12.3	Debug mode is not functional.	SAM L10	X
				SAM L11	X
SERCOM USART	Collision Detection	2.12.4	Collision Detection does not stop Data Transfer.	SAM L10	X
				SAM L11	X
SERCOM USART	Wakeup	2.12.5	The USART does not wake up the device on Error (INTFLAG.ERROR=1) interrupt.	SAM L10	X
				SAM L11	X
SERCOM USART	Overconsumption in Standby Mode	2.12.6	Unexpected over-consumption in standby mode	SAM L10	X
				SAM L11	X
SERCOM USART	Wakeup Interrupt	2.12.7	The Data Register Empty (DRE) wake-up interrupt is not de-asserted when the register interrupt is cleared (INTFLAG.DRE = 0).	SAM L10	X
				SAM L11	X
TC	Flags Synchronization	2.13.1	The SYNCBUSY.PER/SYNCBUSY.CCx flags are released before the PERBUF/CCBUFx registers are restored to their expected value.	SAM L10	X
				SAM L11	X
TC	Capture mode / Over consumption	2.13.2	Over consumption in Capture mode when entering Standby mode.	SAM L10	X
				SAM L11	X
TC	Retrigger	2.13.3	If a Retrigger event occurs at the Channel Compare Match [n] time, the next Waveform Output [n] is missing or disturbed.	SAM L10	X
				SAM L11	X
TC	PER Register (8-bit mode)	2.13.4	In 8-bit Mode, PER register updates using the DMA are not possible in standby mode.	SAM L10	X
				SAM L11	X
TRNG	Over consumption	2.14.1	When TRNG is disabled, some internal logic could continue to operate causing an over consumption.	SAM L10	X
				SAM L11	X

# SAM L10/L11 Family

## Silicon Issue Summary

.....continued					
Module	Feature	Errata Number	Summary	Device	Affected Silicon Revisions
					B
SUPC	Buck Converter Mode	2.15.1	Digital Phase-Locked Loop FDPLL96M cannot be used with main voltage regulator in Buck Converter mode.	SAM L10	X
				SAM L11	X
OSC32KCTRL	External 32.768KHz Crystal Oscillator	2.16.1	External 32.768KHz crystal oscillator operation is not supported over the full temperature range of -40°C to +125°C.	SAM L10	X
				SAM L11	X
OSC32KCTRL	1024 Hz Clock Output	2.16.2	1024 Hz clock output spikes can lead to wrong RTC or Watchdog counting.	SAM L10	X
				SAM L11	X
OSC32KCTRL	Clock Failure Detection	2.16.3	Re-enabling the Clock Failure Detector when the XOSC32K is enabled can lead to a false Clock Failure Detection.	SAM L10	X
				SAM L11	X
OSC32KCTRL	XOSC32K Ready bit	2.16.4	The XOSC32K Ready bit of the STATUS register is not cleared when disabling the XOSC32K bit at the same time as the Crystal Oscillator	SAM L10	X
				SAM L11	X
Boot ROM	GCM API	2.17.1	GCM API does not follow the Procedure Call Standard for the ARM Architecture (AAPCS)	SAM L10	
				SAM L11	X
EVSYS	Synchronous and Resynchronized Modes	2.18.1	Spurious Overrun Interrupt following a software event.	SAM L10	X
				SAM L11	X
EVSYS	Synchronous Mode	2.18.2	Spurious Overrun Interrupt when the generic clock for a channel is always on.	SAM L10	X
				SAM L11	X
EVSYS	Spurious Overrun	2.18.3	Overrun interrupt flag may be incorrectly set upon software events in synchronous/resynchronized path modes with event detection on both rising and falling edges.	SAM L10	X
				SAM L11	X
EVSYS	Software Event	2.18.4	CHBUSY flag never reset upon software events in synchronous/resynchronized path modes with event detection on falling edges.	SAM L10	X
				SAM L11	X
EVSYS	PAC Write-Protection	2.18.5	PAC Write-Protection is not functional for the NSCHKCHAN and NSCHKUSER registers.	SAM L10	X
				SAM L11	X
OSCCTRL	Clock Failure Detection	2.19.1	When the XOSC Clock Failure Detector is enabled and a failure is detected, the XOSC Ready bit is not cleared.	SAM L10	X
				SAM L11	X
OSCCTRL	Clock Failure Detection	2.19.2	Re-enabling the Clock Failure Detector when the XOSC is enabled can lead to a false Clock Failure Detection.	SAM L10	X
				SAM L11	X
OSCCTRL	XOSC Ready Bit	2.19.3	The XOSC Ready bit of the STATUS register is not cleared when disabling the XOSC at the same time as the Crystal Oscillator.	SAM L10	X
				SAM L11	X
OSCCTRL	FDPLL96M On Demand in Standby	2.19.4	The FDPLL96M On Demand mode is not functional in Standby sleep mode.	SAM L10	X
				SAM L11	X
OSCCTRL	DFLLULP Dithering Mode	2.19.5	DFLLULP dithering mode is not functional.	SAM L10	X
				SAM L11	X
PORT	IOBUS	2.20.1	Concurrent accesses on the PORT peripheral registers between the ARM APB and the ARM CPU IOBUS are not supported.	SAM L10	X
				SAM L11	X
TRAM	PAC Protection	2.21.1	Security RAM n registers (RAMn) are not PAC Write-Protected.	SAM L10	X
				SAM L11	X

# SAM L10/L11 Family

## Silicon Issue Summary

.....continued					
Module	Feature	Errata Number	Summary	Device	Affected Silicon Revisions
					B
NVMCTRL	Data FLASH Silent Access and Scrambling	2.22.1	Silent Access and Scrambling on the Data FLASH are not functional when both are enabled.	SAM L10	
				SAM L11	X

## 2. SAM L10/L11 Errata Issues

The following issues apply to the SAM L10/L11 Family devices.

### 2.1 Analog-to-Digital Converter (ADC)

#### 2.1.1 Reference Buffer Offset Compensation Reference:CHIP003-247, ADC101-11

TUE of the ADC conversion result is out of specification when,

- Using the reference source as REFCTRL.REFSEL  $\neq$  VDDANA and
- Reference Buffer Offset Compensation is enabled (REFCTRL.REFCOMP = 1)

##### Workaround

The first five conversions after enabling ADC must be ignored. All further ADC conversions are within the specification.

##### Affected Silicon Revisions

Device Family	B						
SAM L10	X						
SAM L11	X						

#### 2.1.2 Offset Correction Reference:ADC101-16

Offset correction using the OFFSETCORR register is not supported in the 8-bit and 10-bit conversion resolution.

##### Workaround

None.

##### Affected Silicon Revisions

Device Family	B						
SAM L10	X						
SAM L11	X						

### 2.2 Configurable Custom Logic (CCL)

#### 2.2.1 PAC Protection Reference: CLA100-6

Writing the Software Reset bit in the Control A register (CTRLA.SWRST) will trigger a PAC protection error.

##### Workaround

Clear the CCL PAC error each time a CCL software reset is executed.

### Affected Silicon Revisions

Device Family	B						
SAM L10	X						
SAM L11	X						

### 2.2.2 Enable Protected Registers Reference: CLA100-33

The SEQCTRL0 and LUCTRL0/1 registers are enable-protected by the CTRL.ENABLE bit whereas they should be enable-protected by the LUTCTRL0/1.ENABLE bits.

#### Workaround

None.

### Affected Silicon Revisions

Device Family	B						
SAM L10	X						
SAM L11	X						

### 2.2.3 Sequential Logic Reference: CLA100-32

LUT Output is corrupted after enabling CCL when sequential logic is used.

#### Workaround

Write the CTRL register twice when enabling the CCL.

### Affected Silicon Revisions

Device Family	B						
SAM L10	X						
SAM L11	X						

## 2.3 DEVICE

### 2.3.1 Temperature Sensor Reference: CHIP003-299

Temperature Sensor is not functional.

#### Workaround

None.

### Affected Silicon Revisions

Device Family	B						
SAM L10	X						
SAM L11	X						

### 2.3.2 Standby Entry Reference: CHIP003-325

When the SysTick interrupt is enabled and the standby back-bias option is set (STDBYCFG.BBIAS = 1), a hard fault can occur when the SysTick interrupt coincides with the standby entry.

#### Workaround

Disable the SysTick interrupt before entering standby and re-enable it after wake up.

#### Affected Silicon Revisions

Device Family	B						
SAM L10	X						
SAM L11	X						

## 2.4 Direct Memory Access Controller (DMAC)

### 2.4.1 Concurrent Channels Trigger Reference: DMA100-17

When using concurrent channels triggers, DMAC write-back descriptors may get corrupted.

#### Workaround

Multiple transfers must only be sequenced using linked descriptors on a single channel.

#### Affected Silicon Revisions

Device Family	B						
SAM L10	X						
SAM L11	X						

## 2.5 External Interrupt Controller (EIC)

### 2.5.1 PAC Protection Reference: INT103-3, INT103-46

8-bit and 16-bit reads/writes on the reserved areas of the EIC registers mapping starting from the EVCTRL register do not generate a PAC protection error.

#### Workaround

None.

#### Affected Silicon Revisions

Device Family	B						
SAM L10	X						
SAM L11	X						



## 2.6 Frequency Meter (FREQM)

### 2.6.1 PAC Protection Reference: CLK101-9

FREQM reads on the Control B register (FREQM.CTRLB) generate a PAC protection error.

#### Workaround

None.

#### Affected Silicon Revisions

Device Family	B						
SAM L10	X						
SAM L11	X						

## 2.7 Main Clock (MCLK)

### 2.7.1 PAC Protection Reference: CLK107-7

Writes to the MCLK Control A register (MCLK.CTRLA) do not generate a PAC protection error even if this register has been write-protected using the PAC.

#### Workaround

None.

#### Affected Silicon Revisions

Device Family	B						
SAM L10	X						
SAM L11	X						

### 2.7.2 DFLLULP Clock Reference: CLK107-8

A Hard fault exception can occur after selecting the DFLLULP clock as main clock source (CTRLA.CKSEL = 1).

#### Workaround

Add 6 NOP instructions after writing the CTRLA.CKSEL bit.

#### Affected Silicon Revisions

Device Family	B						
SAM L10	X						
SAM L11	X						

## 2.8 Operational Amplifier Controller (OPAMP)

### 2.8.1 Reference Buffer Reference: OPAMP100-4

The internal reference REFBUF is not generated when the Low-Power Mux feature is enabled (CTRLA.LPMUX = 1).

#### Workaround

Disable the Low-Power Mux feature (CTRLA.LPMUX = 0) when the internal REFBUF is used.

#### Affected Silicon Revisions

Device Family	B						
SAM L10	X						
SAM L11	X						

### 2.8.2 High Gain Instrumentation Amplifier Reference: OPAMP100-7

High Gain Instrumentation Amplifier is not functional.

#### Workaround

None.

#### Affected Silicon Revisions

Device Family	B						
SAM L10	X						
SAM L11	X						

## 2.9 Real Time Clock (RTC)

### 2.9.1 Tamper Detection Reference: TMR102-44

When the RTC Separate Tamper Outputs (SEPTO) bit of the CTRLB register is cleared (CTRLB.SEPTO = 0) and the Active layer protection 0 (ALSI0) bit of the TAMPCTRLB register is set (TAMPCTRLB.ALSI0 = 1), the RTC pseudo random pattern is only generated on the TrustRAM Active layer.

#### Workaround

Set the CTRLB.SEPTO bit to '1' if Tamper Detection is required on the RTC Tamper pins.

#### Affected Silicon Revisions

Device Family	B						
SAM L10	X						
SAM L11	X						

### 2.9.2 Event Generation Reference: TMR102-45

In RTC Clock mode or Calendar mode (CTRLA.MODE = 2), the Periodic Daily Event (PERD) is not generated.

#### Workaround

None.

#### Affected Silicon Revisions

Device Family	B						
SAM L10	X						
SAM L11	X						

### 2.9.3 Write Corruption Reference: TMR102-46

A 8-bit or 16-bit write access for a 32-bit register, or 8-bit write access for a 16-bit register can fail for the following registers:

- The COUNT register in COUNT32 mode
- The COUNT register in COUNT16 mode
- The CLOCK register in CLOCK mode

#### Workaround

Write the registers with:

- A 32-bit write access for:
  - The COUNT register in COUNT32 mode
  - The CLOCK register in CLOCK mode
- A 16-bit write access for:
  - The COUNT register in COUNT16 mode

### Affected Silicon Revisions

Device Family	B						
SAM L10	X						
SAM L11	X						

#### 2.9.4 Tamper Detection Timestamp Reference: TMR102-48

If an external reset occurs during a tamper detection, the TIMESTAMP register will not be updated when next tamper detection is triggered.

#### Workaround

Enable RTC tamper interrupt and copy the timestamp from the RTC CLOCK register to one of the following locations:

- SRAM
- GPx register in RTC

### Affected Silicon Revisions

Device Family	B						
SAM L10	X						
SAM L11	X						

#### 2.9.5 Prescaler Reference: TMR102-52

When the tamper or debouncing features (TAMPCTRL) are enabled, periodic interrupts and events are generated when the prescaler is OFF (CTRLA.PRESCALER = 0).

#### Workaround

When the prescaler is OFF (CTRLA.PRESCALER = 0), clear the Periodic Interval n Event Output Enable bits (EVCTRL.PEREOn [n = 7...0]) and the respective Periodic Interval n Interrupt Enable (INTENCLR.PERn [n = 7...0]) bits.

### Affected Silicon Revisions

Device Family	B						
SAM L10	X						
SAM L11	X						

#### 2.9.6 Active Layer Protection Reference: TMR102-66

Active Layer Protection feature is limited to one tamper channel n (i.e. one RTC INn/OUTn pair). Any other tamper channels can be used either in Wake mode or Capture mode.

#### Workaround

None.

### Affected Silicon Revisions

Device Family	B						
SAM L10	X						
SAM L11	X						

### 2.9.7 Tamper Detection Timestamp Reference: TMR102-67

The INTFLAG.TAMPER bit is not reset by reading the TIMESTAMP register.

#### Workaround

Clear the INTFLAG.TAMPER bit by writing a '1' to this bit when the Timestamp value has been read from the TIMESTAMP register.

### Affected Silicon Revisions

Device Family	B						
SAM L10	X						
SAM L11	X						

### 2.9.8 Tamper Detection Timestamp Reference: TMR102-60

A wrong timestamp value can be returned if more than one CPU and DMA accesses to the TIMESTAMP register are performed upon a INTFLAG.TAMPER assertion.

#### Workaround

The timestamp value captured in the TIMESTAMP register must be retrieved as described below:

- If RTC can trigger a DMA request when the timestamp value is available (CTRLB.DMAEN = 1):
  - Wait for DMA transfer completion to read the timestamp value from the DMA buffers.
  - Clear the INTFLAG.TAMPER bit.

**Note:** Do not read the timestamp value from the TIMESTAMP register.

- If RTC cannot trigger a DMA request when the timestamp value is available (CTRLB.DMAEN = 0):
  - Wait for the INTFLAG.TAMPER bit to read the timestamp value from the TIMESTAMP register.
  - Clear the INTFLAG.TAMPER bit.

### Affected Silicon Revisions

Device Family	B						
SAM L10	X						
SAM L11	X						

### 2.9.9 Tamper Detection Reference: TMR102-62

If the Tamper Channel n Action (TAMPCTRL.INnACT) is set to WAKE or CAPTURE and the Active Layer Protection is enabled for this channel (TAMPCTRLB.ALSIn = 1), no tamperers are detected on this channel n.

#### Workaround

Clear the TAMPCTRLB.ALSIn bits for the channels configured in WAKE or CAPTURE modes.

### Affected Silicon Revisions

Device Family	B						
SAM L10	X						
SAM L11	X						

### 2.9.10 Tamper Detection Reference: TMR102-63

False tamper detections may occur when configuring the RTC INn and OUTn pins.

#### Workaround

First configure the different RTC registers, and then select the RTC INn and OUTn peripheral functions on the PORT peripheral (PMUX registers).

### Affected Silicon Revisions

Device Family	B						
SAM L10	X						
SAM L11	X						

### 2.9.11 General Purpose Registers Reference: TMR102-56

The General Purpose Registers n (GPn) are reset on tamper detection even if GPTRST = 0.

#### Workaround

None.

### Affected Silicon Revisions

Device Family	B						
SAM L10	X						
SAM L11	X						

### 2.9.12 Active Layer Protection Reference: TMR102-65

When the RTC is configured in Active Layer Protection mode (TAMPCTRL.INACT = 0x3), and the RTC CTRLA.ENABLE bit is not set, a tamper can be detected and a timestamp captured. The TAMPID register and the INTFLAG.TAMPER bit may not be set.

#### Workaround

When the RTC is configured in Active Layer Protection mode, after setting the CTRLA.ENABLE control bit, the user must wait for 10 RTC clock periods. Then the user must clear the TAMPID register and the INTFLAG.TAMPER bit, and do a dummy read of the TIMESTAMP register to remove the lock condition on the TIMESTAMP register.

### Affected Silicon Revisions

Device Family	B						
SAM L10	X						
SAM L11	X						

## 2.10 Serial Communication Interface Inter-Integrated Circuit (SERCOM I<sup>2</sup>C)

### 2.10.1 High-Speed Mode Reference: CHIP003-145

When configured in HS or Fast-Mode Plus, SDA and SCL fall times are shorter than I<sup>2</sup>C specification requirement and can lead to reflection.

#### Workaround

When reflection is observed, a 100 ohm serial resistor can be added on the impacted line.

#### Affected Silicon Revisions

Device Family	B						
SAM L10	X						
SAM L11	X						

### 2.10.2 Repeated Start Reference: COM100-84

When Quick command is enabled (CTRLB.QCEN = 1), the software can issue a Repeated Start by either writing the CTRLB.CMD or ADDR.ADDR bit fields. If in these conditions, SCL Stretch Mode is CTRLA.SCLSM = 1, a bus error will be generated.

#### Workaround

Use Quick Command mode (CTRLB.QCEN = 1) only if SCL Stretch mode is CTRLA.SCLSM = 0.

#### Affected Silicon Revisions

Device Family	B						
SAM L10	X						
SAM L11	X						

### 2.10.3 Repeated Start Reference: COM100-128

For Host Write operations (excluding High-Speed mode), in 10-bit addressing mode, writing CTRLB.CMD = 0x1 does not issue correctly a Repeated Start command.

#### Workaround

Write the same 10-bit address with the same direction bit to the ADDR.ADDR register to generate properly a Repeated Start.

#### Affected Silicon Revisions

Device Family	B						
SAM L10	X						
SAM L11	X						

### 2.10.4 Repeated Start Reference: COM100-123

For High-Speed Host Read operations, sending a NACK (CTRLB.CMD = 0x2) forces a STOP to be issued making repeated start not possible in that mode.

### Workaround

None.

### Affected Silicon Revisions

Device Family	B						
SAM L10	X						
SAM L11	X						

## 2.10.5 Repeated Start Reference: COM100-122

For High-Speed Host Write operations, writing CTRLB.CMD = 0x1 issues a STOP command instead of a Repeated Start making repeated start not possible in that mode.

### Workaround

None.

### Affected Silicon Revisions

Device Family	B						
SAM L10	X						
SAM L11	X						

## 2.10.6 Client Mode with DMA Reference: COM100-94

In I<sup>2</sup>C Client Transmitter mode, at the reception of a NACK, if there is still data to be sent in the DMA buffer, the DMA will push a data to the DATA register. Because a NACK was received, the transfer on the I<sup>2</sup>C bus will not occur causing the loss of this data.

### Workaround

Configure the DMA transfer size to the number of data to be received by the I<sup>2</sup>C host. DMA cannot be used if the number of data to be received by the host is not known.

### Affected Silicon Revisions

Device Family	B						
SAM L10	X						
SAM L11	X						

## 2.10.7 Client Mode 10-bit Reference: COM100-101

I<sup>2</sup>C client 10-bit addressing mode is not functional.

### Workaround

None.

### Affected Silicon Revisions

Device Family	B						
SAM L10	X						



.....continued							
Device Family	B						
SAM L11	X						

### 2.10.8 Status Flags Reference: COM100-102

In Client mode, the BUSERR, COLL, LOWTOUT, SEXTTOUT and LENERR STATUS register bits are not automatically cleared when INTFLAG.AMATCH is cleared.

#### Workaround

Clear the STATUS register bits, BUSERR, COLL, LOWTOUT, SEXTTOUT and LENERR, by writing these STATUS bits to '1' when INTFLAG.AMATCH is cleared.

#### Affected Silicon Revisions

Device Family	B						
SAM L10	X						
SAM L11	X						

### 2.10.9 Status Flags Reference: COM100-114

The STATUS.CLKHOLD bit in host and client modes can be written whereas it is a read-only status bit.

#### Workaround

Do not clear the STATUS.CLKHOLD bit to preserve the current clock hold state.

#### Affected Silicon Revisions

Device Family	B						
SAM L10	X						
SAM L11	X						

### 2.10.10 Status Flags Reference: COM100-157

When an unexpected STOP occurs on the I<sup>2</sup>C bus, the STATUS.BUSERR and INTFLAG.ERROR bits are set, but may not wake the system from Sleep mode. An unexpected START will not produce this issue.

#### Workaround

None.

#### Affected Silicon Revisions

Device Family	B						
SAM L10	X						
SAM L11	X						

### 2.10.11 Automatic Acknowledge Reference: COM100-216

The I<sup>2</sup>C Client Automatic Acknowledge feature (CTRLB.AACKEN = 1) is not supported when doing a repeated start.

### Workaround

Do not use the AACKEN feature, implement a AMATCH handler instead.

### Affected Silicon Revisions

Device Family	B						
SAM L10	X						
SAM L11	X						

## 2.11 Serial Communication Serial Peripheral Interface (SERCOM SPI)

### 2.11.1 Data Preload Reference: COM100-83

In SPI Client mode with Client Data Preload Enabled (CTRLB.PLOADEN = 1), the client transmitter may discard some data if the host cannot keep the SPI Select ( $\overline{SS}$ ) pin low until the end of transmission.

### Workaround

In SPI Client mode, the SPI Select ( $\overline{SS}$ ) pin must be kept low by the host until the end of the transmission if the Client Data Preload feature is used (CTRLB.PLOADEN = 1).

### Affected Silicon Revisions

Device Family	B						
SAM L10	X						
SAM L11	X						

### 2.11.2 Hardware SPI Select Control Reference: COM100-203

When Hardware SPI Select Control is enabled (CTRLB.MSSEN = 1), the SPI Select ( $\overline{SS}$ ) pin goes high after each byte transfer even if a new data is ready to be sent.

### Workaround

Set CTRLB.MSSEN = 0 and handle the SPI Select ( $\overline{SS}$ ) pin by software.

### Affected Silicon Revisions

Device Family	B						
SAM L10	X						
SAM L11	X						

### 2.11.3 Client Data Preload Reference: COM100-202

Preloading a new SPI data (CTRLB.PLOADEN = 1) before going into Standby mode, may lead to extra power consumption.

### Workaround

None.

### Affected Silicon Revisions

Device Family	B						
SAM L10	X						
SAM L11	X						

#### 2.11.4 Wake-up Interrupt Reference: COM100-192

The Data Register Empty (DRE) wake-up interrupt is not de-asserted when the register interrupt is cleared (INTFLAG.DRE = 0).

The issue occurs if the DRE interrupt is enabled (INTSET.DRE = 1) when the device enters in Standby mode.

#### Workaround

Write DATA register before going back to Standby mode.

### Affected Silicon Revisions

Device Family	B						
SAM L10	X						
SAM L11	X						

## 2.12 Serial Communication Interface USART (SERCOM USART)

### 2.12.1 Inverted Bits Reference: COM100-61

The TXINV and RXINV bits in the CTRLA register have inverted functionality.

#### Workaround

In software, interpret the TXINV bit as a functionality of RXINV, and conversely, interpret the RXINV bit as a functionality of TXINV.

### Affected Silicon Revisions

Device Family	B						
SAM L10	X						
SAM L11	X						

### 2.12.2 ISO7816 Mode Reference: COM100-55

When the SERCOM USART is in ISO7816 mode, the SERCOM bus clock continues to run in Standby mode causing extra power consumption.

#### Workaround

Disable the USART before entering Standby mode.

### Affected Silicon Revisions

Device Family	B						
SAM L10	X						
SAM L11	X						

### 2.12.3 Debug Mode Reference: COM100-80

In USART operating mode, if DBGCTRL.DBGSTOP = 1, data transmission is not halted when entering Debug mode.

#### Workaround

None.

### Affected Silicon Revisions

Device Family	B						
SAM L10	X						
SAM L11	X						

### 2.12.4 Collision Detection Reference: COM100-75

In USART operating mode with Collision Detection enabled (CTRLB.COLDEN = 1), the SERCOM will not abort the current transfer as expected if a collision is detected and if the SERCOM APB clock is lower than the SERCOM generic clock.

#### Workaround

The SERCOM APB clock must always be higher than the SERCOM generic clock to support collision detection.

### Affected Silicon Revisions

Device Family	B						
SAM L10	X						
SAM L11	X						

### 2.12.5 Wakeup Reference: COM100-41

The USART does not wake up the device on Error Interrupt (INTFLAG.ERROR = 1).

#### Workaround

Configure the USART to wake up the device on the RX Complete Interrupt (INTENSET.RXC = 1) to check the PERR/FERR status (STATUS.PERR = 1 or STATUS.FERR = 1).

### Affected Silicon Revisions

Device Family	B						
SAM L10	X						
SAM L11	X						

### 2.12.6 Overconsumption in Standby Mode Reference: COM100-185

When SERCOM USART CTRLA.RUNSTDBY = 0 and the Receiver is disabled (CTRLB.RXEN = 0), the clock request to the GCLK generator feeding the SERCOM will stay asserted during Standby mode, leading to unexpected overconsumption.

#### Workaround

Configure CTRLA.RXPO and CTRLA.TXPO to use the same SERCOM PAD for RX and TX, or add an external pull-up on the RX pin.

#### Affected Silicon Revisions

Device Family	B						
SAM L10	X						
SAM L11	X						

### 2.12.7 Wake-up Interrupt Reference: COM100-192

The Data Register Empty (DRE) wake-up interrupt is not de-asserted when the register interrupt is cleared (INTFLAG.DRE = 0).

The issue occurs if the DRE interrupt is enabled (INTSET.DRE = 1) when the device enters in Standby mode.

#### Workaround

Write DATA register before going back to Standby mode.

#### Affected Silicon Revisions

Device Family	B						
SAM L10	X						
SAM L11	X						

## 2.13 Timer Counter (TC)

### 2.13.1 Flags Synchronization Reference: TMR100-12

When clearing the STATUS.PERBUFV/STATUS.CCBUFVx flags, the SYNCBUSY.PER/SYNCBUSY.CCx flags are released before the PERBUF/CCBUFx registers are restored to their expected value.

#### Workaround

Successively, clear the STATUS.PERBUFV/STATUS.CCBUFVx flags twice to ensure that the PERBUF/CCBUFx registers value is properly restored before updating it.

#### Affected Silicon Revisions

Device Family	B						
SAM L10	X						
SAM L11	X						

### 2.13.2 Capture Mode / Over consumption Reference: TMR100-8

If the Time Counter x (TCx) is in Capture mode (TC.CTRLA.CAPTENx = 1) and TC.CTRLA.RUNSTBY = 0, the clock source driving GCLK\_TCx can be kept running in Standby mode causing extra power consumption.

#### Workaround

Disable the Time Counter x (TCx) (TC.CTRLA.ENABLE = 0) which has a channel configured in Capture mode before going to Standby mode.

#### Affected Silicon Revisions

Device Family	B						
SAM L10	X						
SAM L11	X						

### 2.13.3 Retrigger Reference: TMR100-51

If a Retrigger event (EVCTRL.EVACTn = 0x1, RETRIGGER) occurs at the Channel Compare Match [n] time, the next Waveform Output [n] is corrupted.

#### Workaround

Use two channels to store their two successive (n and n+1) CC register values and combine their related waveform outputs to make signal redundancy.

#### Affected Silicon Revisions

Device Family	B						
SAM L10	X						
SAM L11	X						

### 2.13.4 PER Register Reference: TMR100-54

In 8-bit mode, the PER register updates using the DMA are not possible in Standby mode.

#### Workaround

None.

#### Affected Silicon Revisions

Device Family	B						
SAM L10	X						
SAM L11	X						

## 2.14 True Random Number Generator (TRNG)

### 2.14.1 Over consumption Reference: MATH100-7

When TRNG is disabled, some internal logic could continue to operate causing an over consumption.

#### Workaround

Disable the TRNG module twice:

- CTRLA.ENABLE = 0;
- CTRLA.ENABLE = 0;

### Affected Silicon Revisions

Device Family	B						
SAM L10	X						
SAM L11	X						

## 2.15 Supply Controller (SUPC)

### 2.15.1 Buck Converter Mode Reference: CHIP003-311

Buck Converter mode is not supported when using FDPLL96M. As a result, the data provided in Tables 46-8 and 47-2 "Active Current Consumption for Buck converter mode with FDPLL96M at Performance Level 2 (PL2) setting" is not valid and must be disregarded.

#### Workaround

Use the LDO Regulator mode when using FDPLL96M.

### Affected Silicon Revisions

Device Family	B						
SAM L10	X						
SAM L11	X						

## 2.16 OSC32KCTRL

### 2.16.1 External 32.768 kHz Crystal Oscillator Reference: UANA163-1

External 32.768 kHz crystal oscillator operation is not supported over the full temperature range of -40°C to +125°C.

#### Workaround

Limit external 32.768 kHz crystal oscillator operation temperature range from 0°C to 125°C with a crystal ESR <70 kΩ.

### Affected Silicon Revisions

Device Family	B						
SAM L10	X						
SAM L11	X						

### 2.16.2 1024 Hz Clock Output Reference: OSC102-13

When the XOSC32K is configured for 1024 Hz clock output and is used to clock the Watchdog (OSCULP32K.ULP32KSW = 1) or the RTC (RTCCTRL.RTCSEL = 4), the 1024 Hz clock can generate spikes in Standby Low-Power mode if the XOSC32K is not always ON, leading to incorrect RTC/WDT counting.

### Workaround

Set XOSC32K.RUNSTBY = 1 and clear XOSC32K.ONDEMAND = 0 to force the XOSC32K to be always ON in Standby Low-Power mode.

### Affected Silicon Revisions

Device Family	B						
SAM L10	X						
SAM L11	X						

## 2.16.3 Clock Failure Detection Reference: OSC102-17

Disabling the Clock Failure Detector (CFDCTRL.CFDEN = 0) and re-enabling it (CFDCTRL.CFDEN = 1) when the XOSC32K is enabled (XOSC32K.ENABLE = 1) can lead to a false Clock Failure Detection.

### Workaround

Re-enable the Clock Failure Detector as follows:

1. Disable the XOSC32K (XOSC32K.ENABLE = 0).
2. Disable the Clock Failure Detector (CFDCTRL.CFDEN = 0).
3. Re-enable the Clock Failure Detector (CFDCTRL.CFDEN = 1).
4. Re-enable the XOSC32K (XOSC32K.ENABLE = 1).

### Affected Silicon Revisions

Device Family	B						
SAM L10	X						
SAM L11	X						

## 2.16.4 XOSC32K Ready Bit Reference: OSC102-20

The XOSC32K Read bit of the STATUS register (STATUS.XOSC32KRDY) is not cleared when disabling the XOSC32K (XOSC32K.ENABLE = 0) at the same time as the Crystal Oscillator Enable bit (XOSC32K.XTALEN = 0).

### Workaround

Disable the XOSC32K as follows:

1. Disable the XOSC32K (XOSC32K.ENABLE = 0).
2. Disable the Crystal Oscillator (XOSC32K.XTALEN = 0).

### Affected Silicon Revisions

Device Family	B						
SAM L10	X						
SAM L11	X						



## 2.17 Boot ROM

### 2.17.1 GCM API Reference: BROM100-18

The GCM API function `crya_gf_mult128_t` does not save and restore the core register `r8` on return, thereby violating the Procedure Call Standard for the Arm<sup>®</sup> Architecture (AAPCS).

#### Workaround

The Arm core register `r8` must be saved before calling the `crya_gf_mult128_t` function and must be restored when returning from it.

#### Affected Silicon Revisions

Device Family	B						
SAM L10							
SAM L11	X						

## 2.18 Event System (EVSYS)

### 2.18.1 Synchronous and Resynchronized Modes Reference: PTG100-31

In synchronous or resynchronized modes, generating a software event can generate a spurious overrun interrupt.

#### Workaround

None.

#### Affected Silicon Revisions

Device Family	B						
SAM L10	X						
SAM L11	X						

### 2.18.2 Synchronous Mode Reference: PTG100-37

In Synchronous mode, spurious overrun interrupts can be generated when the generic clock for a channel is always ON (`CHANNEL.ONDEMAND = 0`).

#### Workaround

Set Generic Clock on Demand feature by setting `CHANNEL.ONDEMAND = 1`.

#### Affected Silicon Revisions

Device Family	B						
SAM L10	X						
SAM L11	X						

### 2.18.3 Spurious Overrun Reference: PTG100-64

If a software event occurs when the EVSYS is set in synchronous/resynchronized path modes (CHANNELn.PATH = 0x0/0x1) with event detection set on both rising and falling edges (CHANNELn.EDGESEL = 0x3), spurious overrun interrupts may occur (INTFLAG.OVRn).

#### Workaround

Generate software events for the event user through a dedicated channel configured with even detection set on rising edges (CHANNELn.EDGESEL = 0x1).

#### Affected Silicon Revisions

Device Family	B						
SAM L10	X						
SAM L11	X						

### 2.18.4 Software Event Reference: PTG100-65

If a software event occurs when the EVSYS is set in synchronous/resynchronized path modes (CHANNELn.PATH = 0x0/0x1) with event detection set on falling edges (CHANNELn.EDGESEL = 0x2), the CHSTATUS.CHBUSYn flag will be set but will never come back to 0. It is then impossible to know if the event user for this channel is ready or not to accept new events.

#### Workaround

Generate software events for this user through a dedicated channel configured with even detection set on rising edges (CHANNELn.EDGESEL = 0x1).

#### Affected Silicon Revisions

Device Family	B						
SAM L10	X						
SAM L11	X						

### 2.18.5 PAC Write-Protection Reference: PTG100-43

PAC Write-Protection is not functional for the NSCHKCHAN and NSCHKUSER registers.

#### Workaround

None.

#### Affected Silicon Revisions

Device Family	B						
SAM L10	X						
SAM L11	X						

## 2.19 Oscillator Controller (OSCCTRL)

### 2.19.1 Clock Failure Detection Reference: OSC108-12

When the XOSC Clock Failure Detector is enabled (XOSCCTRL.CFDEN = 1) and a failure is detected (STATUS.XOSCFAIL = 1), the XOSC Ready bit is not cleared (STATUS.XOSCRDY = 1).

#### Workaround

STATUS.XOSCFAIL must always be checked before STATUS.XOSCRDY, and STATUS.XOSCRDY must always be ignored when STATUS.XOSCFAIL = 1.

#### Affected Silicon Revisions

Device Family	B						
SAM L10	X						
SAM L11	X						

### 2.19.2 Clock Failure Detection Reference: OSC108-14

Disabling the Clock Failure Detector (XOSCCTRL.CFDEN = 0) and re-enabling it (XOSCCTRL.CFDEN = 1) when the XOSC is enabled (XOSCCTRL.ENABLE = 1) can lead to a false Clock Failure Detection.

#### Workaround

Re-enable the Clock Failure Detector as follows:

1. Disable the XOSC (XOSCCTRL.ENABLE = 0).
2. Disable the Clock Failure Detector (XOSCCTRL.CFDEN = 0).
3. Re-enable the Clock Failure Detector (XOSCCTRL.CFDEN = 1).
4. Re-enable the XOSC (XOSCCTRL.ENABLE = 1).

#### Affected Silicon Revisions

Device Family	B						
SAM L10	X						
SAM L11	X						

### 2.19.3 XOSC Ready Bit Reference: OSC108-16

The XOSC Ready bit of the STATUS register (STATUS.XOSCRDY) is not cleared when disabling the XOSC bit (XOSCCTRL.ENABLE = 0) at the same time as the Crystal Oscillator Enable bit (XOSCCTRL.XTALEN = 0).

#### Workaround

Disable the XOSC Ready bit as follows:

1. Disable the XOSC (XOSCCTRL.ENABLE = 0).
2. Disable the Crystal Oscillator (XOSCCTRL.XTALEN = 0).

#### Affected Silicon Revisions

Device Family	B						
SAM L10	X						

.....continued

Device Family	B						
SAM L11	X						

### 2.19.4 FDPLL96M On Demand in Standby Reference: PLL100-09, PLL100-20

The FDPLL96M On Demand mode (DPLLCTRLA.ONDEMAND = 1) is not functional in Standby mode.

#### Workaround

Set DPLLCTRLA.ONDEMAND = 0 which makes the FDPLL96M always running in Standby mode.

#### Affected Silicon Revisions

Device Family	B						
SAM L10	X						
SAM L11	X						

### 2.19.5 DFLLULP Dithering Mode Reference: DLL102-7

DFLLULP dithering mode (DFLLULPCTRL.DITHER = 1) is not functional.

#### Workaround

None.

#### Affected Silicon Revisions

Device Family	B						
SAM L10	X						
SAM L11	X						

## 2.20 PORT I/O Controller (PORT)

### 2.20.1 IOBUS Reference: GPIO100-64

Concurrent accesses on the PORT peripheral registers between the Arm APB and the Arm CPU IOBUS are not supported.

#### Workaround

Use exclusively the Arm APB or the Arm CPU IOBUS to access the PORT peripheral registers.

#### Affected Silicon Revisions

Device Family	B						
SAM L10	X						
SAM L11	X						

## 2.21 Trust Ram (TRAM)

### 2.21.1 PAC Protection Reference: RAM102-28

Security RAM n registers (RAMn) are not PAC Write-Protected.

#### Workaround

None.

#### Affected Silicon Revisions

Device Family	B						
SAM L10	X						
SAM L11	X						

## 2.22 Non Volatile Memory Controller (NVMCTRL)

### 2.22.1 Data Flash Silent Access and Scrambling Reference: NVM102-26

Silent Access and Scrambling on the Data Flash are not functional when both are enabled.

Silent Access and Data Flash scrambling remain functional if only one of them is configured by the application.

#### Workaround

None.

#### Affected Silicon Revisions

Device Family	B						
SAM L10							
SAM L11	X						

### 3. Data Sheet Clarifications

The following typographic corrections and clarifications are to be noted for the latest version of the device data sheet (DS60001513G):

**Note:** Corrections in tables, registers, and texts are shown in **bold**. Where possible, the original bold text formatting has been removed for clarity.

There are currently no data sheet clarifications to report.

## 4. Revision History

### Revision E - 07/2021

The SPI, I<sup>2</sup>S, and I<sup>2</sup>C standards use the terminology "Master" and "Slave". The equivalent Microchip terminology used in this document is "Host" and "Client" respectively. These terms have been updated throughout this document for this revision.

This revision contains numerous typographical updates, and formatting updates.

Obsolete [Data Sheet Clarifications](#) have been removed in this update.

The following errata were added in this revision:

- [RTC: 2.9.12 Active Layer Protection](#)
- [SERCOM I<sup>2</sup>C: 2.10.11 Automatic Acknowledge](#)
- [TC: 2.13.4 PER register \(8-bit mode\)](#)
- [EVSYS: 2.18.3 Spurious Overrun](#)
- [EVSYS: 2.18.4 Software Event](#)
- [EVSYS: 2.18.5 PAC Write-Protection](#)
- [OSCCTRL: 2.19.4 FDPLL96M On Demand in Standby](#)
- [OSCCTRL: 2.19.5 DFLLULP Dithering Mode](#)
- [NVMCTRL: 2.22.1 Data FLASH Silent Access and Scrambling](#)

### Revision D - 01/2021

This revision contains numerous typographical updates, and formatting updates.

The following errata were updated with new verbiage:

- [DMAC: 2.4.1 Concurrent Channels Trigger](#)
- [EIC: 2.5.1 PAC Protection](#)
- [OPAMP: 2.8.1 Reference Buffer](#)
- [SERCOM I<sup>2</sup>C: 2.10.8 Status Flags](#)
- [SERCOM I<sup>2</sup>C: 2.10.9 Status Flags](#)
- [SERCOM SPI: 2.11.1 Data Preload](#)
- [SERCOM USART: 2.12.5 Wakeup](#)

The following errata were added in this revision:

- [ADC: 2.1.2 Offset Correction](#)
- [Device: 2.3.2 Standby Entry](#)
- [RTC: 2.9.9 Tamper Detection](#)
- [RTC: 2.9.10 Tamper Detection](#)
- [RTC: 2.9.11 General Purpose Registers](#)
- [SERCOM I<sup>2</sup>C: 2.10.10 Status Flags](#)
- [SERCOM SPI: 2.11.2 Hardware Slave Select Control](#)
- [SERCOM SPI: 2.11.3 Slave Data Preload](#)
- [SERCOM SPI: 2.11.4 Wakeup Interrupt](#)
- [SERCOM USART: 2.12.6 Overconsumption in Standby Mode](#)
- [SERCOM USART: 2.12.7 Wakeup Interrupt](#)
- [TC: 2.13.3 Retrigger](#)
- [OSC32KCTRL: 2.16.2 1024 Hz Clock Output](#)
- [OSC32KCTRL: 2.16.3 Clock Failure Detection](#)
- [OSC32KCTRL: 2.16.4 XOSC32K Ready Bit](#)
- [EVSYS: 2.18.1 Synchronous and Resynchronized Modes](#)
- [EVSYS: 2.18.2 Synchronous Mode](#)

- [OSCCTRL: 2.19.1 Clock Failure Detection](#)
- [OSCCTRL: 2.19.2 Clock Failure Detection](#)
- [OSCCTRL: 2.19.3 XOSC Ready Bit](#)
- [PORT: 2.20.1 IOBUS](#)
- [TRAM: 2.21.1 PAC Protection](#)

### **Revision C - 05/2019**

The following new errata were added:

- RTC:
  - [2.9.5 Prescaler](#)
  - [2.9.6 Active Layer Protection](#)
  - [2.9.7 Tamper Detection Timestamp](#)
  - [2.9.8 Tamper Detection Timestamp](#)
- SERCOM USART:
  - [2.12.5 Wakeup](#)

### **Revision B - 02/2019**

The following new errata were added:

- [RTC: 2.9.4 Tamper detection Timestamp](#)
- [SUPC: 2.15.1 Buck Converter Mode](#)
- [OSC32KCTRL: 2.16.1 External 32.768kHz Crystal Oscillator](#)
- [Boot ROM: 2.17.1 GMC API](#)

The following errata is updated:

- [ADC: 2.1.1 Reference Buffer Offset Compensation](#)

The following Data Sheet clarifications were added:

- Updates to Electrical Specifications Tables:
  - Table 46-8
  - Table 46-54
  - Table 47-2

### **Revision A - 5/2018**

This is the initial release of this document.



## The Microchip Web Site

---

Microchip provides online support via our web site at [www.microchip.com/](http://www.microchip.com/). This web site is used as a means to make files and information easily available to customers. Accessible by using your favorite Internet browser, the web site contains the following information:

- **Product Support** – Data sheets and errata, application notes and sample programs, design resources, user's guides and hardware support documents, latest software releases and archived software
- **General Technical Support** – Frequently Asked Questions (FAQ), technical support requests, online discussion groups, Microchip consultant program member listing
- **Business of Microchip** – Product selector and ordering guides, latest Microchip press releases, listing of seminars and events, listings of Microchip sales offices, distributors and factory representatives

## Customer Change Notification Service

---

Microchip's customer notification service helps keep customers current on Microchip products. Subscribers will receive e-mail notification whenever there are changes, updates, revisions or errata related to a specified product family or development tool of interest.

To register, access the Microchip web site at [www.microchip.com/](http://www.microchip.com/). Under "Support", click on "Customer Change Notification" and follow the registration instructions.

## Customer Support

---

Users of Microchip products can receive assistance through several channels:

- Distributor or Representative
- Local Sales Office
- Field Application Engineer (FAE)
- Technical Support

Customers should contact their distributor, representative or Field Application Engineer (FAE) for support. Local sales offices are also available to help customers. A listing of sales offices and locations is included in the back of this document.

Technical support is available through the web site at: [www.microchip.com/support](http://www.microchip.com/support)

## Microchip Devices Code Protection Feature

---

Note the following details of the code protection feature on Microchip devices:

- Microchip products meet the specification contained in their particular Microchip Data Sheet.
- Microchip believes that its family of products is one of the most secure families of its kind on the market today, when used in the intended manner and under normal conditions.
- There are dishonest and possibly illegal methods used to breach the code protection feature. All of these methods, to our knowledge, require using the Microchip products in a manner outside the operating specifications contained in Microchip's Data Sheets. Most likely, the person doing so is engaged in theft of intellectual property.
- Microchip is willing to work with the customer who is concerned about the integrity of their code.
- Neither Microchip nor any other semiconductor manufacturer can guarantee the security of their code. Code protection does not mean that we are guaranteeing the product as "unbreakable."

Code protection is constantly evolving. We at Microchip are committed to continuously improving the code protection features of our products. Attempts to break Microchip's code protection feature may be a violation of the Digital Millennium Copyright Act. If such acts allow unauthorized access to your software or other copyrighted work, you may have a right to sue for relief under that Act.

## Legal Notice

---

Information contained in this publication regarding device applications and the like is provided only for your convenience and may be superseded by updates. It is your responsibility to ensure that your application meets with your specifications. MICROCHIP MAKES NO REPRESENTATIONS OR WARRANTIES OF ANY KIND WHETHER EXPRESS OR IMPLIED, WRITTEN OR ORAL, STATUTORY OR OTHERWISE, RELATED TO THE INFORMATION, INCLUDING BUT NOT LIMITED TO ITS CONDITION, QUALITY, PERFORMANCE, MERCHANTABILITY OR FITNESS FOR PURPOSE. Microchip disclaims all liability arising from this information and its use. Use of Microchip devices in life support and/or safety applications is entirely at the buyer's risk, and the buyer agrees to defend, indemnify and hold harmless Microchip from any and all damages, claims, suits, or expenses resulting from such use. No licenses are conveyed, implicitly or otherwise, under any Microchip intellectual property rights unless otherwise stated.

## Trademarks

---

The Microchip name and logo, the Microchip logo, AnyRate, AVR, AVR logo, AVR Freaks, BeaconThings, BitCloud, CryptoMemory, CryptoRF, dsPIC, FlashFlex, flexPWR, Helder, JukeBlox, KeeLoq, KeeLoq logo, Klear, LANCheck, LINK MD, maXStylus, maXTouch, MediaLB, megaAVR, MOST, MOST logo, MPLAB, OptoLyzer, PIC, picoPower, PICSTART, PIC32 logo, Prochip Designer, QTouch, RightTouch, SAM-BA, SpyNIC, SST, SST Logo, SuperFlash, tinyAVR, UNI/O, and XMEGA are registered trademarks of Microchip Technology Incorporated in the U.S.A. and other countries.

ClockWorks, The Embedded Control Solutions Company, EtherSynch, Hyper Speed Control, HyperLight Load, IntelliMOS, mTouch, Precision Edge, and Quiet-Wire are registered trademarks of Microchip Technology Incorporated in the U.S.A.

Adjacent Key Suppression, AKS, Analog-for-the-Digital Age, Any Capacitor, AnyIn, AnyOut, BodyCom, chipKIT, chipKIT logo, CodeGuard, CryptoAuthentication, CryptoCompanion, CryptoController, dsPICDEM, dsPICDEM.net, Dynamic Average Matching, DAM, ECAN, EtherGREEN, In-Circuit Serial Programming, ICSP, Inter-Chip Connectivity, JitterBlocker, KlearNet, KlearNet logo, Mindi, MiWi, motorBench, MPASM, MPF, MPLAB Certified logo, MPLIB, MPLINK, MultiTRAK, NetDetach, Omniscient Code Generation, PICDEM, PICDEM.net, PICkit, PICtail, PureSilicon, QMatrix, RightTouch logo, REAL ICE, Ripple Blocker, SAM-ICE, Serial Quad I/O, SMART-I.S., SQL, SuperSwitcher, SuperSwitcher II, Total Endurance, TSHARC, USBCheck, VariSense, ViewSpan, WiperLock, Wireless DNA, and ZENA are trademarks of Microchip Technology Incorporated in the U.S.A. and other countries.

SQTP is a service mark of Microchip Technology Incorporated in the U.S.A.

Silicon Storage Technology is a registered trademark of Microchip Technology Inc. in other countries.

GestIC is a registered trademark of Microchip Technology Germany II GmbH & Co. KG, a subsidiary of Microchip Technology Inc., in other countries.

All other trademarks mentioned herein are property of their respective companies.

© 2017, Microchip Technology Incorporated, Printed in the U.S.A., All Rights Reserved.

ISBN: 978-1-5224-8608-4

## Quality Management System Certified by DNV

---

### ISO/TS 16949

Microchip received ISO/TS-16949:2009 certification for its worldwide headquarters, design and wafer fabrication facilities in Chandler and Tempe, Arizona; Gresham, Oregon and design centers in California and India. The Company's quality system processes and procedures are for its PIC® MCUs and dsPIC® DSCs, KEELOQ® code hopping devices, Serial EEPROMs, microperipherals, nonvolatile memory and analog products. In addition, Microchip's quality system for the design and manufacture of development systems is ISO 9001:2000 certified.

## Worldwide Sales and Service

AMERICAS	ASIA/PACIFIC	ASIA/PACIFIC	EUROPE
<b>Corporate Office</b> 2355 West Chandler Blvd. Chandler, AZ 85224-6199 Tel: 480-792-7200 Fax: 480-792-7277 Technical Support: <a href="http://www.microchip.com/support">http://www.microchip.com/support</a> Web Address: <a href="http://www.microchip.com">www.microchip.com</a>	<b>Asia Pacific Office</b> Suites 3707-14, 37th Floor Tower 6, The Gateway Harbour City, Kowloon <b>Hong Kong</b> Tel: 852-2943-5100 Fax: 852-2401-3431 <b>Australia - Sydney</b> Tel: 61-2-9868-6733 Fax: 61-2-9868-6755 <b>China - Beijing</b> Tel: 86-10-8569-7000 Fax: 86-10-8528-2104 <b>China - Chengdu</b> Tel: 86-28-8665-5511 Fax: 86-28-8665-7889 <b>China - Chongqing</b> Tel: 86-23-8980-9588 Fax: 86-23-8980-9500 <b>China - Dongguan</b> Tel: 86-769-8702-9880 <b>China - Guangzhou</b> Tel: 86-20-8755-8029 <b>China - Hangzhou</b> Tel: 86-571-8792-8115 Fax: 86-571-8792-8116 <b>China - Hong Kong SAR</b> Tel: 852-2943-5100 Fax: 852-2401-3431 <b>China - Nanjing</b> Tel: 86-25-8473-2460 Fax: 86-25-8473-2470 <b>China - Qingdao</b> Tel: 86-532-8502-7355 Fax: 86-532-8502-7205 <b>China - Shanghai</b> Tel: 86-21-3326-8000 Fax: 86-21-3326-8021 <b>China - Shenyang</b> Tel: 86-24-2334-2829 Fax: 86-24-2334-2393 <b>China - Shenzhen</b> Tel: 86-755-8864-2200 Fax: 86-755-8203-1760 <b>China - Wuhan</b> Tel: 86-27-5980-5300 Fax: 86-27-5980-5118 <b>China - Xian</b> Tel: 86-29-8833-7252 Fax: 86-29-8833-7256	<b>China - Xiamen</b> Tel: 86-592-2388138 Fax: 86-592-2388130 <b>China - Zhuhai</b> Tel: 86-756-3210040 Fax: 86-756-3210049 <b>India - Bangalore</b> Tel: 91-80-3090-4444 Fax: 91-80-3090-4123 <b>India - New Delhi</b> Tel: 91-11-4160-8631 Fax: 91-11-4160-8632 <b>India - Pune</b> Tel: 91-20-3019-1500 <b>Japan - Osaka</b> Tel: 81-6-6152-7160 Fax: 81-6-6152-9310 <b>Japan - Tokyo</b> Tel: 81-3-6880-3770 Fax: 81-3-6880-3771 <b>Korea - Daegu</b> Tel: 82-53-744-4301 Fax: 82-53-744-4302 <b>Korea - Seoul</b> Tel: 82-2-554-7200 Fax: 82-2-558-5932 or 82-2-558-5934 <b>Malaysia - Kuala Lumpur</b> Tel: 60-3-6201-9857 Fax: 60-3-6201-9859 <b>Malaysia - Penang</b> Tel: 60-4-227-8870 Fax: 60-4-227-4068 <b>Philippines - Manila</b> Tel: 63-2-634-9065 Fax: 63-2-634-9069 <b>Singapore</b> Tel: 65-6334-8870 Fax: 65-6334-8850 <b>Taiwan - Hsin Chu</b> Tel: 886-3-5778-366 Fax: 886-3-5770-955 <b>Taiwan - Kaohsiung</b> Tel: 886-7-213-7830 <b>Taiwan - Taipei</b> Tel: 886-2-2508-8600 Fax: 886-2-2508-0102 <b>Thailand - Bangkok</b> Tel: 66-2-694-1351 Fax: 66-2-694-1350	<b>Austria - Wels</b> Tel: 43-7242-2244-39 Fax: 43-7242-2244-393 <b>Denmark - Copenhagen</b> Tel: 45-4450-2828 Fax: 45-4485-2829 <b>Finland - Espoo</b> Tel: 358-9-4520-820 <b>France - Paris</b> Tel: 33-1-69-53-63-20 Fax: 33-1-69-30-90-79 <b>France - Saint Cloud</b> Tel: 33-1-30-60-70-00 <b>Germany - Garching</b> Tel: 49-8931-9700 <b>Germany - Haan</b> Tel: 49-2129-3766400 <b>Germany - Heilbronn</b> Tel: 49-7131-67-3636 <b>Germany - Karlsruhe</b> Tel: 49-721-625370 <b>Germany - Munich</b> Tel: 49-89-627-144-0 Fax: 49-89-627-144-44 <b>Germany - Rosenheim</b> Tel: 49-8031-354-560 <b>Israel - Ra'anana</b> Tel: 972-9-744-7705 <b>Italy - Milan</b> Tel: 39-0331-742611 Fax: 39-0331-466781 <b>Italy - Padova</b> Tel: 39-049-7625286 <b>Netherlands - Drunen</b> Tel: 31-416-690399 Fax: 31-416-690340 <b>Norway - Trondheim</b> Tel: 47-7289-7561 <b>Poland - Warsaw</b> Tel: 48-22-3325737 <b>Romania - Bucharest</b> Tel: 40-21-407-87-50 <b>Spain - Madrid</b> Tel: 34-91-708-08-90 Fax: 34-91-708-08-91 <b>Sweden - Gothenberg</b> Tel: 46-31-704-60-40 <b>Sweden - Stockholm</b> Tel: 46-8-5090-4654 <b>UK - Wokingham</b> Tel: 44-118-921-5800 Fax: 44-118-921-5820