Product/Process Change Notice

PCN # P-1912-0012
Date: 2020/02/17

Dear Customer:

Please be informed that Macronix is going to add 2nd source assembly subcontractor to backup customer original approved assembly subcontractors for 56TSOP package products. The 2nd source assembly subcontractor is LINGSEN.

The detailed information about this change is described in the following pages. This process change has passed Macronix' qualification based on JEDEC standard, and the qualification report is attached below.

If you have any questions, concerns, or requests about this change, please contact your local Macronix Sales Representatives within 30 days, otherwise Macronix will assume customer received the PCN with no comments and the change is acceptable to the customer. Macronix follows JEDEC J-STD-046, it stipulates: ".....Lack of acknowledgement of the PCN within 30 days constitutes acceptance of the change".

Thank you.

Macronix International Co., Ltd.
旺宏電子股份有限公司

(Note: For the customers who receive Macronix PCNs via distributors, Macronix will assist the distributors to convey the PCNs to the customers. It is each distributor's responsibility to communicate and track the responses of each customers and report back to Macronix, the distributor shall assume full responsibilities if failed to do so.)

PCN No.: P-1912-0012 **Issue Date :** 2020/02/17

Subject: Adding a 2nd source assembly vendor–LINGSEN for 56TSOP package products.

Affected Macronix Part No.:

MX29GL256EHT2I-90Q, MX29GL256ELT2I-90Q, MX29GL256FDT2I-11G, MX29GL256FHT2I-90Q, MX29GL256FLT2I-90Q, MX29GL256FUT2I-11G, MX29GL512FDT2I-11G, MX29GL512FDT2I-12G, MX29GL512FHT2I-11G, MX29GL512FLT2I-11G, MX29GL512FUT2I-11G

Package type: 56TSOP package products

Change Category : New assembly vendor

Reason of Change:

To increase 56TSOP package assembly capacity and flexibility.

Before Change :

Assembly vendor:

1. SPIL

After Change :

Assembly vendors:

1. SPIL
2. LINGSEN

Product identification:

SPIL assembled IC the marking has vendor code: S

LINGSEN assembled IC the marking has vendor code: L

Assessment of Change:

1. No impact to Form, Fit, Function, Quality & Reliability.
2. LINGSEN assembled 56TSOP package has passed Macronix' qualification based on JEDEC MSL level 3 standards, and it is also Halogen-Free, and meets the RoHS standards..
   * Attached is LINGSEN assembled 56TSOP package qualification report.
3. LINGSEN has been one of Macronix' qualified assembly vendors with good quality for a long time.

Schedule:

Sample available date: 2020/2/1

1st shipping date: 2020/5/15 (Or follow PCN agreement with the customer)

MACRONIX INTERNATIONAL CO., LTD.
旺 宏 電 子 股 份 有 限 公 司

LINGSEN 56TSOP Package Qualification Report

1. PURPOSE:

To qualify 2nd source assembly subcontractor “LINGSEN” for 56TSOP package.

2. PACKAGE PROFILE:

ASSEMBLY HOUSE	LINGSEN
PACKAGE	56TSOP (14X20 mm)
DIE SIZE	8386 x 7016 μm^2
DIE ATTACH	Sumitomo CRM-1076WA
LEAD FRAME	Copper
WIRE BOND MATERIAL	Au
MOLD COMPOUND	Sumitomo EME-G700
LEAD FINISH	Matte Sn

3. QUALIFICATION ITEMS, TEST CONDITION AND FLOW:

3-1. QUALIFICATION ITEMS:

Test Item	Reference	Test Condition
1. Heat Resistance Test: Reflow Test	JEDEC J-STD-020	MSL: Follow JEDEC MSL Level 3 (30℃/ 60%RH, 192hrs)
2. Pressure Cooker Test	JESD22-A102	121℃/ 100%RH/ 2atm
3.Temperature Cycling Test	JESD22-A104	-65℃ ~150℃
4. Highly Accelerated Temperature and Humidity Stress Test	JESD22-A110	130℃/ 85% RH, Bias: 3.6V
5.High Temperature Storage Life Test	JESD22-A103	150℃
6. Solderability Test	JESD22-B102	■ Steam aging 8hrs & Dipping Time≦ 5sec ■ Sn-Ag-Cu solder paste: 245℃ ■ Sn-Pb solder paste: 235℃

*Perform SAT examination before and after Preconditioning per JESD22-A112.

MACRONIX INTERNATIONAL CO., LTD.
旺 宏 電 子 股 份 有 限 公 司

3-2. HEAT RESISTANT TEST (REFLOW TEST) AND RELIABILITY TEST FLOW

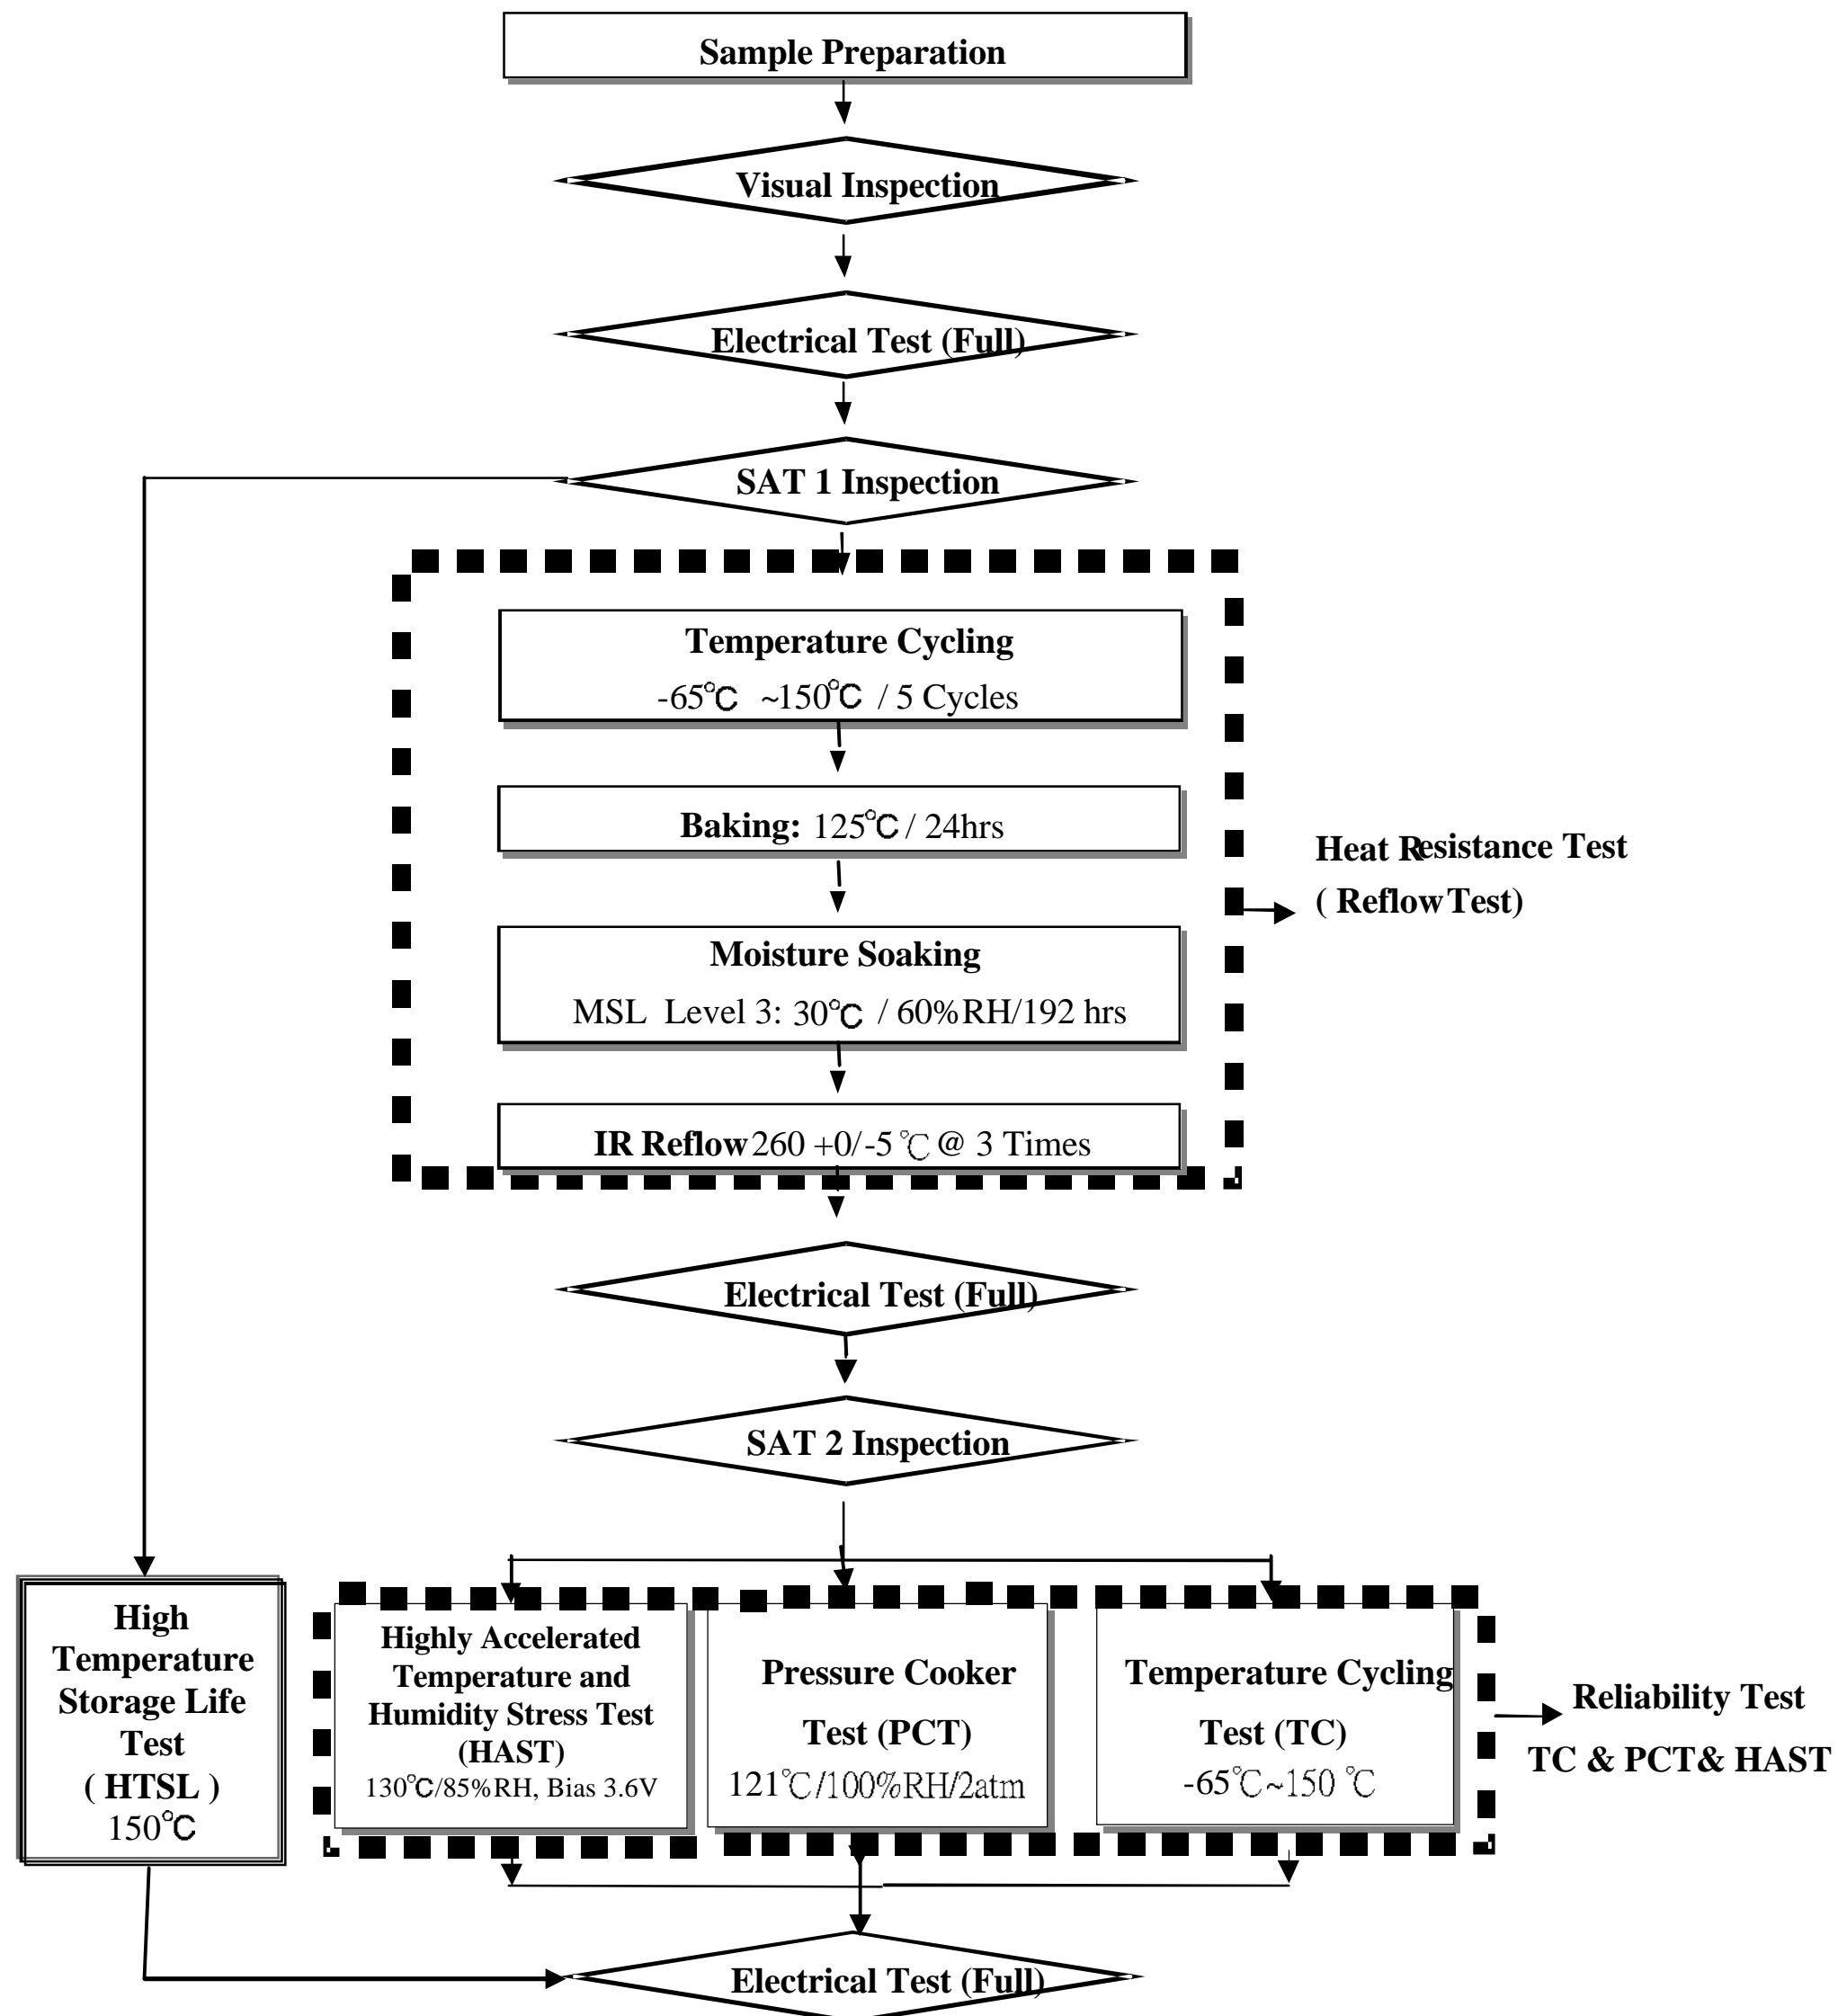

MACRONIX INTERNATIONAL CO., LTD.
旺 宏 電 子 股 份 有 限 公 司

3-2-1. REFLOW PROFILE:

Ra Lab Reflow Test Data

Equipment Name：	IR Reflow
Equipment Model：	SIERRA THERM/3K16-63C42-7AN
委託單號：	R-2019080251-53
Test Date：	2019/8/16

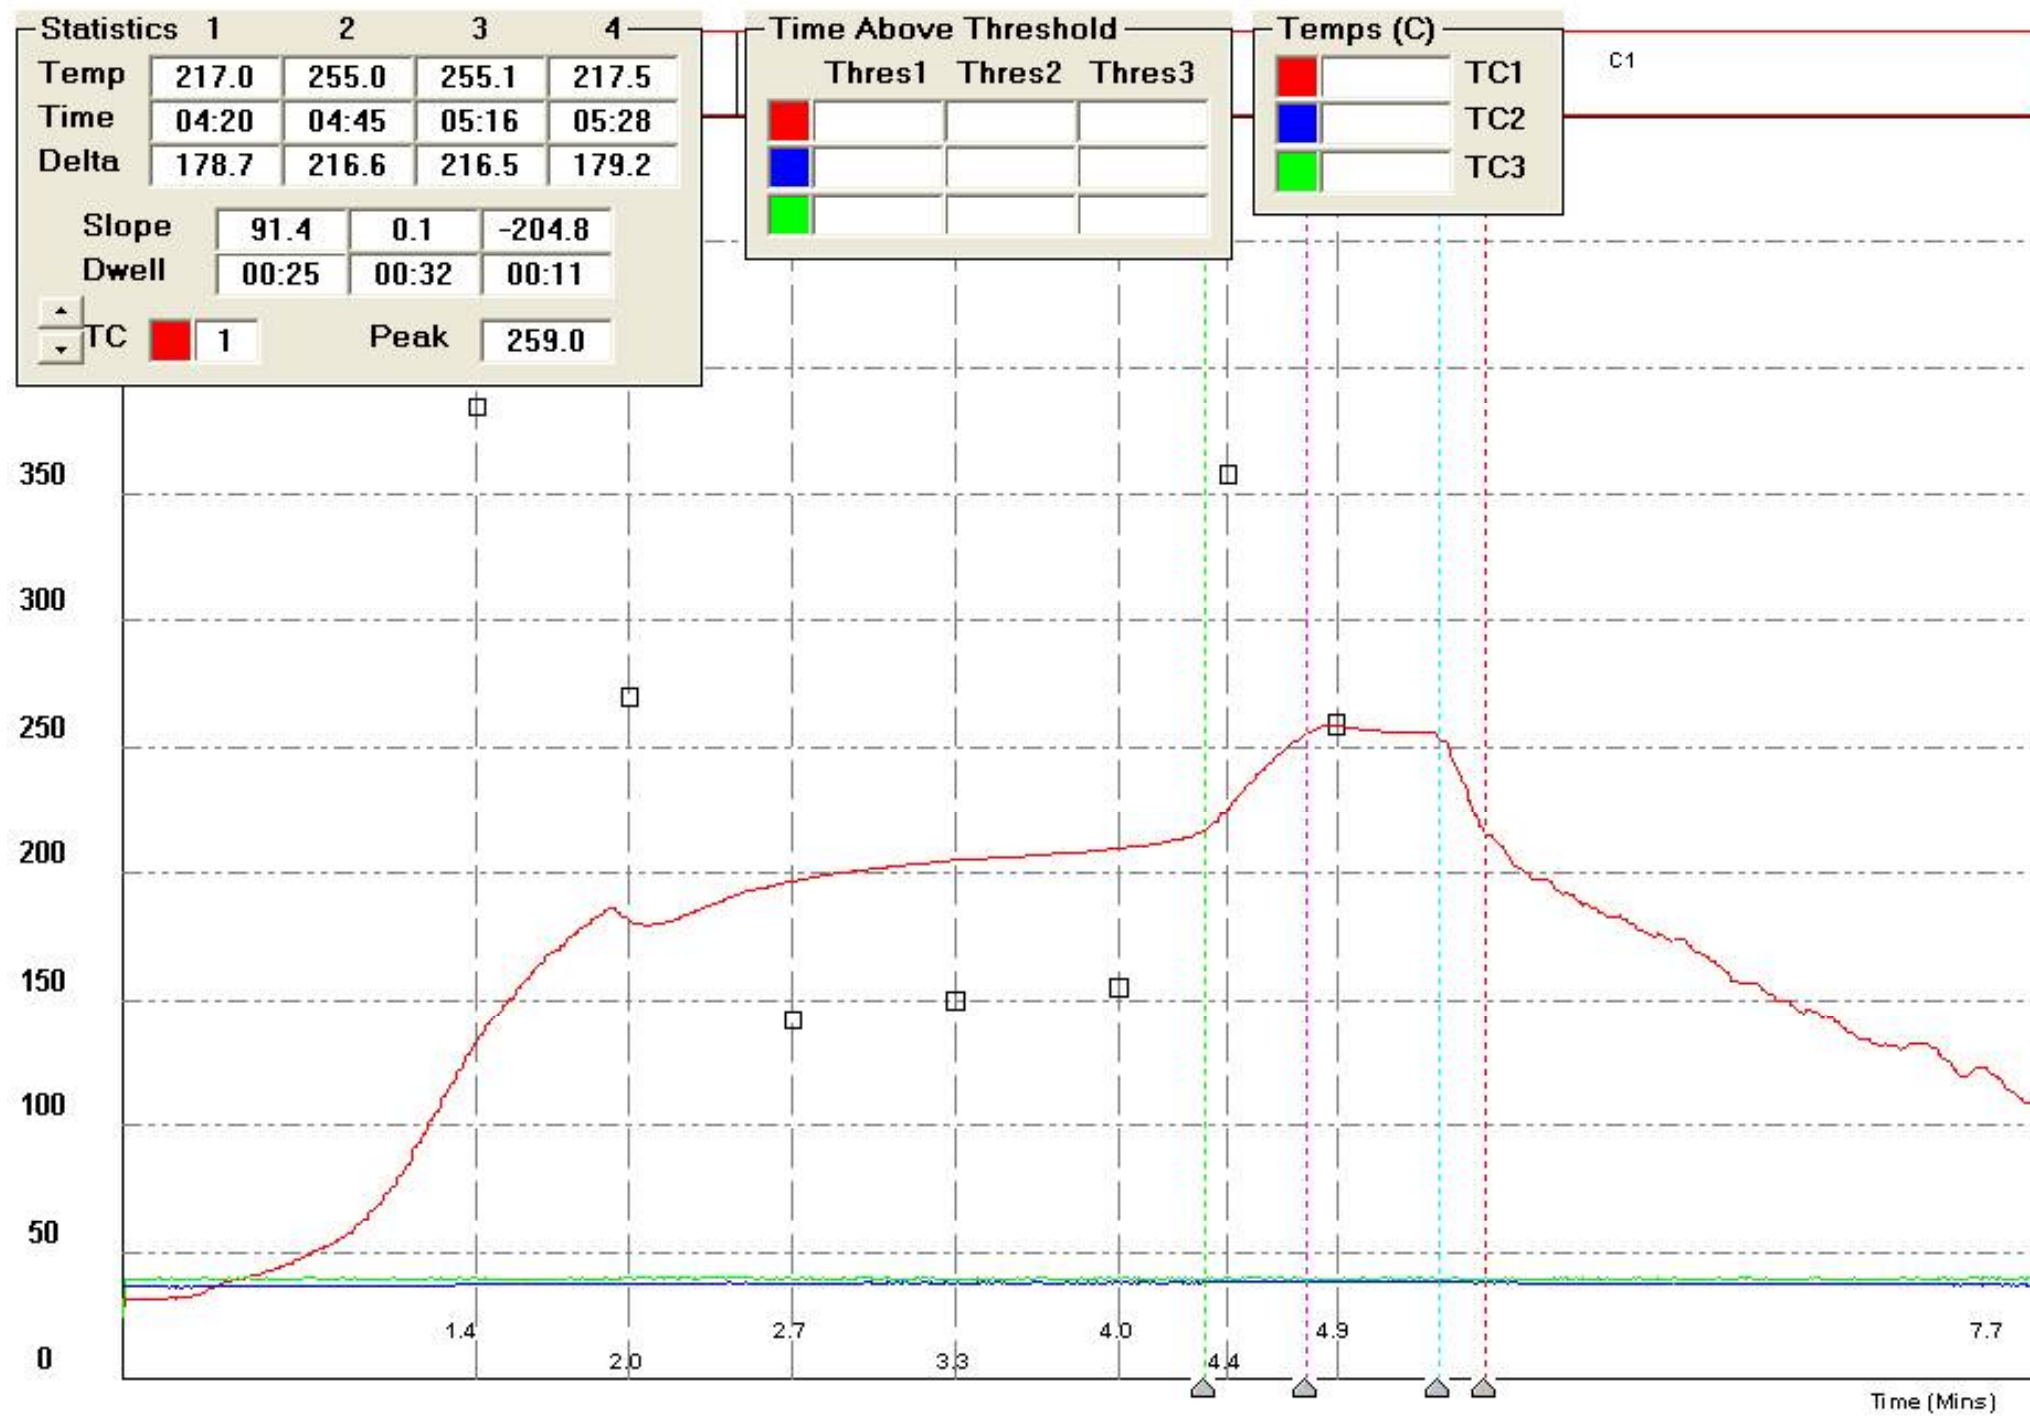

	Ramp-up rate(1)：	Pre-heat time：	Ramp-up rate(2)：	Peak Temperature：	Soldering Zone	Ramp-down rate：	結果判定
Temp rang	50~150℃	150~200℃	217~255℃	260+0/-5℃	217~217℃	255~217℃	Pass
Spec	1.5~3℃/Sec	60~120Sec	1.5~3℃/Sec	30~40Sec	60~150Sec	＜6℃/Sec	
Data	2.05	77	1.52	31	68	3.13	

Note 1: Subject the samples to 3 cycles of the above defined reflow conditions

Note 2: Time 25℃ to peak temperature: 8 minutes max.

Note 3: The time between reflows shall be 5 minutes minimum and 40 minutes maximum.

3-2-2. CRITERIA:

LTPD= 3%, PCT 96 hours and TC 500 cycles & HAST 96 hours & HTSL 500 hours.

3-2-3. REFERENCE SPECIFICATION:

5650-0901: ASSEMBLY RELIABILITY QUALIFICATION SPEC

MACRONIX INTERNATIONAL CO., LTD.
旺 宏 電 子 股 份 有 限 公 司

3-3. SOLDERABILITY TEST FLOW

Sample Preparation

Visual Inspection

Fail → *Reject*

Pass

Pre-process: Steam aging
$93 \pm 3\ ^{o}C$, 8hours

Solder Paste Category

Sn-(3.0-4.0)Ag-0.5Cu

Dip & look Test:
Solder bath temperature: 245 ^{o}C
Dipping time ≤ 5 sec

63Sn-37Pb

Dip & look Test:
Solder bath temperature: 235 ^{o}C
Dipping time ≤ 5 sec

Inspection Solder Coverage > 95%

Fail → *Reject*

Pass

MACRONIX INTERNATIONAL CO., LTD.
旺 宏 電 子 股 份 有 限 公 司

4. RESULTS:

4-1. HEAT RESISTANCE TEST and RELIABILITY TEST RESULTS:

PRODUCT	6709		
LOT#	8F369200BD	8F369200B8	8F369200BC
DATE CODE	L1929	L1929	L1930
SAT 1	0/22	0/22	0/22
PRECON	0/231	0/231	0/231
SAT 2	0/22	0/22	0/22
PCT 96 HRS	0/77	0/77	0/77
TC 500 CYC	0/77	0/77	0/77
HAST 96 HRS	0/77	0/77	0/77
HTSL 500 HRS	0/45	0/45	0/45

FAIL / SAMPLE SIZE

4-2. SOLDERABILITY TEST RESULTS:

Matte Sn Plating

Plating Material	Matte Sn		
Solder Paste Material	Sn-(3.0-4.0)Ag-0.5Cu		
INSPECTION	0/5	0/5	0/5

FAIL / SAMPLE SIZE

Plating Material	Matte Sn		
Solder Paste Material	63Sn-37Pb		
INSPECTION	0/5	0/5	0/5

FAIL / SAMPLE SIZE

5. CONCLUSION: PASS

MACRONIX INTERNATIONAL CO., LTD.
旺 宏 電 子 股 份 有 限 公 司

6. ATTACHED FILE:

6-1. SAT PHOTO

6-1-1. BEFORE PRE-CONDITION

a1.Lot no#8F369200BD: Topside of package	a2.Lot no#8F369200BD: Backside of package
b1.Lot no#8F369200B8: Topside of package	b2.Lot no#8F369200B8: Backside of package
c1.Lot no# 8F369200BC: Topside of package	c2.Lot no#8F369200BC: Backside of package

6-1-2. AFTER PRE-CONDITION

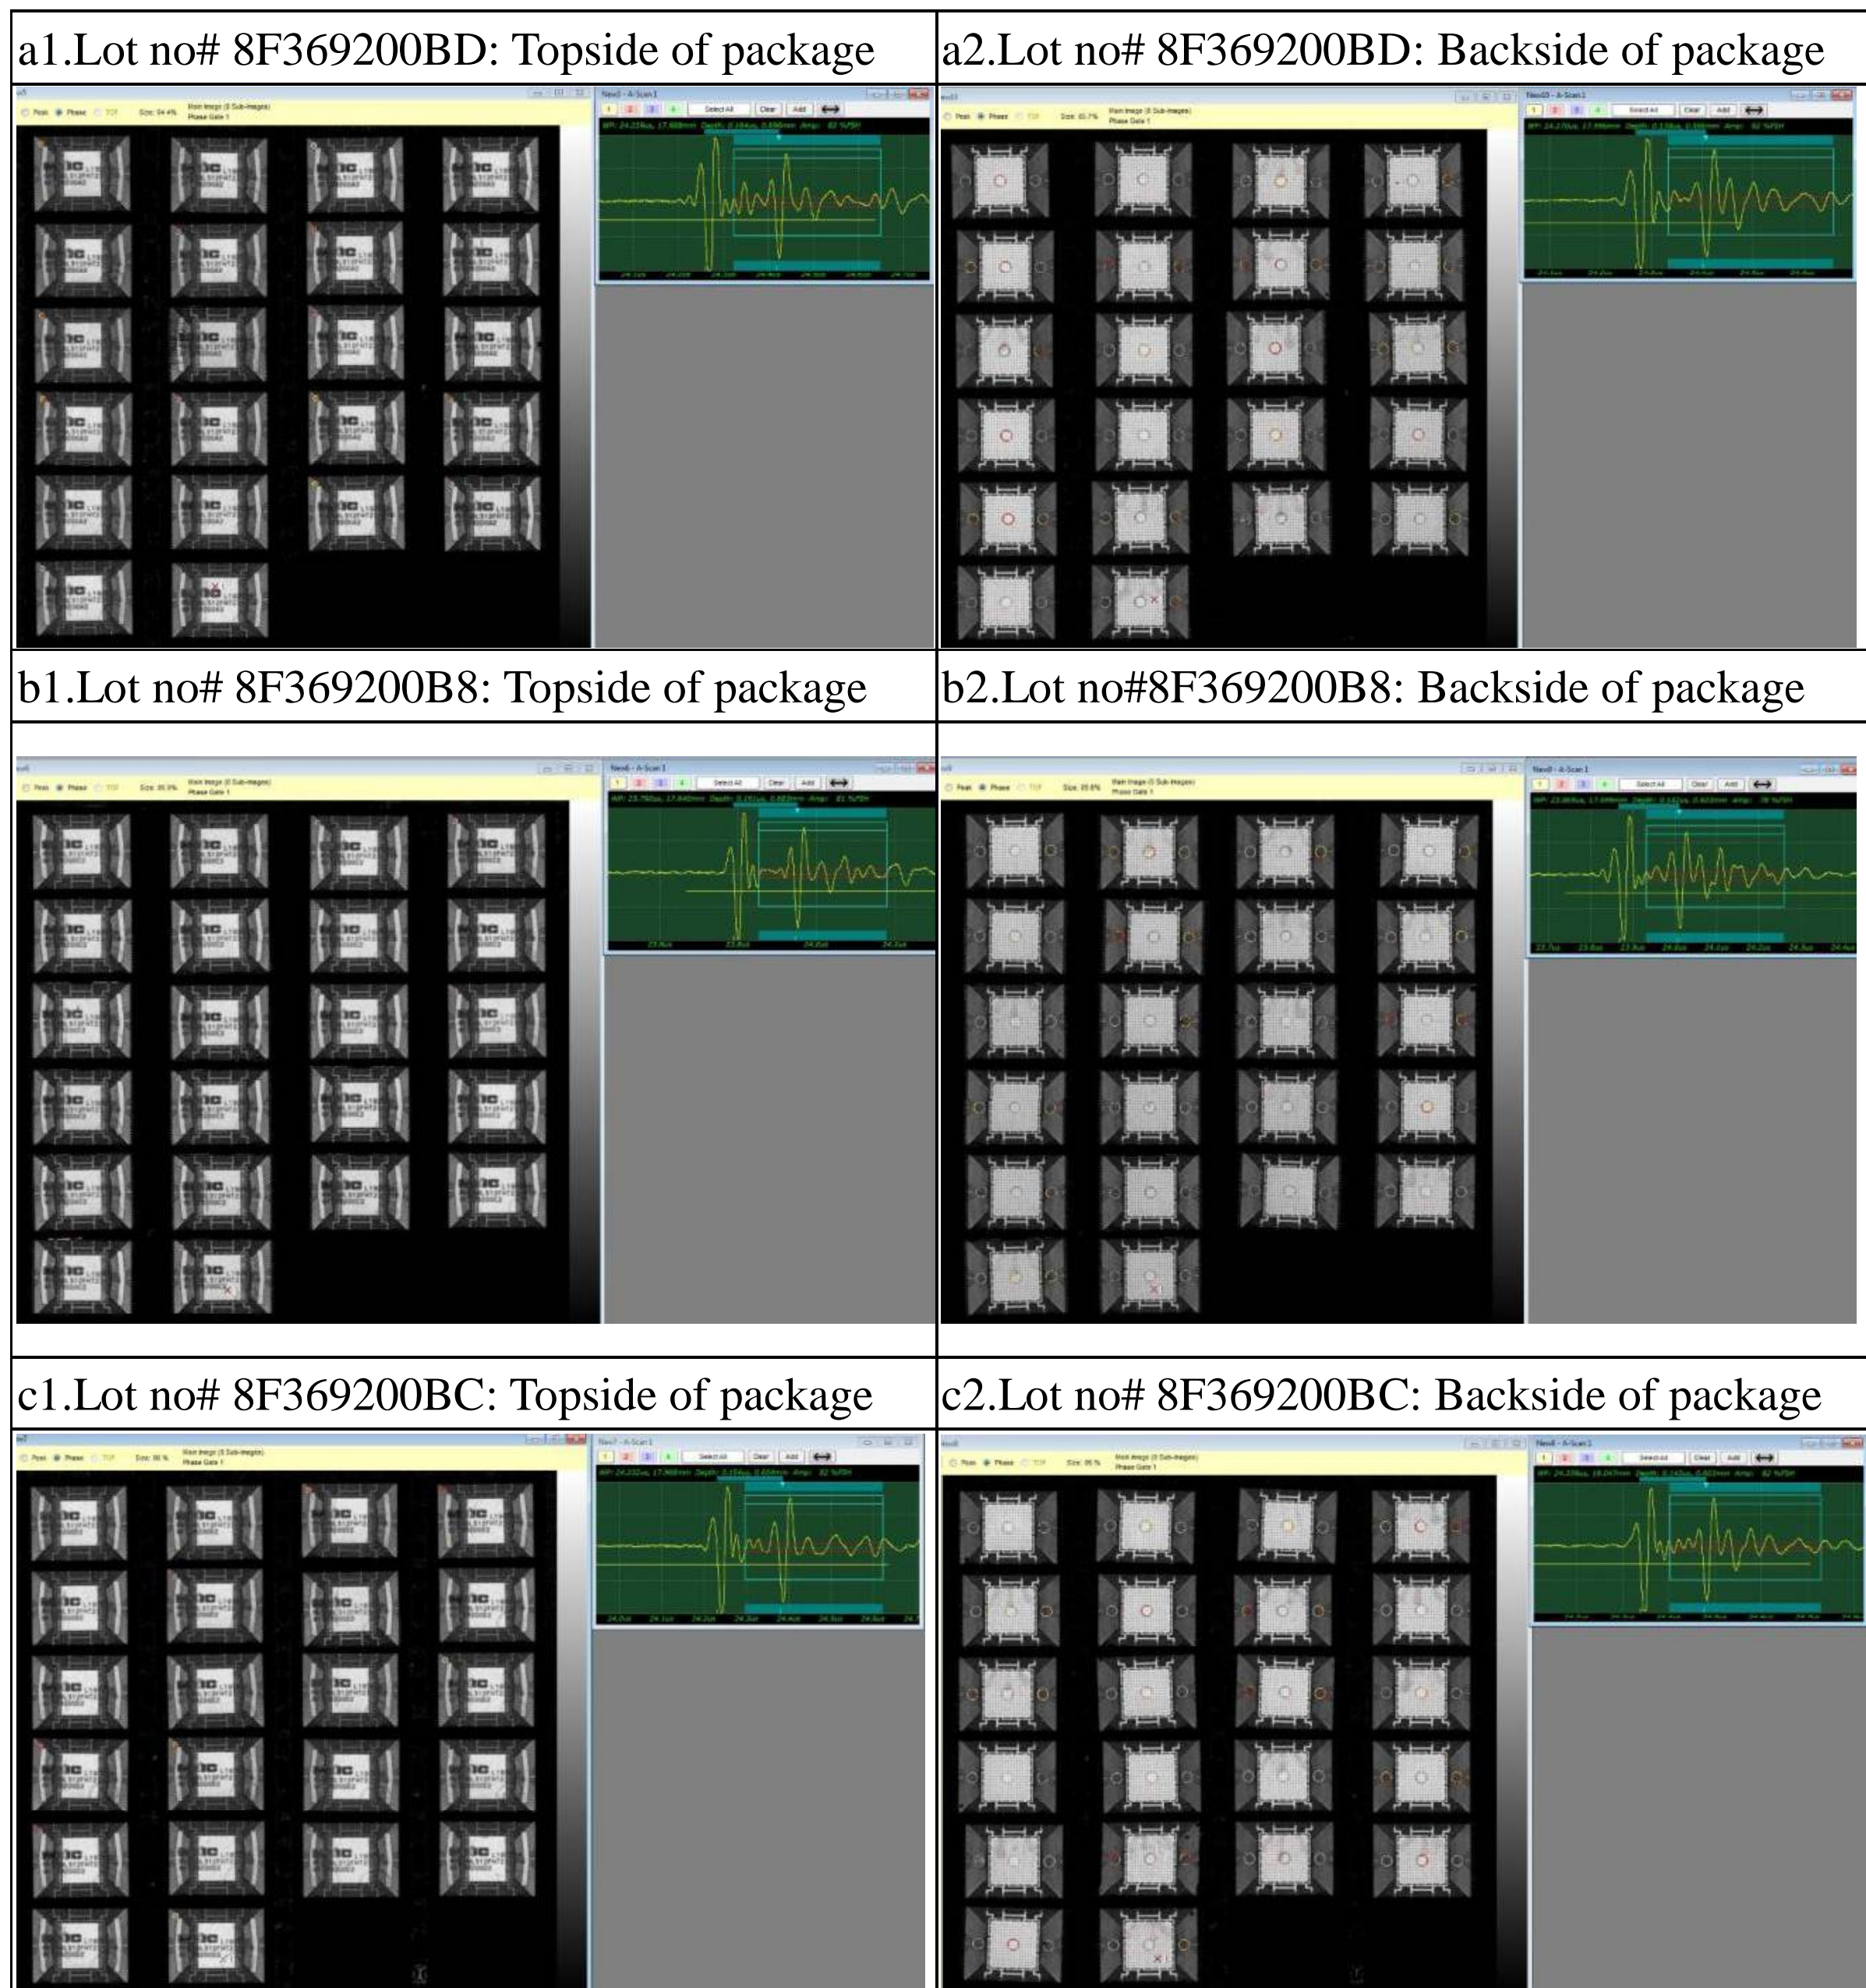

a1.Lot no# 8F369200BD: Topside of package	a2.Lot no# 8F369200BD: Backside of package
b1.Lot no# 8F369200B8: Topside of package	b2.Lot no#8F369200B8: Backside of package
c1.Lot no# 8F369200BC: Topside of package	c2.Lot no# 8F369200BC: Backside of package